
TASK NO.	TASK/DESCRIPTION	NOTES
	H6 EXTERNAL LADDERS	
H6.01	Main Mast Ladder Chains	Hotwork Required – Appropriate precautions to be taken iaw General 8.4.
		IAW Paint scheme -General 12 and Annex B refer.
	Main mast lower ladder rungs port and stbd have total breakdown of paint coating and excessive active corrosion which has reduced rung cross sectional area to approx. 50% of original. REFURBISH ladder, RENEW ladder rungs and REPRESERVE on completion. ALLOW for 30 Rungs total. ALLOW for 10m ² REPRESERVATION.	

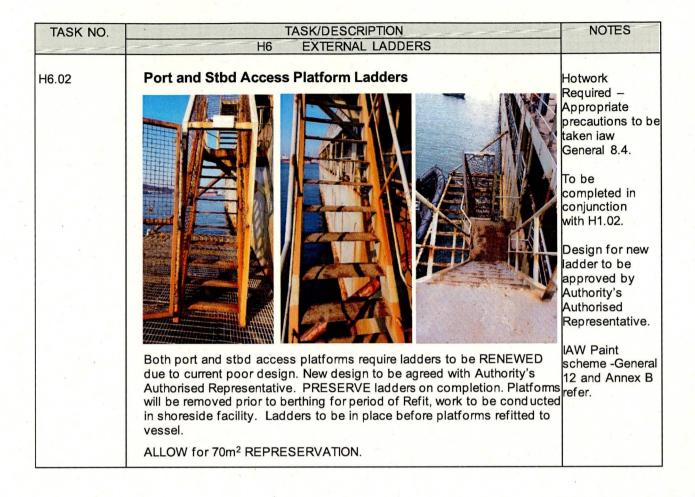

TASK NO.	TASK/DESCRIPTION	NOTES
	H6 EXTERNAL LADDERS	
H6.03	<image/>	Hotwork Required – Appropriate precautions to be taken iaw General 8.4. IAW Paint scheme -General 12 and Annex B refer. Complete IAW Ref. 5.
	All upper deck ladders paint coatings are breaking down with active corrosion evident on ladder treads. Ladders to be SURVEYED and treads RENEWED as required. Ladder handrails also require SURVEY, RENEW as required and REPRESERVE on completion.	
	ALLOW for 10 Ladder rungs and 6 handrail RENEWAL. ALLOW for 300m ² REPRESERVATION.	

TASK NO.	TASK/DESCRIPTION	NOTES
	H6 EXTERNAL LADDERS	maken ****
H6.04	Crane Deck LadderImage: Strain of the	IAW Paint scheme -General 12 and Annex B refer.
	lockable 'No Access' grill is to be manufactured and fitted to the ladder cage. Ladder and cage to be REPRESERVED following removal of broken down paint coatings.	
	ALLOW for 3m ² REPRESERVATION.	