


TASK NO.	TASK/DESCRIPTION	NOTES
H7.04	<p data-bbox="694 295 933 353">H7 BILGES</p> <p data-bbox="411 387 992 421"><b>Bow Door and Vehicle Ramp Compartment</b></p>  <p data-bbox="411 1191 1252 1310">Although dry at time of visit, evidence of previous free standing water in bilge of compartment which has lead to total breakdown of bilge coatings resulting in active corrosion. Bilges to be cleaned and dried to allow for scaling back, preparing and REPRESENTATION of affected areas.</p> <p data-bbox="411 1321 853 1355">ALLOW for 20m<sup>2</sup> REPRESENTATION.</p>	<p data-bbox="1252 392 1452 504">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1252 537 1412 649">Contractor to remove and dispose of all arisings.</p> <p data-bbox="1252 683 1452 851">Adequate ventilation to be arranged before work commences IAW General 3.2.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.01	<p data-bbox="403 387 815 421"><b>Internal Training Door Frames</b></p> <div data-bbox="403 439 1201 882">  </div> <p data-bbox="403 898 1214 1095">Manufacture and RENEW 15 doorframes, and manufacture 5 further as spares. These door frames are fitted to the temporary bulkheads which divide the galley area into training zones. Each frame is used to easily hang a standard 176mm x 198mm x 35mm internal door which normally only lasts as long as each training session. The steel frames have themselves now been damaged after repeated use and require RENEWAL.</p> <p data-bbox="403 1106 1214 1229">The existing frames are manufactured from 2 sizes of mild steel square section to produce the outer frame and inner door stop. On the hinge side there are 2 clamp plates which allows a standard hinge to be quickly secured. The doors are secured shut by a simple rotating latch.</p> <p data-bbox="368 1234 1214 1290">All frames and surrounding area to be PRESERVED in red paint as shown.</p> <p data-bbox="403 1301 847 1335">ALLOW for 10m<sup>2</sup> REPRESENTATION.</p>	<p data-bbox="1249 387 1453 562">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.02	<p data-bbox="408 389 584 421"><b>Galley Doors</b></p>  <p data-bbox="408 1171 1214 1279">The main steel galley access doors (x3) have been damaged and the latching mechanism no longer functions correctly. Doors to be REFURBISHED. If unable to repair then new doors to be supplied and RENEWED.</p>	

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.03	<p><b>Stbd Troop Accommodation Area Access Ladder</b></p> <p>Access ladder to stbd troop accommodation compartment has loose ladder handrails. Ladder rails to be resecured.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4</p>

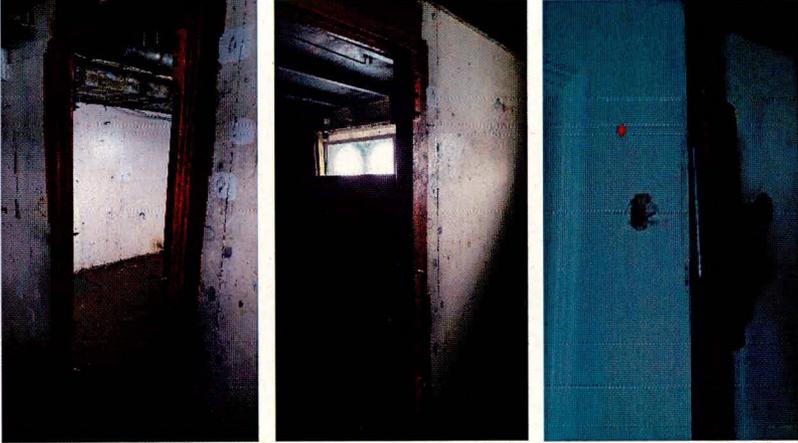