





TASK NO.	TASK/DESCRIPTION		NOTES
	H8	INTERNAL DECKS, DOORS AND LADDERS	
H8.01	Internal Training Door Frames <div data-bbox="402 432 1197 878" data-label="Image"> </div> <p>Manufacture and RENEW 15 doorframes, and manufacture 5 further as spares. These door frames are fitted to the temporary bulkheads which divide the galley area into training zones. Each frame is used to easily hang a standard 176mm x 198mm x 35mm internal door which normally only lasts as long as each training session. The steel frames have themselves now been damaged after repeated use and require RENEWAL.</p> <p>The existing frames are manufactured from 2 sizes of mild steel square section to produce the outer frame and inner door stop. On the hinge side there are 2 clamp plates which allows a standard hinge to be quickly secured. The doors are secured shut by a simple rotating latch.</p> <p>All frames and surrounding area to be PRESERVED in red paint as shown.</p> <p>ALLOW for 10m² REPRESENTATION.</p>		Hotwork Required – Appropriate precautions to be taken iaw General 8.4.


TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.02	<p>Galley Doors</p>  <p>The main steel galley access doors (x3) have been damaged and the latching mechanism no longer functions correctly. Doors to be REFURBISHED. If unable to repair then new doors to be supplied and RENEWED.</p>	

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.03	Stbd Troop Accommodation Area Access Ladder Access ladder to stbd troop accommodation compartment has loose ladder handrails. Ladder rails to be resecured.	Hotwork Required – Appropriate precautions to be taken iaw General 8.4

TASK NO.	TASK/DESCRIPTION		NOTES
	H8	INTERNAL DECKS, DOORS AND LADDERS	
H8.04	Stbd Troop Accommodation Compartment Deck  <p>Following a compartment flood, the deck screed has broken down in certain areas. Damaged screed to be removed to SURVEY steel deck below. Compartment requires confirmed dry (possible dehumidifiers required) with screed RENEWED and REPRESENTED on completion.</p> <p>ALLOW for 6m² screed RENEWAL. ALLOW for 6m² REPRESENTATION.</p>		<p>Adequate ventilation to be arranged before work commences IAW General 3.2.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.05	<p>Tank Deck Training Area Ladders</p>  <p>Both tank deck gantry access ladders showing breakdown of paint coverings. REPRESENT both ladders.</p> <p>ALLOW for 5m² REPRESENTATION.</p>	IAW Paint scheme -General 12 and Annex B refer.

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.06	<p>Main Engine Room Deckplates</p> <div data-bbox="406 470 1236 840"></div> <p>Engine room deckplates are loose in many areas and require re-securing. Some deckplates are missing. All loose items currently blocking access throughout engine room walkways are to be removed and disposed of. Deckplates to be re-secured and missing deckplates manufactured and replaced with comparable checker-plate to current fit.</p> <p>ALLOW for 80 man hours. ALLOW for 15m² deckplate replacement.</p>	

TASK NO.	TASK/DESCRIPTION	NOTES
	H8 INTERNAL DECKS, DOORS AND LADDERS	
H8.07	<p>Machinery Control Room</p> <div data-bbox="399 468 1181 1052"></div> <p>The Machinery Control Room (MCR) is currently not used for training purposes and contains a large amount of unused material. Contractor is to remove and dispose of all loose material to allow it to become a the training zone.</p>	<p>To be done in conjunction with L1.02 – Training Zone Lighting</p>