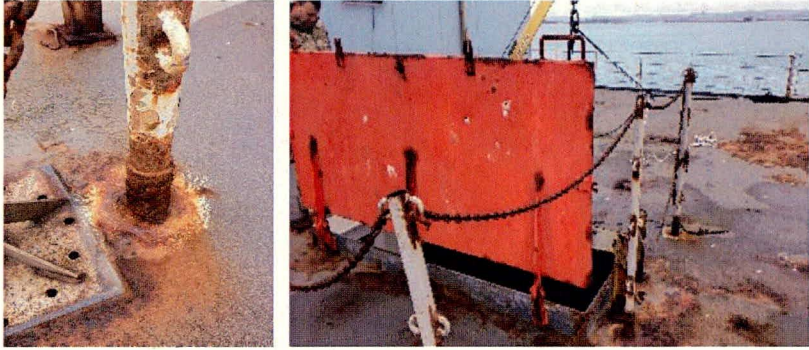

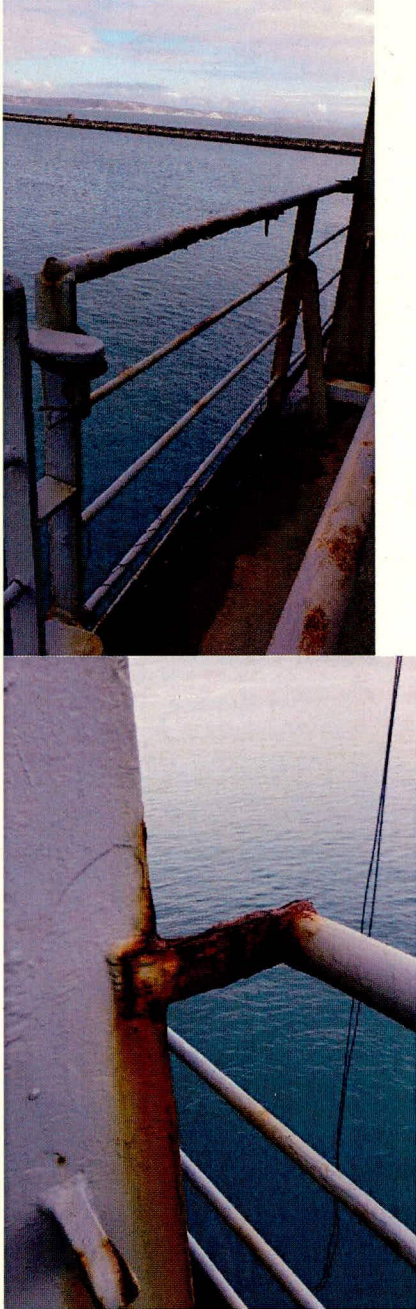


TASK NO.	TASK/DESCRIPTION		NOTES
	H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.01	Vehicle Deck Guardrails <div data-bbox="397 434 1107 837">  </div> <p>Vehicle deck guardrail stanchions paint coatings are breaking down with active corrosion present at deck connection points. REPRESENTATIVE coatings.</p> <p>Allow for 15m² REPRESENTATION.</p>		<p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.17.</p> <p>Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION		NOTES
	H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.02	CASEVAC Hatch Guardrails  <p>CASEVAC hatch guardrail stanchions and stanchion deck supports have total paint covering breakdown with active corrosion present. Stanchion chains also suffering from active corrosion. SURVEY guardrail stanchion deck supports and RENEW as required. REPRESENTATIVE coatings on stanchion supports and stanchions. RENEW associated chains and shackles.</p> <p>ALLOW for 10m² REPRESENTATION.</p>		<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>To be completed in conjunction with H2.17 and H4.01.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>Complete IAW Ref. 5.</p>

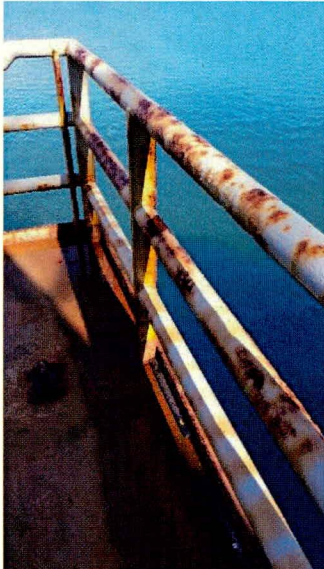
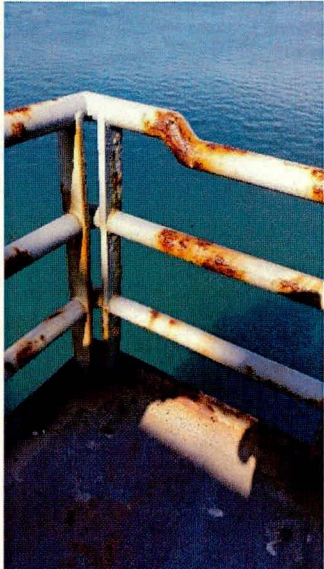
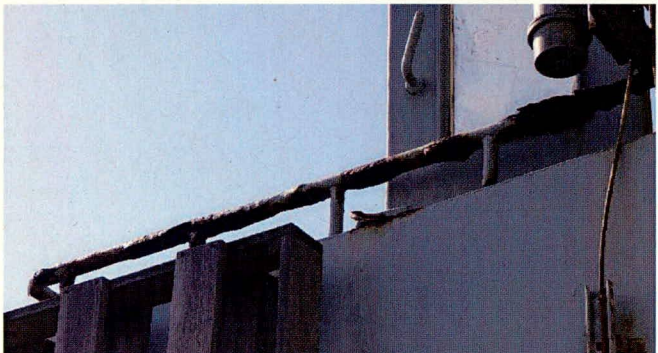
TASK NO.	TASK/DESCRIPTION	NOTES
	H3 HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.03	<p data-bbox="400 383 839 416">Forecastle Guardrail Stanchions</p> <div data-bbox="400 432 1174 869">  </div> <p data-bbox="400 887 1209 972">Both guardrail stanchions on the port side of the forecastle are bent and heavily corroded. REPLACE stanchions and REPRESENT deck and guardrails.</p> <p data-bbox="400 987 831 1016">ALLOW for 2m² REPRESENTATION.</p>	<p data-bbox="1251 383 1449 562">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1251 589 1449 701">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1251 728 1449 786">Complete IAW Ref. 5.</p>


TASK NO.	TASK/DESCRIPTION	NOTES
	H3 HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.04	Guardrail 01 Deck 	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.11.</p> <p>Complete IAW Ref. 5.</p>

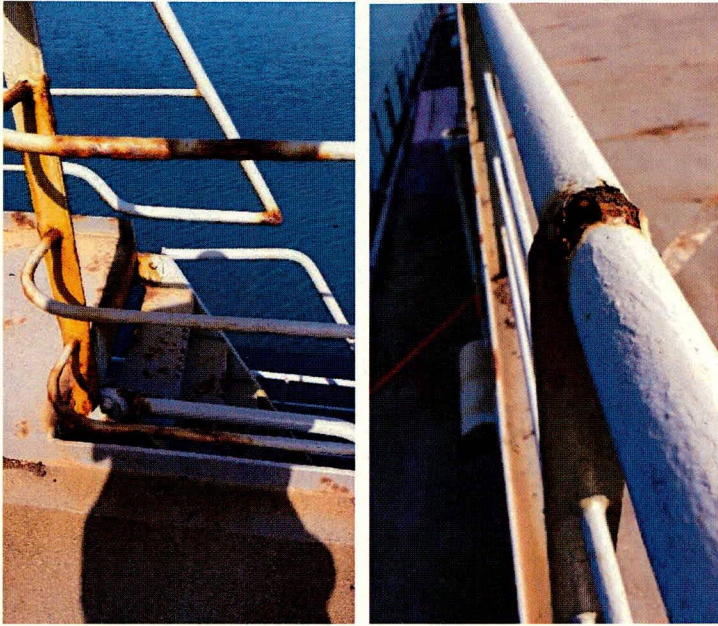



Guardrails have total paint covering breakdown in areas which has led to total thickness corrosion of tubular guardrails. Affected areas to be RENEWED including intermediate rails and end support fixings as shown. PRESERVE on completion.

ALLOW for 10m top rail and 6m intermediate rail RENEWAL. ALLOW for 6m² REPRESENTATION.

TASK NO.	TASK/DESCRIPTION		NOTES
	H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.05	Port and Stbd Bridge Wing Guardrails <div style="display: flex; justify-content: space-around;">   </div>  <p>Stbd bridge wing guardrails show paint covering breakdown and active corrosion. REPRESENT all stbd guardrails. Port guardrail has severe full thickness active corrosion and requires RENEWAL.</p> <p>ALLOW for 8m guardrail RENEWAL. ALLOW for 20m² REPRESENTATION.</p>		<p>Hotwork Required – Appropriate precautions to be taken IAW General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.15.</p> <p>Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION		NOTES
	H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.06	<p>Gundeck Guardrails</p>  <p>Strikable guardrails port and stbd are damaged and not fit for purpose. RENEW with fixed stanchions and permanent guardrails as fitted elsewhere on board. PRESERVE guardrails and deck area on completion.</p> <p>ALLOW for 15m guardrail RENEWAL. ALLOW for 10m² REPRESENTATION.</p>		<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H3 HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.07	<p data-bbox="411 387 715 421">Flight Deck Guardrails</p> <div data-bbox="408 436 1129 1059">  </div> <p data-bbox="411 1075 1212 1160">The flight deck guardrails have areas of paint coating breakdown and active corrosion present. The top rail has suffered full thickness corrosion penetration and requires RENEWAL in certain areas.</p> <p data-bbox="411 1193 1212 1249">ALLOW for 8m top rail RENEWAL ALLOW for 10m² REPRESENTATION of all rails.</p>	<p data-bbox="1254 394 1449 562">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1254 595 1449 703">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1254 736 1422 792">Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION		NOTES
	H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.08	Aft Suspended Walkway Guardrails <div data-bbox="397 430 1203 896">  </div> <p>The aft suspended walkway guardrails are damaged and have areas of full thickness penetration due to corrosion on the top rail. REPLACE damaged lengths of top rail and also lengths of damaged/corroded/missing intermediate rails.</p> <p>ALLOW for 8m top rail and 30m intermediate rail RENEWAL. ALLOW for 15m² REPRESENTATION.</p>		<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>Complete IAW Ref. 5.</p>