

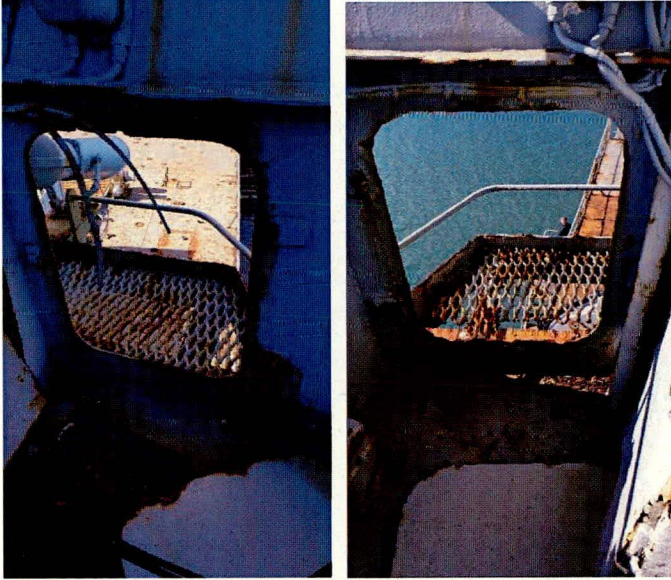
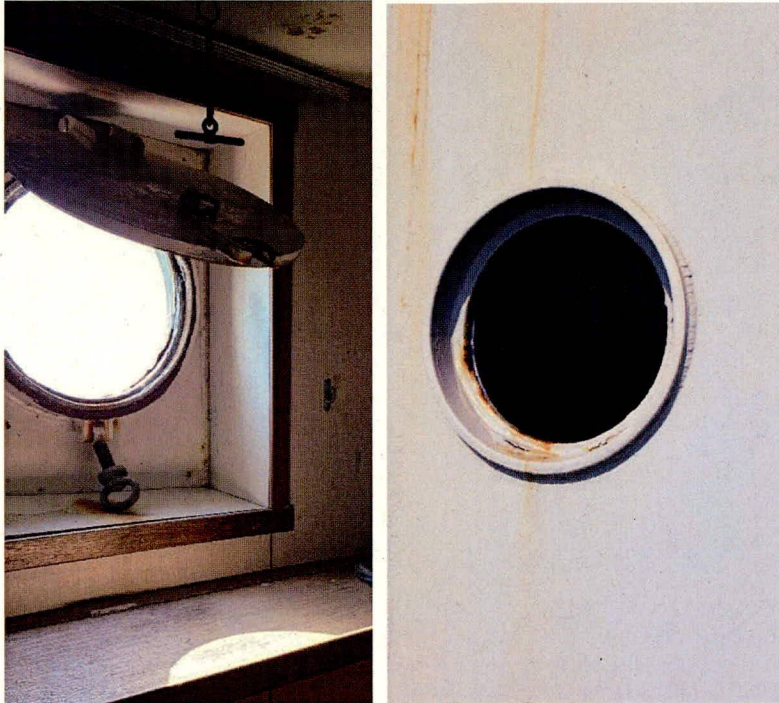



TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.01	<p>CASEVAC Hatch</p>  <p>The CASEVAC hatch located fwd on the vehicle deck is stiff to open and the hold-back facility inoperative. REMOVE and REFURBISH Vehicle deck CASEVAC hatch and hold back facility. REPRESENT all affected areas on completion. ALLOW for 4m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H3.02.</p>


TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.02	<p>Stbd Shade Deck Hatch</p>  <p>Fwd stbd shade deck hatch has unrequired wooden cover. Cover to be removed to inspect condition of hatch beneath. REPRESENT/REPAIR hatch as required. REPRESENT coatings on hatch and hatch combing on completion ALLOW for 8m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>Iaw Paint scheme -General 12 and Annex B refer.</p>



TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.03	<p>Upper Deck Doors</p>  <p>Many upper deck doors are seized or stiff to move with no ability to securely close. REFURBISH doors to include renewal of rubber seals and repair any excessively corroded areas. All clips to be freed up and greased, or RENEWED if beyond repair. Doors will be placed in priority order with list provided to the Contractor prior to RPSD. REPRESENTATION on completion of any required work.</p> <p>ALLOW for 30 doors. ALLOW for 60m² REPRESENTATION.</p>	<p>Awaiting Escape, Evacuation and Rescue report to aid priority listing.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p>

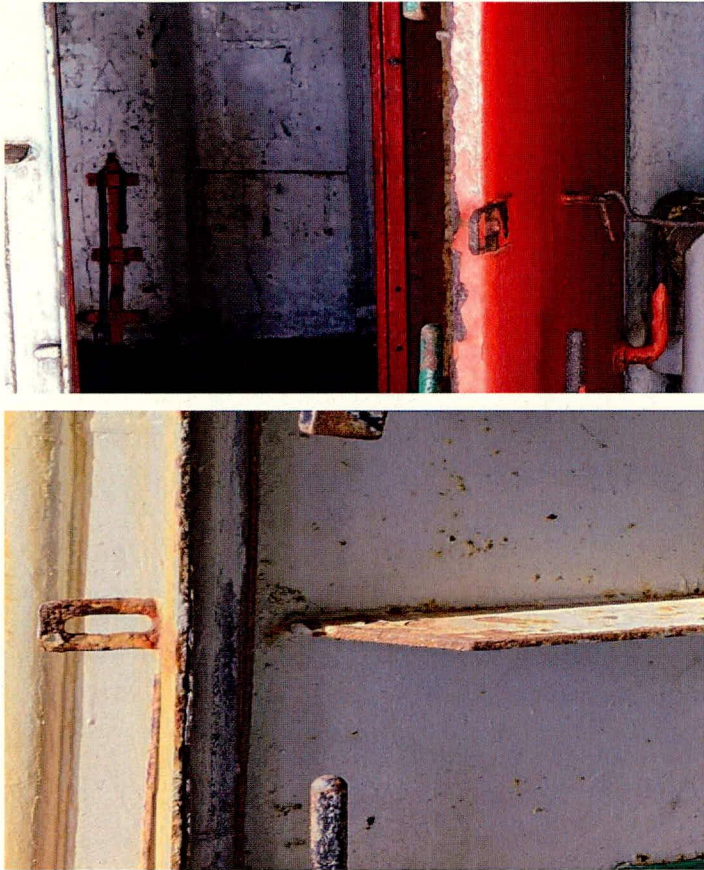
TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.04	<p>Bridge Wing Access Panels to Light Boom</p>  <p>Port and stbd bridge wing access doors to flight lighting booms have both suffered excessive corrosion on hinges resulting in doors becoming detached. RENEW door hinges and refit doors. REPRESENT on completion.</p> <p>ALLOW for 4m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.15 and H3.05.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.05	<p>Cabin Porthole</p> <div data-bbox="406 436 1189 1137"></div> <p>Cabin 01Z0 porthole flap is seized open and porthole glass has become detached leaving an opening for rain ingress. Hinged flap to be freed up and sealed shut with appropriate weatherproof sealant.</p>	

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.06	<p>Upper Deck Intakes and Watertight Openings</p>  <p>Numerous upper deck vent grills and hinged watertight openings have corroded beyond repair. Steel blanks to be manufactured and used to REPLACE existing openings. Relevant openings will be identified prior to Refit start date. PRESERVE on completion.</p> <p>ALLOW for 15 openings. ALLOW for 45m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>Iaw Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.07	<p>Natural Vent Covers</p>  <p>01 deck stbd side. 4 in number vent openings heavily corroded with full thickness rust penetration. All 4 openings to be REMOVED, with blanks welded in place. Area to be REPRESENTED on completion.</p> <p>ALLOW for 4m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>Contractor to dispose of removed items.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.08	<p data-bbox="400 389 842 418">Transom Access Door and Deck</p> <div data-bbox="400 432 943 777">  </div> <div data-bbox="400 779 708 1256">  </div> <p data-bbox="400 1272 1214 1473">Transom door closing mechanism is worn and regularly seizes, door does not seal properly (daylight can be seen through sealing faces when closed). Remove and REFURBISH door – to include new door seal. Platform support brackets and door frame have paint coating breakdown with active corrosion evident. REPRESENT affected areas. Chalk test to be carried out once door is refitted and door adjusted accordingly.</p> <p data-bbox="400 1487 1214 1547">Note: Wooden blank to be manufactured and fitted in place of rear door whilst REFURBISHMENT of door taking place.</p> <p data-bbox="400 1561 842 1590">ALLOW for 10m² REPRESENTATION.</p>	<p data-bbox="1251 389 1437 533">Wooden blank to be fitted whilst door is being REFURBISHED.</p> <p data-bbox="1251 562 1449 734">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1251 763 1449 875">IAW Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.09	<p>Door Locking Arrangements</p>  <p>Upper deck door locking arrangements are seized in numerous locations. Contractor is to free up /RENEW hasp and staple fittings on all associated doors as required. REPRESENT on completion.</p> <p>ALLOW for 7m² REPRESENTATION. ALLOW for 23 doors.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p>