

Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken into 4 main pieces, with some sections missing

Surface condition :

Organic growth

Some green staining

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

Corroded

Iron cramps fixing headstone to granite base?

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

A

General comments:

Granite base has since been re-erected, with broken headstone attached (see photo). High risk of further loss.

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Sink granite base into ground to original depth in original location. Pin surviving sections (4? no plus base) together to 25mm thick slate backing. Make good joints with mortar. Refix to granite base and re-erect headstone.

Schedule of Work clauses:

2.01 and 2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Broken pieces on the ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION	Monument reference:	J05	Date surveyed:	10 January 2020
	Name of burial (if known):	(Possibly) Kitty Solomon	Date of burial:	1846
	Others commemorated:	Sarah Killa	Date of burial:	1846
	Monument type:	Headstone	Heritage designation:	SAM
	Headstone dimensions (in mm):	Height: 1170	Width: 760	Thickness: 75
	Tomb dimensions (in mm):	Height: 0	Width: 0	Length: 0
	Designer/sculptor/mason:	Unknown	Orientation:	North

DESCRIPTION	Principal materials:	Slate	
	Technique of inscription:	Incised	
	Previous interventions :	None	

STRUCTURAL CONDITION

Overall structural condition:	Laid flat complete	
Ground condition :	Good/level	Slight slope
Impact of vegetation:	Other	Moss growth
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Broken off at base, but complete

Surface condition :

Organic growth

Moss

Condition of inscription :

Other

Unreadable

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Fair

Heritage significance:

B

General comments:

Slate intact but lying face down, at risk of further damage if left in current location

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base and pin base and top of headstone to 25mm thick slate backing. Make good joints with mortar. Re-erect in original location of existing base.

Schedule of Work clauses:

2.02 and 2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone lying flat

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken into 11 pieces

Surface condition :

Organic growth

and surface dirt

Condition of inscription :

Other

Growth and dirt covering parts of inscription

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

C

General comments:

Sandstone broken into several pieces. High risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base section. Pin broken sections (at least 11 no plus base) together with stainless steel dowels, and pin to 25mm thick slate backing. Make good joints with mortar. Re-erect in original location.

Schedule of Work clauses:

2.04 and 2.09a.

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone lying flat in pieces

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Surface dirt

De-colouration of sandstone

Condition of inscription :

Good

De-colouration over inscription

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

B

General comments:

Sandstone broken into two pieces. High risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base section. Pin broken sections together (2 no plus base) with stainless steel dowels, and pin to 25mm thick slate backing. Make good joints with mortar. Re-erect in original location.

Schedule of Work
clauses:

2.04 and 2.09a.

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone lying flat in pieces

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION	Monument reference:	J13	Date surveyed:	10 January 2020
	Name of burial (if known):	Judith Harris	Date of burial:	1839
	Others commemorated:	(Yetele d. of Israel Aaron Segal)	Date of burial:	-
	Monument type:	Headstone	Heritage designation:	SAM
	Headstone dimensions (in mm):	Height: 1450	Width: 690	Thickness: 45
	Tomb dimensions (in mm):	Height: 0	Width: 0	Length: 0
	Designer/sculptor/mason:	Unknown	Orientation:	North

DESCRIPTION	Principal materials:	Sandstone	
	Technique of inscription:	Incised	
	Previous interventions :	None	

STRUCTURAL CONDITION

Overall structural condition:	Excessively tilted	
Ground condition :	Good/level	On slight slope
Impact of vegetation:	None	
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Other

Leaning headstone

Surface condition :

Organic growth

Lichen (see photo)

Condition of inscription :

Other

Some of inscription covered in lichen as above

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Fair

Heritage significance:

A

General comments:

Sandstone with drastic lean, currently not unstable but may be advisable to deal with during any repair works to avoid need in the future

PROPOSED REPAIRS

Proposed repairs:

Carefully excavate headstone, and re-set vertically in the same location

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Leaning headstone

Headstone seems to be stable

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION	Monument reference:	J15	Date surveyed:	10 January 2020
	Name of burial (if known):	Lewis Falkson	Date of burial:	1832
	Others commemorated:	(Judah son of Joshua)	Date of burial:	-
	Monument type:	Headstone	Heritage designation:	SAM
	Headstone dimensions (in mm):	Height: 1450	Width: 690	Thickness: 60
	Tomb dimensions (in mm):	Height: 0	Width: 0	Length: 0
	Designer/sculptor/mason:	Unknown	Orientation:	North

DESCRIPTION	Principal materials:	Sandstone	
	Technique of inscription:	Incised	
	Previous interventions :	None	

STRUCTURAL CONDITION

Overall structural condition:	Excessively tilted	Headstone drastically leaning towards north
Ground condition :	Other	Grass verge downhill
Impact of vegetation:	None	
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Other

Leaning headstone

Surface condition :

Organic growth

Lichen / tree deposit

Condition of inscription :

Good

Some of inscription covered with growth

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Fair

Heritage significance:

A

General comments:

Drastic lean, currently not unstable but may be advisable to deal with during any repair works to avoid need in the future.

PROPOSED REPAIRS

Proposed repairs:

Carefully excavate headstone, and re-set vertically in the same location

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Leaning headstone

Headstone seems to be stable

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Good

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Good, slate lying on ground. Medium to high risk of further damage in current location.

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone lying flat

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Organic growth

Surface dirt / lichen

Condition of inscription :

Good

Some surface dirt over inscription

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Good, slate lying on ground. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone lying flat

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Organic growth

Surface dirt / growth

Condition of inscription :

Good

Dirt covering some of inscription

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Good, slate lying on ground. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION

Monument reference:	J28	Date surveyed:	
Name of burial (if known):	Unknown	Date of burial:	
Others commemorated:		Date of burial:	
Monument type:	Headstone	Heritage designation:	SAM
Headstone dimensions (in mm):	Height:	Width:	Thickness:
Tomb dimensions (in mm):	Height:	Width:	Length:
Designer/sculptor/mason:		Orientation:	—

DESCRIPTION

Principal materials:	Slate	
Technique of inscription:	Incised	
Previous interventions :	None	

STRUCTURAL CONDITION

Overall structural condition:	Laid flat in pieces	
Ground condition :	Good/level	
Impact of vegetation:	None	
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Missing elements

Surface condition :

Good

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

C

General comments:

Broken headstone laid flat, only one large piece apparent, not large enough to re-erect. Not included in CMP schedule of monuments to be repaired

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Allow to lay back down in current location at a slope on new limecrete bed. Add J30a if it established that this is part of J28.

Schedule of Work
clauses:

2.09b

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone laid flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base

Surface condition :

Good

Condition of inscription :

Good

Some dirt in inscriptions

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

B

General comments:

Fair / poor - slate lying on ground, belongs to broken base J14

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base J14 and pin base and main section J29 to 25mm thick slate backing with stainless steel dowels. Make good joints with mortar. Re-erect at position J14.

Schedule of Work
clauses:

2.01 and 2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION	Monument reference:	J30	Date surveyed:	10 January 2020
	Name of burial (if known):	Unknown	Date of burial:	-
	Others commemorated:		Date of burial:	
	Monument type:	Headstone	Heritage designation:	SAM
	Headstone dimensions (in mm):	Height: 9700	Width: 540	Thickness: 30
	Tomb dimensions (in mm):	Height: 0	Width: 0	Length: 0
	Designer/sculptor/mason:	Unknown	Orientation:	North

DESCRIPTION	Principal materials:	Slate	Good condition. Inscription assumed but not visible?
	Technique of inscription:	Incised	
Previous interventions :	None		

STRUCTURAL CONDITION

Overall structural condition:	Laid flat complete	Headstone lying face down
Ground condition :	Good/level	
Impact of vegetation:	Other	Grass growth
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Other

Good condition

Surface condition :

Surface dirt

Organic growth

Condition of inscription :

Other

Inscription not visible

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Slate lying on ground, but in good condition. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Other

Fallen headstone

PHOTOGRAPHS

J29. SEE J14

J30. NAME UNKNOWN



Slate, good condition, needs re-erecting.



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Loose elements

Top corner of slate headstone broken

Surface condition :

Organic growth

Surface dirt / moss growth

Condition of inscription :

Other

Moss and other growths over most of inscription

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

B

General comments:

Fair/Poor, slate lying on ground, top corner broken. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base. Pin broken sections (2 no plus base) to 25mm thick slate backing with stainless steel dowels. Make good joints with mortar. Re-erect in original location.

Schedule of Work clauses:

2.01 and 2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Broken and fallen headstone, flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Organic growth

Surface dirt

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Slate headstone lying on ground, but in good condition. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Allow to lay back down in current location at a slope on new limecrete bed. Headstone will be re-erected if original location can be established.

Schedule of Work
clauses:

2.09b

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone laid flat on grass

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Surface dirt

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Slate lying on ground, but in good condition. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: J34 Date surveyed: 10 January 2020

Name of burial (if known): Unknown Date of burial: Unknown

Others commemorated: Date of burial:

Monument type: Headstone Heritage designation: SAM

Headstone dimensions (in mm): Height: 1060 Width: 560 Thickness: 25

Tomb dimensions (in mm): Height: 0 Width: 0 Length: 0

Designer/sculptor/mason: Unknown Orientation: North

DESCRIPTION Principal materials: Slate

Technique of inscription: Incised

Previous interventions : None

STRUCTURAL CONDITION

Overall structural condition: Laid flat complete

Ground condition : Good/level

Impact of vegetation: None

Condition of foundation: Not visible

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Organic growth

Surface dirt

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Fair

Heritage significance:

B

General comments:

Slate lying on ground but in good condition. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Allow to lay back down in current location at a slope on new limecrete bed. Headstone will be re-erected if original location can be established.

Schedule of Work
clauses:

2.09b

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone laid flat on ground

PHOTOGRAPHS



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Other

None - in very good condition

Surface condition :

Surface dirt

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Slate lying on ground, but in good condition. Broken fragment beside J30a, Kelland transposes J30a and J41. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Re-erect in original location.

Schedule of Work
clauses:

2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Headstone fallen, flat on ground

PHOTOGRAPHS



J30A. PHOEBE MOSES, d. 1804 (Feigele daughter of Moses, d. 5565)
(Recently uncovered, beneath J41)



Slate, very good condition, should be re-erected.

Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION Monument reference: Date surveyed:

Name of burial (if known): Date of burial:

Others commemorated: Date of burial:

Monument type: Heritage designation:

Headstone dimensions (in mm): Height: Width: Thickness:

Tomb dimensions (in mm): Height: Width: Length:

Designer/sculptor/mason: Orientation:

DESCRIPTION Principal materials:

Technique of inscription:

Previous interventions :

STRUCTURAL CONDITION

Overall structural condition:

Ground condition :

Impact of vegetation:

Condition of foundation:

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base?

Surface condition :

Surface dirt

Organic growth

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Good

Heritage significance:

B

General comments:

Slate lying on ground, but in good condition. Two pieces are lying at this location; J41 bedded flat into the turf (Phoebe Moses) with J30a beside. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Allow to lay back down in current location at a slope on new limecrete bed. Headstone will be re-erected if original location can be established.

Schedule of Work
clauses:

2.09b

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Fallen headstone flat on ground

PHOTOGRAPHS

Slate, upright and stable.

J41. PERHAPS PART OF 28

J42. NAME UNKNOWN



Slate, good condition, needs re-erecting.



Jewish Cemetery, Ponsharden

Proforma Condition and Repairs Schedule

IDENTIFICATION	Monument reference:	J43	Date surveyed:	10 January 2020
	Name of burial (if known):	Phoebe Joseph	Date of burial:	1830
	Others commemorated:		Date of burial:	
	Monument type:	Headstone	Heritage designation:	SAM
	Headstone dimensions (in mm):	Height: 1450	Width: 560	Thickness: 30
	Tomb dimensions (in mm):	Height: 0	Width: 0	Length: 0
	Designer/sculptor/mason:	Unknown	Orientation:	North

DESCRIPTION	Principal materials:	Slate	
	Technique of inscription:	Incised	
	Previous interventions :	None	

STRUCTURAL CONDITION

Overall structural condition:	Laid flat complete	Headstone broken off at base
Ground condition :	Good/level	
Impact of vegetation:	None	
Condition of foundation:	Not visible	

MATERIAL CONDITION (Masonry)

Types of deterioration:

Broken

Headstone broken off at base

Surface condition :

Other

Good condition

Condition of inscription :

Good

MATERIAL CONDITION (Ironwork)

Condition of ironwork:

None

GENERAL CONDITION/COMMENTS

General condition :

Poor

Heritage significance:

B

General comments:

Fair/Poor, slate broken off at base. Main section of the broken base recorded as J21. Medium to high risk of further damage

PROPOSED REPAIRS

Proposed repairs:

Clean off organic growth and dirt. Excavate base of J21 and pin base and main section to 25mm thick slate backing with stainless steel pins. Make good joints with mortar. Re-erect in original location at J21.

Schedule of Work clauses:

2.01 and 2.09a

HEALTH AND SAFETY HAZARDS

Hazards:

Trip hazard

Fallen headstone flat on ground

PHOTOGRAPHS

