

Main rear roof slope and dormer at East end of building showing patch repairs



Main rear roof slope at West end of building, showing patch repairs & slipped tiles

Existing stone coping blocks are to be removed to allow lead flashings to be replaced.

The copings are to be replaced using stainless steel restraint angles in the joints as per SE detail



Parapet wall at West end of building



East valley



Cast iron gutter and broken and spalling roof tiles



West valley

Gutters are to be cleaned out and all support bracket fixings are to be checked and repaired as necessary. Provide and fit matching brackets as required, to re-align the gutter



Deflected gutter above main flat roof area



The gable end roof overhang is to be under-boarded using 18mm T & G boards painted black and an undercloak board is to be provided under the overhanging edge tiles to allow pointing to the tile edge

> Project: Lymm Village Hall
> Client: Lymm Parish Council Address: 5 Pepper Street, Lymm, WA13 0JB Title: Main Hall Roof- Proposed External Roof Works-Rear Elevation (North Facing) Sketch Number: 19-8550-13

PRINT @ A3 SIZE