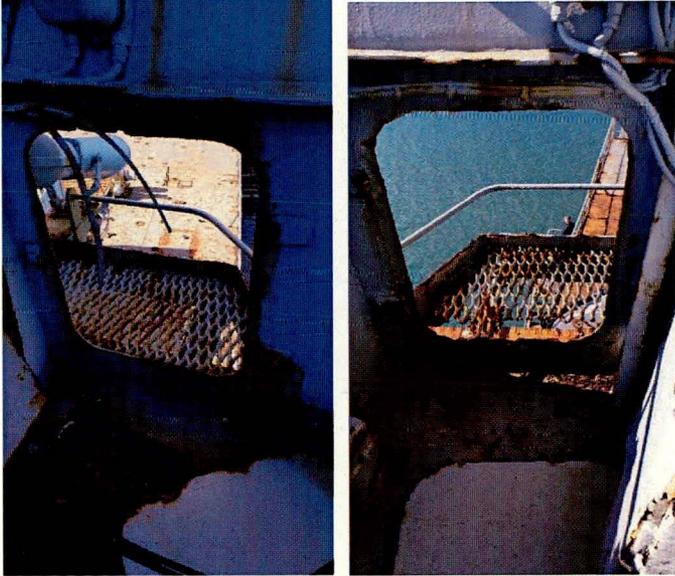
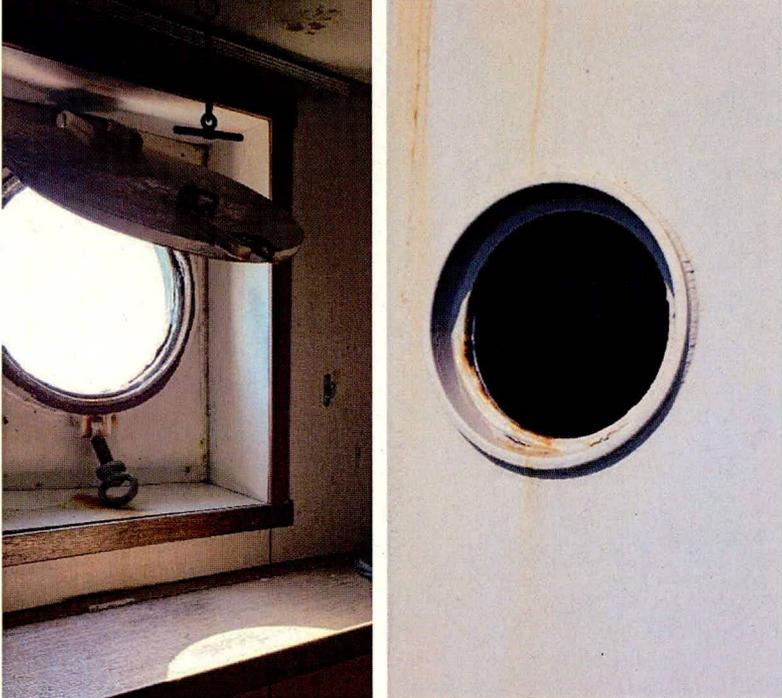


TASK NO.	TASK/DESCRIPTION	NOTES
H4.03	<p data-bbox="408 389 660 423"><b>Upper Deck Doors</b></p>  <p data-bbox="408 1682 1214 1850">Many upper deck doors are seized or stiff to move with no ability to securely close. REFURBISH doors to include renewal of rubber seals and repair any excessively corroded areas. All clips to be freed up and greased, or RENEWED if beyond repair. Doors will be placed in priority order with list provided to the Contractor prior to RPSD. REPRESENTATION on completion of any required work.</p> <p data-bbox="408 1865 1098 1895">ALLOW for 30 doors. ALLOW for 60m<sup>2</sup> REPRESENTATION.</p>	<p data-bbox="1249 394 1437 566">Awaiting Escape, Evacuation and Rescue report to aid priority listing.</p> <p data-bbox="1249 595 1437 703">IAW Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.04	<p><b>Bridge Wing Access Panels to Light Boom</b></p>  <p>Port and stbd bridge wing access doors to flight lighting booms have both suffered excessive corrosion on hinges resulting in doors becoming detached. RENEW door hinges and refit doors. REPRESENT on completion.</p> <p>ALLOW for 4m<sup>2</sup> REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.15 and H3.05.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.05	<p data-bbox="411 389 612 421"><b>Cabin Porthole</b></p> <div data-bbox="408 439 1190 1137">  </div> <p data-bbox="411 1155 1214 1240">Cabin 01Z0 porthole flap is seized open and porthole glass has become detached leaving an opening for rain ingress. Hinged flap to be freed up and sealed shut with appropriate weatherproof sealant.</p>	