



Not to scale - for illustrative purposes only

TREATMENT KEY:

- 50mm inlay TSCS (Do Min)
- Fill and overbanding repair system for crack exceeding 5mm but not exceeding 10mm wide (Do Min)
- Deep repair/ inlay (Do Something)

Notes

- 1) Dimensions are approximate and have been based on the most up-to-date AVIS video data
- 2) Only overhead power lines shown on the treatment plans. For other utilities please refer to the C2 plans for the area
- 3) Due to the potential inaccuracy of AVIS data regarding exact chainages, where Core locations are within the vicinity of a Gully, coring Contractor to adjust the location to avoid potential coring into/through carrier pipes

LOCATION:
M5 J25-24 NB MP 201.7-196.6
DRAWING No:
583 Defect Treatment Plan Sheet 1 of 6
DRAWN: FS DATE: 22/06/2020
DESIGN: FS DATE: 22/06/2020
CHECKED: CC DATE: 25/06/2020

Notes:

DEFECTS KEY	Core crack depth(mm)	Photo	Open long. joint	Rutting	Minor surface deterioration	Pothole	Core location (tar)	Core location (No Tar)	Site to be cored
	Transverse crack minor	Plug joint	Const. joint	Mechanical joint	Major surface deterioration	Nodes	Settlement	Trafficked Lane	SCRIM Deficiency
	Transverse crack major	Loops	Patch	Mud pumping	Depression	Ironwork	Structure/Bridge	Existing HFS	Texture < 0.8mm
	Long. crack minor	Fattening	Failed patch	Minor fretting	Minor crazing	Gully	New HFS		
Long. crack major			Major fretting	Major crazing					