

the play inspection company

Annual Inspection

Central Swindon North Parish Council

Barnum Court

Swindon , SN2 2AP





Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL t- 01202 590675 e- info@playinspections.co.uk

www. playinspections .co.uk







Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

- BS EN 15312 Free access multi-sports equipment
- BS EN 14974 Skateparks
- BS EN 16630 Permanently installed outdoor fitness equipment
- BS EN 16899 Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

A full copy of the Play Inspection Company Ltd. Terms & Conditions is available on our website (www.playinspections.co.uk)

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	\checkmark	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	\checkmark	V [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	\checkmark	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	~	V [3]
6.1 d) Effects of weather	\checkmark	
6.1 d) Presence of rot, decay or corrosion (see note 1)	\checkmark	V [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	\checkmark	[4]
6.1 d) Excavation or dismantling/additional measures	\checkmark	×
6.2.1 Assessment of glass reinforced plastics (see note 5)	\checkmark	V [5]
6.2.1 Inspection of one post equipment (see note 1)	\checkmark	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	\checkmark	×

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

© The Play Inspection Company & the Register of Play Inspectors International 15th September 2021

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
	1	r —			Sev	erity>>		
	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
Likelihood	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
	Very Low Low Moderate High Very Hig				Very High			
	THE PLAN			1	2	3	4	5
No injury likely e.g. damaged or soiled clothing, minor bruising, grazes Minor injury, laceration or bruising aid only Injury requiring medical intervention e.g. cuts requiring stitches Serious injury including concussions or fracture of long bones Severe injury involving a potential life changing injury or fatality								
Severity>>								
Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).								

Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.

Equipment has been assessed to the following standards where relevant:

BS EN 1176 Parts 1-11 (Playground equipment and surfacing)

BS EN 14974 (Facilities for users of roller sports equipment)

BS EN 15312 (Free access multi-sports equipment)

BS EN 16899 (Parkour Equipment)

BS EN 16630 (Outdoor Fitness Equipment).



Barnum Court

Inspection Ref: 2249510

Site Ref: 54428

Inspected: 20-December-2023 - 12:00 by Kyle Warrington (RPII Annual Inspector)

Risk Assessment: 15 Moderate Risk



Location:

The site is located in an area of public open space and is overlooked by a number of properties in the local community. **Disabled Access:**

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.



10 - Low Risk		
Item:	Site General	
Manufacturer:	Owner/Operator	
Surface Type:	Wet Pour	
Item Quantity:	1	
Equipment Compliance:	N/A	
Surface Area Compliance:	N/A	
Total Findings:	4	P P P
Finding 1		Finding 2
The surface is lifting at the e Repair perimeter of surfacing	dges and creating trip points - g to remove trip points	There are significant gaps (over 30mm) between the surface and the edging or between the joints in the surface; these are large enough for a small foot to enter - Repair surfacing
Finding 3		Finding 4
There is algae, silt or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately		There are trip hazards present and the surfacing has subsided or has been pushed up due to tree roots - Repair or replace as required

8 - Low Risk		
Item:	Gate - Self Closing	
Manufacturer:	Not Identified	
Surface Type:	Mixed Surface	
Item Quantity:	1	
Equipment Compliance:	N/A	
Surface Area Compliance:	N/A	
Total Findings:	3	
Finding 1		Finding 2
The item has been damaged - Monitor for any further deterioration and replace as required		There are trip hazards present - Reinstate surrounding surfaces to level to remove the trip points
Finding 3		
The gate is not operating cor ensure the gate closes betwee	rectly - Take effective action to een 4 and 8 seconds	



4 - Very Low Risk 1 Item: Fence - Bow Top Manufacturer: Not Identified Surface Type: Mixed Surface Item Quantity: 1 Equipment Compliance: N/A Surface Area Compliance: N/A **Total Findings:** 1 Finding 1

This item is satisfactory - no work required -


💫 6 - Low Risk

ltem: Manufacturer:	Bench Not Identified	
Surface Type:	Concrete	
Item Quantity:	2	
Equipment Compliance:	N/A	Statement of the statem
Surface Area Compliance:	N/A	
Total Findings:	2	
Finding 1		Finding 2
There is algae or moss on the Clean and treat appropriately	e surface of the equipment - ⁄	There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required



😭 4 - Very Low Risk

Item:	Sign
Manufacturer:	Owner/Operator
Surface Type:	N/A
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	1

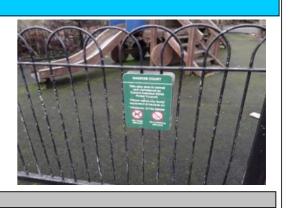

Finding 1

This item is satisfactory - no work required -

12 - Moderate Risk

Item:	Rocking Moose
Manufacturer:	Lappset UK Ltd
Surface Type:	Wet Pour
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	1
Total i mulligs.	I



Finding 1

The item has missing components - Replace or remove the remaining parts and reinstate the surface



15 - Moderate Risk		
Item:	Spring Aeroplane	
Manufacturer:	Kompan Ltd	
Surface Type:	Wet Pour	and the second statement of th
Item Quantity:	1	
Equipment Compliance:	No	
Surface Area Compliance:	Yes	
Total Findings:	5	
Finding 1		Finding 2
The surfacing is damaged exposing the foundations - Repair damaged areas of surfacing		The end of handgrips and/or footrests have a cross section of less than 15cm2 and fail to meet the requirements of BS EN 1176 Part 6 - Monitor - No remedial work recommended
Finding 3		Finding 4
A hand grip has been severely damaged - Repair or replace the item		There are areas or parts of the timber on the structure that have rotted - Replace all affected timbers
Finding 5]
There is/are bolt cap covers item - Replace missing or da		-



9 - Low Risk		
9 - Low Risk Item: Manufacturer: Surface Type: Item Quantity: Equipment Compliance: Surface Area Compliance: Total Findings:	Train Lappset UK Ltd Wet Pour 1 No Yes 12	
Finding 1		Finding 2
There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required		There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers
Finding 3		Finding 4
Parts of the timber are rough rough or sharp edges	or splintered - Remove all	There is or are fixings missing on the item - Replace all missing fixings
Finding 5		Finding 6
The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No remedial work recommended		The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint
Finding 7		Finding 8
There is/are finger entrapment/s in the slide start section and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No remedial work recommended		There is some evidence of rot in the timber throughout - Monitor for any further deterioration and replace as required
Finding 9		Finding 10
Parts of the timber are rough or splintered - Remove all rough or sharp edges		The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No remedial work recommended
Finding 11		Finding 12
The unit is easily accessible and should have the appropriate barriers installed as the height of the unit exceeds 600mm - Monitor - No remedial work recommended		There is some evidence of fire damage to the item - Monitor for any further deterioration and repair as required



Findings information





9 - Low Risk (Finding 2)

Item: Manufacturer: Ancillary Items - Site General Owner/Operator

Risk Level:

L - Low Risk






Finding: There are significant gaps (over 30mm) between the surface and the edging or between the joints in the surface; these are large enough for a small foot to enter

Action: Repair surfacing



Finding: There is algae, silt or moss growth on the surface Action: Clean and treat appropriately resulting in slippery conditions



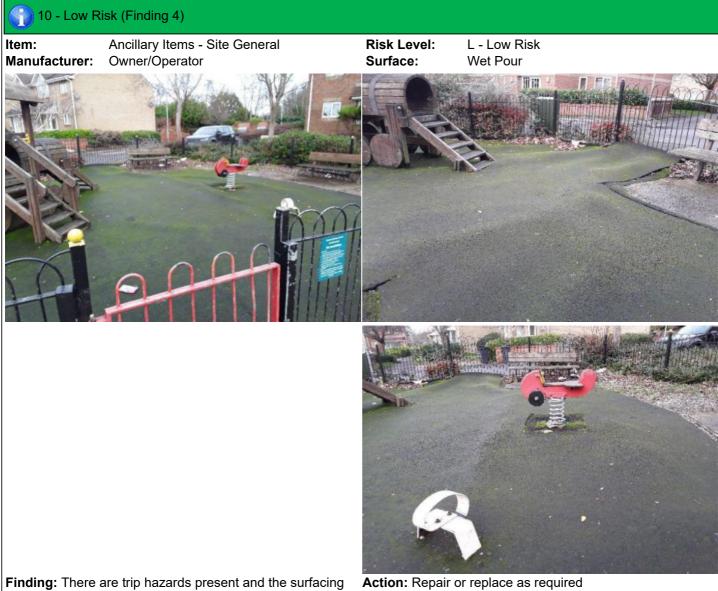


Finding: There are trip hazards present and the surfacing has subsided or has been pushed up due to tree roots



6 - Low Risk (Finding 1) Gates - Gate - Self Closing **Risk Level:** L - Low Risk Item: Not Identified Surface: Mixed Surface Manufacturer: Finding: The item has been damaged Action: Monitor for any further deterioration and replace as required 8 - Low Risk (Finding 2) Item: Gates - Gate - Self Closing **Risk Level:** L - Low Risk Manufacturer: Not Identified Surface: Mixed Surface Action: Reinstate surrounding surfaces to level to remove Finding: There are trip hazards present the trip points



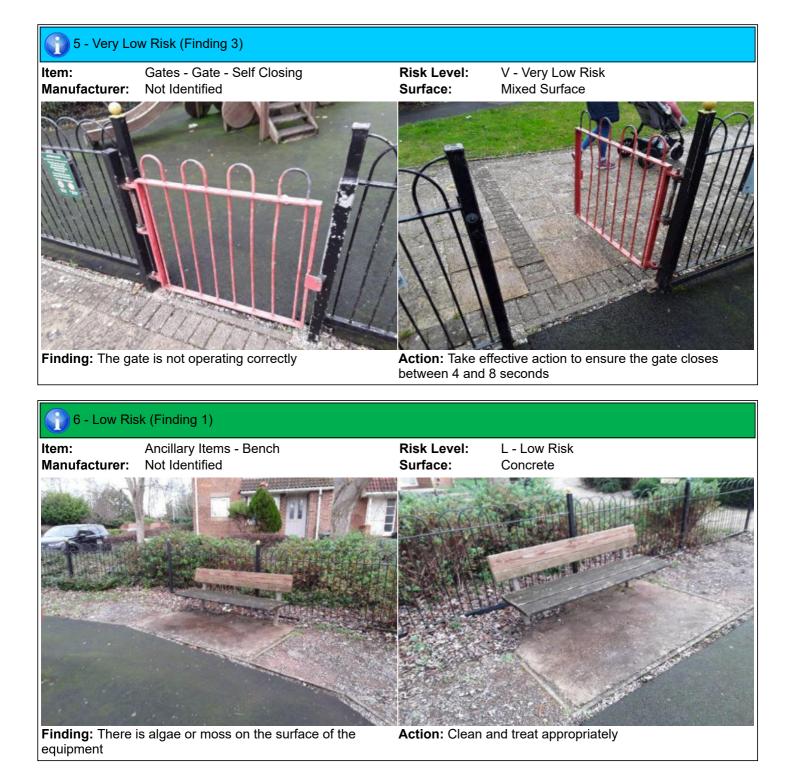




6 - Low Risk (Finding 2)



Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

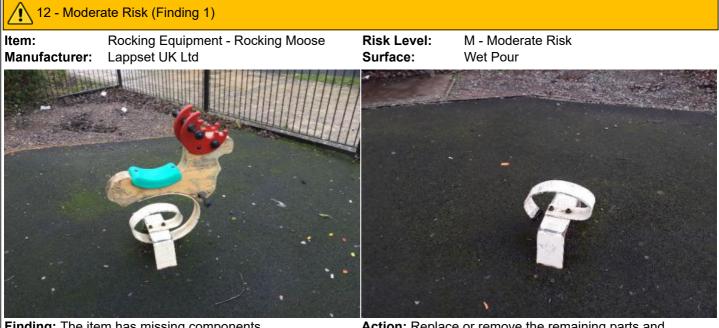


Finding: The item has missing components

Action: Replace or remove the remaining parts and reinstate the surface



10 - Low Risk (Finding 1)

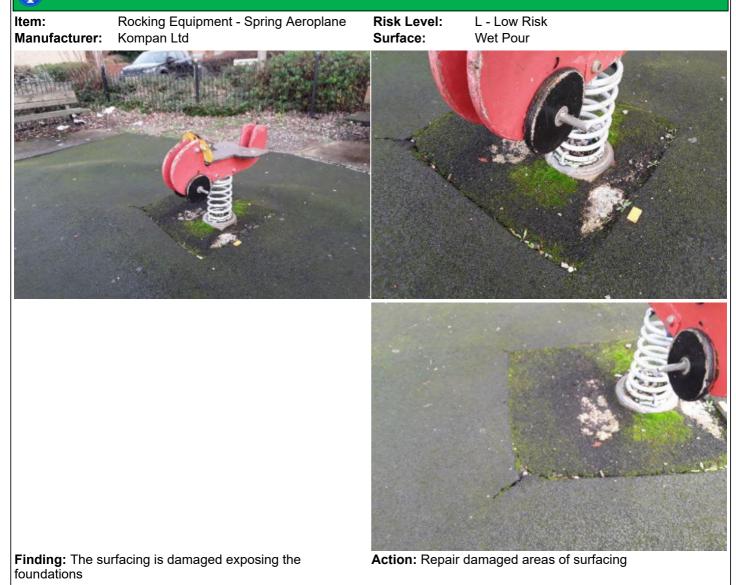




6 - Low Risk (Finding 2)

Item: Manufacturer:

Rocking Equipment - Spring Aeroplane r: Kompan Ltd Risk Level: Surface: L - Low Risk Wet Pour




Finding: The end of handgrips and/or footrests have a cross **Action:** Monitor - No remedial work recommended section of less than 15cm2 and fail to meet the requirements of BS EN 1176 Part 6

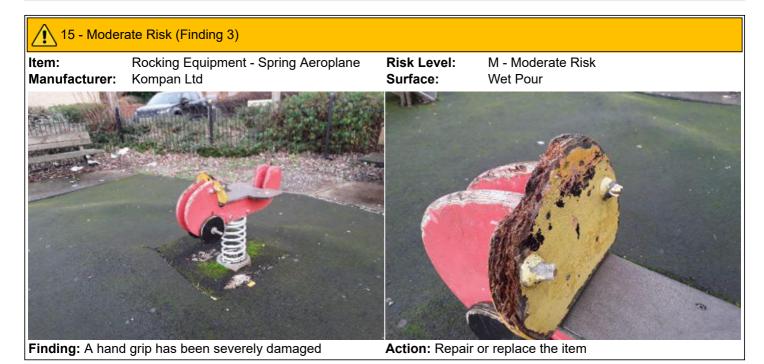



12 - Moderate Risk (Finding 4) Rocking Equipment - Spring Aeroplane Risk Level: M - Moderate Risk Item: Manufacturer: Kompan Ltd Surface: Wet Pour Finding: There are areas or parts of the timber on the Action: Replace all affected timbers structure that have rotted - Very Low Risk (Finding 5) V - Very Low Risk Rocking Equipment - Spring Aeroplane Risk Level: Item: Manufacturer: Kompan Ltd Surface: Wet Pour Finding: There is/are bolt cap covers missing or damaged Action: Replace missing or damaged bolt cap covers on the item



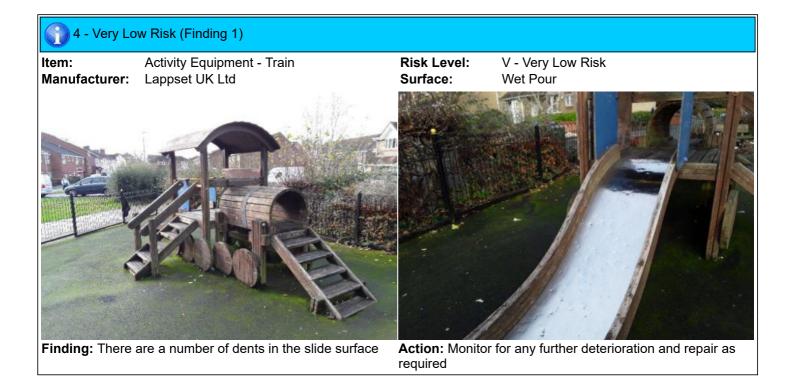








9 - Low Risk (Finding 3) Activity Equipment - Train **Risk Level:** L - Low Risk Item: Manufacturer: Lappset UK Ltd Surface: Wet Pour Finding: Parts of the timber are rough or splintered Action: Remove all rough or sharp edges 8 - Low Risk (Finding 4) Activity Equipment - Train **Risk Level:** L - Low Risk Item: Wet Pour Manufacturer: Lappset UK Ltd Surface:

Finding: There is or are fixings missing on the item

Action: Replace all missing fixings



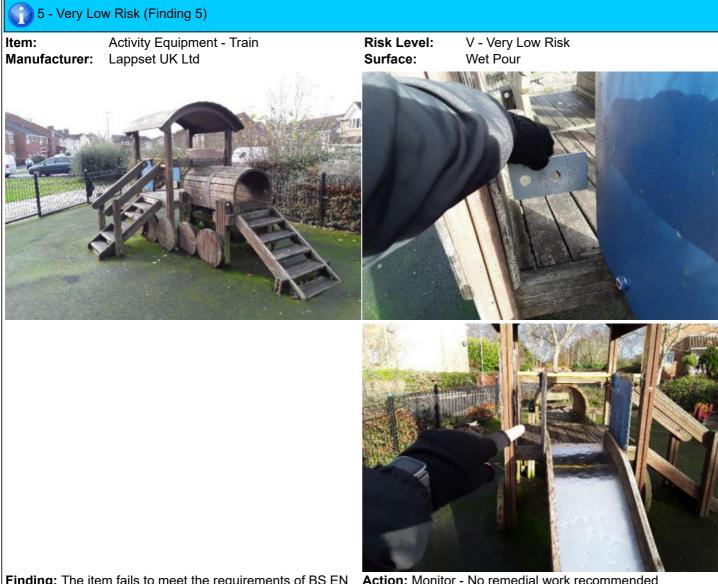

Finding: The item fails to meet the requirements of BS EN **Action:** Monitor - No remedial work recommended 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps



6 - Low Risk (Finding 6)

Item: Manufacturer:


Activity Equipment - Train Lappset UK Ltd

Risk Level: Surface:

L - Low Risk Wet Pour



Finding: The paintwork on this item has been damaged or Action: Treat affected areas and repaint worn exposing the metal underneath which is rusting / corroding



5 - Very Low Risk (Finding 7)

Item: Manufacturer:

Activity Equipment - Train Lappset UK Ltd

Risk Level: Surface:

V - Very Low Risk Wet Pour



Finding: There is/are finger entrapment/s in the slide start section and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Monitor - No remedial work recommended



8 - Low Risk (Finding 8)



Finding: There is some evidence of rot in the timber throughout

Action: Monitor for any further deterioration and replace as required




6 - Low Risk (Finding 9) Item: Activity Equipment - Train Manufacturer: Lappset UK Ltd Surface: Wet Pour

Finding: Parts of the timber are rough or splintered

Action: Remove all rough or sharp edges



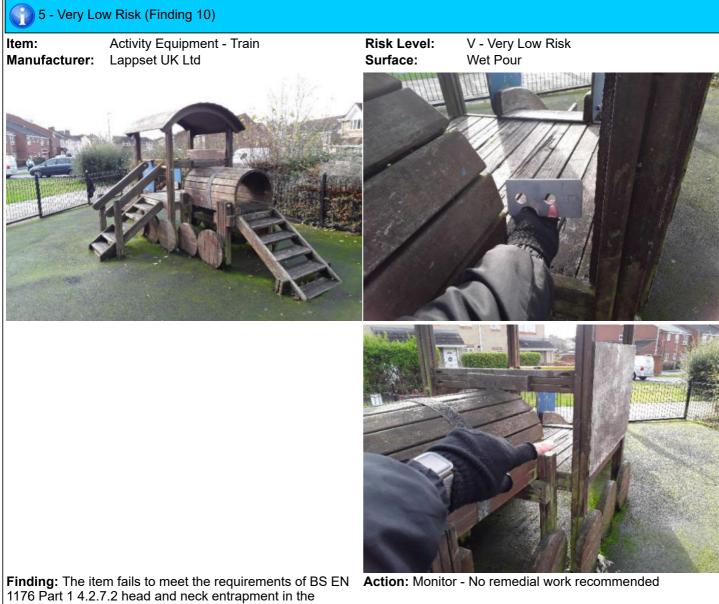

barriers and/or steps





6 - Low Risk (Finding 12)

ltem: Monufactu Activity Equipment - Train

Manufacturer: Lappset UK Ltd

Risk Level: Surface: L - Low Risk Wet Pour



Finding: There is some evidence of fire damage to the item Action: Monitor for any further deterioration and repair as required