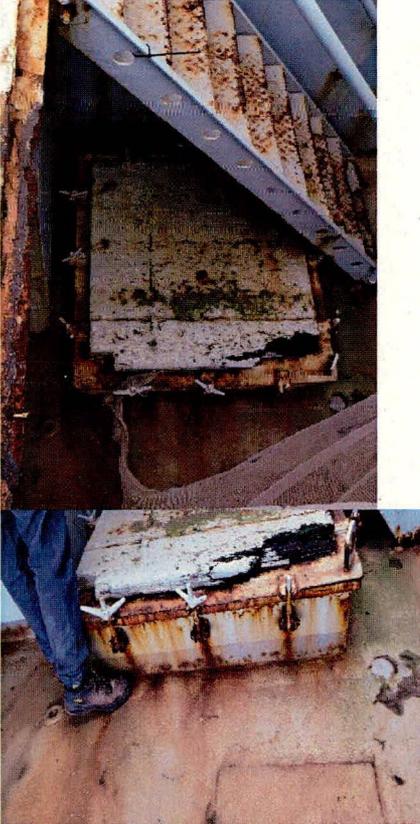


TASK NO.	TASK/DESCRIPTION	NOTES
H3.07	<p data-bbox="395 389 715 421">Flight Deck Guardrails</p> <div data-bbox="408 439 1129 1057">  </div> <p data-bbox="408 1075 1212 1160">The flight deck guardrails have areas of paint coating breakdown and active corrosion present. The top rail has suffered full thickness corrosion penetration and requires RENEWAL in certain areas.</p> <p data-bbox="408 1196 1212 1249">ALLOW for 8m top rail RENEWAL ALLOW for 10m² REPRESENTATION of all rails.</p>	<p data-bbox="1251 394 1450 564">Hotwork Required – Appropriate precautions to be taken IAW General 8.4.</p> <p data-bbox="1251 595 1450 703">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1251 734 1450 792">Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H3.08	<p data-bbox="400 383 884 416">Aft Suspended Walkway Guardrails</p>  <p data-bbox="400 913 1209 1088">The aft suspended walkway guardrails are damaged and have areas of full thickness penetration due to corrosion on the top rail. REPLACE damaged lengths of top rail and also lengths of damaged/corroded/missing intermediate rails. ALLOW for 8m top rail and 30m intermediate rail RENEWAL. ALLOW for 15m² REPRESENTATION.</p>	<p data-bbox="1251 387 1449 555">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1251 589 1449 696">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1251 730 1422 786">Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H4.01	<p data-bbox="404 387 631 421">CASEVAC Hatch</p>  <p data-bbox="404 801 1196 958">The CASEVAC hatch located fwd on the vehicle deck is stiff to open and the hold-back facility inoperative. REMOVE and REFURBISH Vehicle deck CASEVAC hatch and hold back facility. REPRESENT all affected areas on completion. ALLOW for 4m² REPRESENTATION.</p>	<p data-bbox="1232 387 1420 562">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1232 589 1420 701">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1232 728 1420 817">To be completed in conjunction with H3.02.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H4 EXTERNAL DOORS, OPENINGS AND HATCHES	
H4.02	<p data-bbox="403 387 724 416">Stbd Shade Deck Hatch</p>  <p data-bbox="403 1279 1214 1391">Fwd stbd shade deck hatch has unrequired wooden cover. Cover to be removed to inspect condition of hatch beneath. REPRESENT/REPAIR hatch as required. REPRESENT coatings on hatch and hatch combing on completion</p> <p data-bbox="403 1406 831 1431">ALLOW for 8m² REPRESENTATION.</p>	<p data-bbox="1254 394 1452 562">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1254 595 1452 701">IAW Paint scheme -General 12 and Annex B refer.</p>