

**CBC Asbestos Refurbishment Survey Report
Neville House, George Street, Corby
22nd – 24th March 2016**



CBC Asbestos Refurbishment Survey Report Neville House, George Street, Corby 22nd – 24th March 2016

Reference:					
Issue			Prepared by	Verified by	
V1	Apr 16	JQ			
			Joseph Quarrinton	Mike Warburton	
			Asbestos Works Co-Ordinator	Asbestos Team Leader	
			18/04/16	18/04/16	
File Ref: K:\ASBESTOS MANAGEMENT SYSTEM\1 PROPERTY REGISTERS SURVEYS SAMPLING\Housing\Property\George Street\Neville House\Refurbishment Report Template (Ref).doc					
Corby Borough Council, 10 Fleming Road, Corby, Northants, NN17 4SW Telephone: 01536 464646					

Contents

Section 0	Executive Summary
Section 1	Introduction
1.1	General
1.2	Objectives
1.3	Survey Limitations
1.4	Report Conditions
Section 2	Site Details
2.1	Location
2.2	Buildings
Section 3	Survey Methodology
Section 4	Survey Conditions
4.1	Access Constraints
4.2	Areas of No Access
4.3	Survey Specific Notes
Section 5	Asbestos Register
Section 6	Recommendations
Section 7	Glossary of Terms
Section 8	References

Appendices

Appendix A	Inspection Reports
Appendix B	Risk Assessment Criteria
Appendix C	Site Sketches
Appendix D	Analysis Certificates

0.0 Executive Summary

Site Location	The site address is Neville House, George Street, Corby.
Site Description	The site comprises of 12 flats and communal areas located over 6 floors, built circa 1950's. The general construction of the building was concrete floor, concrete and brick walls and concrete ceilings. All external fascias beneath the windows were laminated panels with 'mica' board internal panels.
Date and type of survey undertaken	<p>The survey was undertaken to assist with the compliance of the Control of Asbestos Regulations (CAR) 2012. A Corby Borough Council (CBC) Asbestos Refurbishment Survey was undertaken in accordance with HSG 264 – The Asbestos Surveyors Guide.</p> <p>The CBC Asbestos Refurbishment Survey was conducted on 22nd – 24th March 2016 by Mike Warburton, Joseph Quarrinton and Bethany Capps of CBC.</p> <p>Sample analysis techniques were UKAS accredited in accordance with HSG 248 – Asbestos: The Analysts Guide for Sampling, Analysis and Clearance Procedures, 2005.</p>
Summary of Asbestos Containing Materials Identified	<p>A total of 66 no. samples were analysed following the survey. Of these, 30 no. samples were confirmed as containing asbestos and a further 109 no. occurrences of asbestos were referenced to the samples taken.</p> <p>Asbestos Insulating Board (AIB) – Identified in the form of relay blocks and breakers to the internals of 2 switch gear boxes which work the lifts within 5.03 / Lift Motor Room and as a panel to the internals of a sanitary burner within 3.05 / Refuse Room. The AIB was in fair, unsealed condition and poses a low risk.</p> <p>Asbestos Paper – Identified in the form of ceramic fuses with asbestos paper cores within fuse box and loose within 2.02 / Meter Room. The paper was in fair condition and poses a low risk.</p> <p>Asbestos Textiles – Identified as a rope seal to the internals of a sanitary burner within 3.05 / Refuse Room, as flash guards loose and in old fuse boxes within 2.02 / Meter Room and 5.03 / Lift Motor Room and as brake shoe to the lift motor (right of door) within 5.03 / Lift Motor Room. The textiles were in fair condition and pose a low risk.</p> <p>Asbestos Cement – Identified as down pipes and cowls running from the roof and down through 2 of the flats (please see plans, register and inspection sheets for further details) and as the brake shoe to the lift motor (left of door) within 5.03 / Lift Motor Room. The cement products were in fair condition and pose a very low to low risk.</p> <p>Asbestos Containing Floor Tiles with Bitumen Adhesive Backing – Identified to the floors within a majority of the building (please see plans, register and inspection sheets for further details). The floor tiles and adhesive were in good to fair condition and pose a very low risk.</p> <p>Asbestos Bitumen – Identified to packers below window ledge within one flat. The bitumen packer was in fair condition posing a very low risk. Several window ledges were removed throughout the building but be aware that the packers may be present beneath window ledges that have not been removed.</p>

Corby Borough Council – Asbestos Report



	<p>Asbestos Composite Material – Identified as the nosing strips of the stairwell from the ground to the first floor and as toilet cisterns within several areas of the property (please see plans, register and inspection sheets for further details). The composite materials were in fair to poor condition and pose a very low to low risk.</p> <p>All materials identified should be removed if likely to be disturbed during the refurbishment works.</p> <p>NB: The panels beneath the windows of the property were sampled 4 times and all analysis results came back negative. It has been assumed that all of the fascia panels were the same and therefore pose no risk.</p>
<p>Areas of No Access</p>	<p>Every effort was made to access all areas of the site. Inaccessible areas and limitations of a CBC Asbestos Demolition / Refurbishment Survey are detailed in Sections 1.3.2 and 4.2 of this report.</p> <p>Inaccessible areas should be presumed to contain asbestos containing materials (ACM's) until such time as an inspection can be made that proves otherwise, as required by the Control of Asbestos Regulations (CAR) 2012.</p>
<p>General Recommendations</p>	<p>If asbestos containing materials (ACM's) are to remain in-situ across the premises, CAR 2012 requires a Duty Holder be appointed/identified, who will be responsible for producing and implementing an Asbestos Management Plan, as defined by HSG 227.</p> <p>Due to the nature of a CBC Asbestos Refurbishment Survey there is always the possibility of asbestos being present within inaccessible areas and those areas outlined within Sections 1.3.2 and 4.2 of the report are outside the scope of this type of survey. If any work is to be carried out within these areas then materials encountered should be presumed to contain asbestos unless there is strong evidence for a reasoned argument that the material does not contain asbestos. This can be achieved by taking a sample and having subsequent analysis undertaken on the sample in accordance with HSG 248.</p> <p>Prior to demolition, refurbishment or any other works that might disturb the asbestos materials identified, they should be removed. It is recommended that a site-specific method statement be produced in order to facilitate the removal of the asbestos. It is advised that a duty holder be appointed to coordinate and oversee the management of asbestos at the site.</p>
<p><i>This sheet is intended to provide a summary only of the asbestos survey findings. It does not provide a definitive engineering analysis for the purposes of costing or construction and is subject to the limitations of this CBC Asbestos Refurbishment Survey.</i></p>	

1.0 Introduction

1.1 General

CBC undertook an Asbestos Refurbishment Survey at Neville House, George Street, Corby.

Mike Warburton, Joseph Quarrinton and Bethany Capps undertook the survey on 22nd – 24th March 2016.

1.2 Objectives

A CBC Asbestos Refurbishment Survey was undertaken at the site in order to meet the following objectives:

- To identify the presence, location and condition of reasonably accessible asbestos containing materials (ACM's).
- To produce a report to identify areas of confirmed and suspected asbestos and to provide an indication as to their location, condition and extent.

1.3 Survey Limitations

1.3.1 Whilst the surveyors made every effort, CBC cannot guarantee that all asbestos containing materials have been identified, or that survey results are definitive. Specific areas of the site where suitable access was not available are recorded in Section 4.2 of this document.

1.3.2 Features that generally fall outside the scope of a CBC Asbestos Refurbishment Survey include:

- Within cavity walls
- Areas behind or above suspect asbestos containing materials
- Within solid concrete floors where asbestos shuttering may have been used
- Areas where asbestos is sandwiched between non-asbestos materials
- Within underground ducts etc. where reasonable access is unavailable
- Within live plant or electrical apparatus
- Beneath the lagging of live pipes
- Areas where access may involve damaging the fabric of the building

1.3.3 A strategy of using representative samples of suspected asbestos materials has been used to minimise the number of samples taken to a practical level and keep to a minimum the disturbance of potential asbestos containing materials at the site. Because of this strategy the results of the survey should be interpreted such that all visually similar materials in the same area must be assumed to be composed of the same material until proven otherwise.

1.3.4 In accordance with The CAR 2012, it must be assumed that materials visually assessed as asbestos containing materials contain amphibole asbestos fibres (i.e. Amosite and Crocidolite), unless sampled to prove otherwise.

2.0 Site Details

2.1 Location

The site address is Neville House, George Street, Corby.

2.2 Buildings

The site comprises of 12 flats and communal areas located over 6 floors, built circa 1950's. The general construction of the building was concrete floor, concrete and brick walls and concrete ceilings. All external fascias beneath the windows were laminated panels with 'mica' board internal panels.

2.2.1 Specific areas included within the survey scope are as follows:

- 5th Floor – 5.01 / Landing, 5.02 / Meter Room, 5.03 / Lift Motor Room, 5.04 / Cupboard below Lift Motor, 5.05 / Store, 5.06 / Roof (Right), 5.07 / Roof (Left)
- 4th Floor – 4.01 / Landing, 4.02 / Store, 4.03 / Store, 4.04 / Tank Room, 4.05 / Lift Shaft, 4.06 / Hoist Shaft
- 3rd Floor – 3.01 / Landing/Stairs, 3.02 / Corridor, 3.03 / Store, 3.04 / Corridor, 3.05 / Refuse, 3.06 / Lift Shaft, 3.07 / Hoist
- 2nd Floor – 2.01 / Landing/Stairs, 2.02 / Meter room, 2.03 / Store, 2.04 / Lift shaft, 2.05 / Hoist, 2.06 / Undercroft
- 1st Floor – 1.01 / Landing
- Ground Floor – 0.01 / Entrance Lobby/Stairs, 0.02 / Rear Lobby
- Flat 12 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Bedroom 3, 06 / Landing, 07 / Bedroom 1, 08 / Cupboard, 09 / Balcony, 10 / Cupboard, 11 / Bathroom, 12 / Lounge, 13 / Bedroom 2, 14 / Cupboard
- Flat 11 – 01 / Hallway, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Lounge, 06 / Hall, 07 / Bedroom 1, 08 / Cupboard, 09 / Cupboard, 10 / Bedroom 2, 11 / Cupboard, 12 / Bathroom
- Flat 10 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Lounge, 06 / Hall, 07 / Bathroom, 08 / Bedroom 1, 09 / Cupboard, 10 / Bedroom 2, 11 / Cupboard, 12 / Cupboard
- Flat 9 – 01 / Hall, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Stairs/landing, 06 / Lounge, 07 / Hallway, 08 / Bedroom 2, 09 / Cupboard, 10 / Cupboard, 11 / Bedroom 2, 12 / Cupboard, 13 / Bathroom
- Flat 8 – 01 / Hall, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Lounge, 06 / Hallway, 07 / Bathroom, 08 / Bedroom 2, 09 / Cupboard, 10 / Bedroom 1, 11 / Cupboard, 12 / Cupboard
- Flat 7 – 01 / Hall, 02 / Kitchen, 03 / Cupboard, 04 / Lounge, 05 / Hallway, 06 / Bedroom 2, 07 / Cupboard, 08 / Cupboard, 09 / Bedroom 1, 10 / Cupboard, 11 / Bathroom
- Flat 6 – 01 / Hall, 02 / Kitchen, 03 / Cupboard, 04 / Lounge, 05 / Hall, 06 / Bathroom, 07 / Bedroom 1, 08 / Cupboard, 09 / Bedroom 1, 10 / Cupboard, 11 / Cupboard
- Flat 5 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Bedroom 3, 06 / Landing, 07 / Bedroom 1, 08 / Cupboard, 09 / Lounge, 10 / Bathroom, 11 / Cupboard, 12 / Bedroom 2, 13 / Cupboard
- Flat 4 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Bedroom 3, 05 / Landing, 06 / Bedroom 1, 07 / Cupboard, 08 / Bathroom, 09 / Lounge, 10 / Bedroom 2
- Flat 3 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Bedroom 2, 06 / Landing, 07 / Bedroom 1, 08 / Lounge, 09 / Bathroom, 10 / Cupboard
- Flat 2 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Bedroom 3, 06 / Landing, 07 / Bedroom 1, 08 / Cupboard, 09 / Cupboard, 10 / Bathroom, 11 / Lounge, 12 / Bedroom 2, 13 / Cupboard
- Flat 1 – 01 / Lobby, 02 / Kitchen, 03 / Cupboard, 04 / Cupboard, 05 / Bedroom 2, 06 / Landing, 07 / Bedroom 1, 08 / Lounge, 09 / Bathroom, 10 / Cupboard, 11 / Bedroom 2

3.0 Survey Methodology

3.1 A CBC Asbestos Refurbishment Survey, based upon the methodology set out in HSG 264 was undertaken. Each accessible area was inspected to locate materials presumed or strongly presumed to contain asbestos, and samples were taken where necessary.

3.2 Photographs of each sample location were taken, however where similar materials were identified these are referenced to similar homogeneous materials.

3.3 Each sample is assessed using a material assessment algorithm, which assigns a score of risk to each individual ACM based the following criteria:

- Friability;
- Condition;
- Surface Treatment;
- Fibre Type;

Each criterion has various scores and when all the scores for each are added together a value of risk is generated for the material. This is only a requirement of HSG 264 for Asbestos Refurbishment Surveys.

3.4 All samples were analysed by a UKAS accredited laboratory using Polarised Light Microscopy and Dispersion Staining techniques in accordance with HSG 248.

4.0 Survey Conditions

4.1 Access Constraints

4.1.1 All areas of the site were assessed (unless stated in Section 4.2) for the presence of ACM's and where ACM's were presumed and/or strongly presumed samples were taken. These presumptions are based upon surveyors experience associated with identification of a particular material.

4.2 Areas of No Access

4.2.1 The table below identifies areas of no access:

Area of No Access	Reason
0.01 / Entrance Lobby – No access to duct	Concerted into floor
2.04 / Dumb Waiter – Limited access	Floor not visible as the lift car was located at ground floor level. There was no entrance to the dumb waiter shaft below the 3 rd floor within the property.
2.06 / Under croft – limited access	Confined space
3.02 / Corridor – No access above metal corrugated panels.	Irreversible damage would have been sustained to gain access above the panels. Contract intimated the panels may stay
3.04 / Corridor – No access above metal corrugated panels.	Irreversible damage would have been sustained to gain access above the panels. Contract intimated the panels may stay
4.05 / Lift Car – Limited access	Due to the lift being suspended on the 4 th floor. Advised by lift engineer not to enter as he could not guarantee the safety of the area.
5.04 / Store – Limited access	Timber floor above lift shaft – Could not prove the integrity of the timber floor

Please refer to Section 1.3.2 for our standard CBC Asbestos Demolition / Refurbishment Survey limitations.

4.3 Survey Specific Notes

4.3.1 There is always a possibility that asbestos materials other than those highlighted by the report are present in those areas not accessed fully at the time of the survey.

4.3.2 Inaccessible areas should be presumed to contain amphibole asbestos and appropriate management planning should be implemented in order to control access and maintenance activities to these areas until such a time as they can be accessed and the presence or absence of asbestos containing materials can be confirmed.

4.3.3 A strategy of using representative samples of suspected asbestos materials has been used to minimise the number of samples taken to a practical level and keep to a minimum the disturbance of potential asbestos containing materials. Because of this strategy the results of the survey should be interpreted such that all visually similar materials in the same area must be assumed to be composed of the same material until proven otherwise.

Corby Borough Council – Asbestos Report



- 4.3.4 In accordance with the Control of Asbestos Regulation 2012, it must be assumed that materials visually assessed as asbestos containing materials contain amphibole asbestos fibres (i.e. Amosite and Crocidolite), unless strongly presumed otherwise or sampled to prove otherwise.
- 4.3.5 Asbestos products and non-asbestos products in some areas of the building are located in close proximity to each other. Care must be taken when removing the asbestos in order that contamination of the non-asbestos materials is not caused, as this will increase disposal costs.
- 4.3.6 Material assessments have been undertaken on the various items inspected. These assessments are carried out according to the material assessment algorithm appended to this report, which is based on the assessment criteria in HSG 264.

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 12 - Neville House, 3rd floor, 01 / Lobby	Black and grey floor tiles and adhesive	Floor Tile / Covering - (Low)	<u>2</u>	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	3 sq. m.	High / Internal	220316MW03 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 3rd floor, 02 / Kitchen	Black and grey floor tiles and adhesive	Floor Tile / Covering - (Low)	<u>5</u>	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	220316MW04 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 3rd floor, 04 / Cupboard	Top section of down pipe	Cement - (Low)	<u>6</u>	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 m.	Medium / Internal	220316MW05 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 3rd floor, 05 / Bedroom 3	Packer below window ledge	Bitumen - (Low)	<u>7</u>	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	<1 sq. m.	High / Internal	220316MW06 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 3rd floor, 05 / Bedroom 3	Brown floor tiles and adhesive	Floor Tile / Covering - (Low)	<u>9</u>	Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	220316MW07 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 06 / Landing	Green floor tiles and adhesive	Floor Tile / Covering - (Low)	<u>12</u>	Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	7 sq. m.	High / Internal	220316MW09 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 12 - Neville House, 4th floor, 07 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	16	Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	220316MW12 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 08 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	17	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	220316MW11 (Same as Sample 220316MW12)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 10 / Cupboard	Pipe in riser	Cement - (Low)	19	Strongly Presumed Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	3 m.	Low / Internal	220316MW26 (Same as Sample 220316MW05)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 10 / Cupboard	Green floor tiles and adhesive	Floor Tile / Covering - (Low)	20	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 sq. m.	High / Internal	220316MW19 (Same as Sample 220316MW09)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 11 / Bathroom	Toilet cistern	Composite / Resin - (Low)	21	Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	220316MW20 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 11 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	22	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	4 sq. m.	High / Internal	220316MW22 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 12 - Neville House, 4th floor, 13 / Bedroom 2	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	25	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	220316MW25 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 12 - Neville House, 4th floor, 14 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	26	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	220316MW27 (Same as Sample 220316MW25)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 3rd floor, 01 / Hallway	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	28	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	220316MW36 (Same as Sample 220316MW25)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	31	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	220316MW39 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 3rd floor, 04 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	32	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	1 sq. m.	High / Internal	220316MW40 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 06 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	36	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	3 sq. m.	High / Internal	220316MW45 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 11 - Neville House, 2nd floor, 07 / Bedroom 1	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	37	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	11 sq. m.	High / Internal	220316MW46 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 08 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	38	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	220316MW47 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 09 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	39	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	220316MW48 (Same as Sample 220316MW03)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 10 / Bedroom 2	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	41	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	220316MW50 (Same as Sample 220316MW25)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 11 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	42	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	220316MW51 (Same as Sample 220316MW25)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 11 - Neville House, 2nd floor, 12 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	43	Strongly Presumed Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	4 sq. m.	High / Internal	220316MW52 (Same as Sample 220316MW22)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 10 - Neville House, 3rd floor, 01 / Lobby	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	44	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	220316MW55 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 3rd floor, 02 / Kitchen	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	45	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	11 sq. m.	High / Internal	220316MW56 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 3rd floor, 03 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	46	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	220316MW57 (Same as Sample 220316MW56)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 06 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	48	Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	220316MW59 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 07 / Bathroom	Brown and blue floor tiles and adhesive	Floor Tile / Covering - (Low)	49	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	3 sq. m.	High / Internal	220316MW60 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 08 / Bedroom 1	Brown floor tiles and adhesive	Floor Tile / Covering - (Low)	51	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	220316MW62 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 10 - Neville House, 2nd floor, 09 / Cupboard	Brown floor tiles and adhesive	Floor Tile / Covering - (Low)	52	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	220316MW63 (Same as Sample 220316MW62)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 10 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	55	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	220316MW66 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 11 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	56	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 sq. m.	High / Internal	220316MW67 (Same as Sample 220316MW66)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 10 - Neville House, 2nd floor, 12 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	57	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 sq. m.	High / Internal	220316MW68 (Same as Sample 220316MW66)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 3rd floor, 01 / Hallway	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	59	Chrysotile (White Asbestos)	Good / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW70 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	61	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW72 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 9 - Neville House, 3rd floor, 03 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	62	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW73 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 07 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	65	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW75 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 08 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	66	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW76 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 09 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	67	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW77 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 10 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	68	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW78 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 11 / Bedroom 1	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	69	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW79 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 9 - Neville House, 2nd floor, 12 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	70	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 sq. m.	High / Internal	230316MW80 (Same as Sample 230316MW79)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 9 - Neville House, 2nd floor, 13 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	71	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	4 sq. m.	High / Internal	230316MW81 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 3rd floor, 01 / Hallway	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	74	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW84 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	77	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	230316MW87 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 3rd floor, 03 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	78	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	Low / Internal	230316MW88 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 06 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	82	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW90 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 8 - Neville House, 2nd floor, 07 / Bathroom	Toilet cistern	Composite / Resin - (Low)	83	Strongly Presumed Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW91 (Same as Sample 220316MW20)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 07 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	84	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW92 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 08 / Bedroom 2	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	86	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW94 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 09 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	87	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW95 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 10 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	88	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW96 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 8 - Neville House, 2nd floor, 11 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	89	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW97 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 8 - Neville House, 2nd floor, 12 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	90	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW98 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 3rd floor, 01 / Hallway	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	91	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW99 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	92	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	230316MW100 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 05 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	94	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW102 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 06 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	95	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW103 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 07 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	96	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW104 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 7 - Neville House, 2nd floor, 08 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	97	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW105 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 09 / Bedroom 1	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	98	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW106 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 10 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	99	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW107 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 11 / Bathroom	Toilet cistern	Composite / Resin - (Low)	100	Strongly Presumed Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW108 (Same as Sample 220316MW20)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 7 - Neville House, 2nd floor, 11 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	101	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW109 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 3rd floor, 01 / Hallway	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	102	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW110 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 6 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	103	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	230316MW111 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 05 / Hallway	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	105	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	7 sq. m.	High / Internal	230316MW113 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 06 / Bathroom	Toilet cistern	Composite / Resin - (Low)	106	Strongly Presumed Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW114 (Same as Sample 220316MW20)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 06 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	107	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	3 sq. m.	High / Internal	230316MW115 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 07 / Bedroom 2	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	108	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW116 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 08 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	109	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW117 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 6 - Neville House, 2nd floor, 09 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	110	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW118 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 10 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	111	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW119 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 6 - Neville House, 2nd floor, 11 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	112	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW120 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 3rd floor, 01 / Lobby	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	113	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW121 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	114	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW122 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 3rd floor, 03 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	115	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW123 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 5 - Neville House, 3rd floor, 05 / Bedroom 3	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	116	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW124 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 06 / Landing	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	117	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW125 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 07 / Bedroom 1	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	118	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	230316MW126 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 08 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	119	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW127 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 10 / Bathroom	Toilet cistern	Composite / Resin - (Low)	121	Strongly Presumed Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW129 (Same as Sample 220316MW20)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 10 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	122	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW130 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 5 - Neville House, 4th floor, 11 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	123	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW131 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 12 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	124	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	230316MW132 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 5 - Neville House, 4th floor, 13 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	126	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW134 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 3rd floor, 01 / Lobby	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	127	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	12 sq. m.	High / Internal	230316MW135 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	128	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW136 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 3rd floor, 04 / Bedroom 3	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	129	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW140 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 4 - Neville House, 4th floor, 05 / Landing	Grey floor tiles	Floor Tile / Covering - (Low)	130	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW137 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 4th floor, 06 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	131	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	230316MW138 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 4th floor, 07 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	132	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW139 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 4 - Neville House, 4th floor, 10 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	134	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	4 sq. m.	High / Internal	230316MW142 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 3rd floor, 01 / Lobby	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	135	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW143 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	136	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW144 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 3 - Neville House, 3rd floor, 03 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	137	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW145 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 3rd floor, 05 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	138	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	230316MW146 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 4th floor, 06 / Landing	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	139	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW147 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 4th floor, 07 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	141	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	20 sq. m.	High / Internal	230316MW149 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 4th floor, 09 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	145	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW153 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 3 - Neville House, 4th floor, 10 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	146	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW154 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 2 - Neville House, 3rd floor, 01 / Lobby	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	147	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW155 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	148	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	15 sq. m.	High / Internal	230316MW156 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 3rd floor, 04 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	149	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW157 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 3rd floor, 05 / Bedroom 3	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	150	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	230316MW158 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 06 / Landing	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	151	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW159 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 07 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	152	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW160 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 2 - Neville House, 4th floor, 08 / Cupboard	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	153	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW161 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 09 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	154	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW162 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 10 / Bathroom	Toilet cistern	Composite / Resin - (Low)	155	Strongly Presumed Amosite (Brown Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW163 (Same as Sample 220316MW20)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 10 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	156	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW164 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 12 / Bedroom 2	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	158	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW166 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 2 - Neville House, 4th floor, 13 / Cupboard	Red floor tiles and adhesive	Floor Tile / Covering - (Low)	159	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW167 (Same as Sample 230316MW70)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 1 - Neville House, 3rd floor, 01 / Lobby	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	161	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	4 sq. m.	High / Internal	230316MW171 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 3rd floor, 02 / Kitchen	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	163	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW173 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 3rd floor, 03 / Cupboard	Grey and black floor tiles and adhesive	Floor Tile / Covering - (Low)	164	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW174 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 3rd floor, 04 / Cupboard	Cement down pipe	Cement - (Low)	165	Chrysotile (White Asbestos) Crocidolite (Blue Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	2 m.	High / Internal	230316MW175 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 3rd floor, 05 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	166	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW176 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 4th floor, 06 / Landing	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	168	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	10 sq. m.	High / Internal	230316MW178 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Flat 1 - Neville House, 4th floor, 07 / Bedroom 1	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	169	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	8 sq. m.	High / Internal	230316MW179 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 4th floor, 09 / Bathroom	Toilet cistern	Composite / Resin - (Low)	172	Strongly Presumed Amosite (Brown Asbestos)	Poor / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	230316MW182 (Same as Sample 220316MW20)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 4th floor, 09 / Bathroom	Blue and green floor tiles and adhesive	Floor Tile / Covering - (Low)	173	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	2 sq. m.	High / Internal	230316MW183 (Same as Sample 230316MW81)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 4th floor, 10 / Cupboard	Grey floor tiles and adhesive	Floor Tile / Covering - (Low)	174	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	0.5 sq. m.	High / Internal	230316MW184 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Flat 1 - Neville House, 4th floor, 11 / Bedroom 2	Black floor tiles and adhesive	Floor Tile / Covering - (Low)	176	Strongly Presumed Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	6 sq. m.	High / Internal	230316MW186 (Same as Sample 230316MW72)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.03 / Lift Motor Room	Relay block and breakers within 2 Switch gear boxes to lifts	Insulating Board - (Medium)	177	Chrysotile (White Asbestos)	Fair / Unsealed AIB or encapsulated lagging and spray	Throughout	High / Internal	220316MW31 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Communal Areas - Neville House, 5th floor, 5.03 / Lift Motor Room	Flash guard within fuses box to back wall	Textile - (Medium)	178	Strongly Presumed Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 Box	High / Internal	220316MW32 (Same as Sample 220316MW29)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.03 / Lift Motor Room	Brake shoe to lift motor (left of door)	Cement - (Low)	180	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	2 No.	High / Internal	220316MW34 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.03 / Lift Motor Room	Brake shoe to lift motor (right of door)	Textile - (Medium)	181	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	2 No.	High / Internal	220316MW35 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.05 / Store	Redundant toilet cistern	Composite / Resin - (Low)	183	Strongly Presumed Amosite (Brown Asbestos)	Poor / Composite materials, reinforced plastics, resin, vinyl materials	1 No.	High / Internal	240316MW191 (Same as Sample 220316MW20)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.06 / Roof (Right)	Down pipe next to door	Cement - (Low)	184	Strongly Presumed Chrysotile (White Asbestos) Crocidolite (Blue Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	2 m.	High / External	240316MW194 (Same as Sample 240316MW193)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 5th floor, 5.06 / Roof (Right)	Cowl	Cement - (Low)	185	Strongly Presumed Chrysotile (White Asbestos) Crocidolite (Blue Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 No.	High / External	240316MW195 (Same as Sample 240316MW193)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	------------------------------	-----------------------	---------------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Communal Areas - Neville House, 5th floor, 5.07 / Roof (Left)	Down pipe near door	Cement - (Low)	188	Chrysotile (White Asbestos) Crocidolite (Blue Asbestos)	Poor / Composite materials, reinforced plastics, resin, vinyl materials	50 sq. m.	High / External	240316MW193 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 4th floor, 4.05 / Lift Shaft	Floor tiles and adhesive within lift car	Floor Tile / Covering - (Low)	191	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	3 sq. m.	High / Internal	240316MW204 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 3rd floor, 3.05 / Refuse Room	Rope seal within sanitary burner	Textile - (Medium)	195	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 No.	High / Internal	220316MW53 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 3rd floor, 3.05 / Refuse Room	Panel within sanitary burner	Insulating Board - (Medium)	196	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 No.	High / Internal	220316MW54 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 2nd floor, 2.02 / Meter Room	Flash guard loose and in old fuse boxes	Textile - (Medium)	198	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	1 loose + 2 boxes	High / Internal	220316MW29 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works
Communal Areas - Neville House, 2nd floor, 2.02 / Meter Room	Core to ceramic fuses within fuse box and loose	Paper - (Medium)	199	Chrysotile (White Asbestos)	Fair / Enclosed sprays and lagging, encapsulated AIB, cement etc.	aprox 20 No.	High / Internal	220316MW30 (Sample)	Risk Band C Low Risk	Remove if likely to be disturbed during the refurbishment works

5.0 Asbestos Register

Project Name	Corby Borough Council	Date of Survey	22 - 24 March 2016
---------------------	-----------------------	-----------------------	--------------------

Area	Feature	Material Type - (Friability)	Photo No.	Asbestos Fibre	Condition / Surface Treatment	Extent	Access / Position	Reference Number / (Identification)	Risk Band	Recommendations
Communal Areas - Neville House, Ground, 0.01 / Entrance Lobby and Stairs	Nosing strip to stairs	Composite / Resin - (Low)	200	Chrysotile (White Asbestos)	Fair / Composite materials, reinforced plastics, resin, vinyl materials	20 m.	High / Internal	240316MW202 (Sample)	Risk Band D Very Low Risk	Remove if likely to be disturbed during the refurbishment works

6.0 Recommendations

6.1 Summary

Survey inspection reports detail the ACM identified, its approximate extent and its priority risk rating, these reports are contained within Appendix B of this report. The asbestos register, Section 5.0 of this report summarises asbestos containing materials and presumed asbestos materials identified during the course of the survey.

6.2 Asbestos Insulating Board

Asbestos Insulating Board (AIB) was identified in the form of relay blocks and breakers to the internals of 2 switch gear boxes which work the lifts within 5.03 / Lift Motor Room and as a panel to the internals of a sanitary burner within 3.05 / Refuse Room. The AIB was in fair, unsealed condition, posing a low risk and requires removal if likely to be disturbed during the refurbishment works.

Removal of AIB **does require the use of a licensed asbestos removal contractor and is subject to a 14-day notification period to the HSE.** The removals should also be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works will include:

- ◆ The Control of Asbestos Regulations 2012 (and associated Approved Codes of Practice – L143)
- ◆ Management of Health & Safety at Work Regulations 1999
- ◆ Construction (Design and Management) Regulations 2015
- ◆ HSE Document HSG 247

6.3 Asbestos Paper

Asbestos Paper was identified in the form of ceramic fuses with asbestos paper cores both loose and in fuse boxes within 2.02 / Meter Room. The paper was in fair condition, posing a low risk and requires removal if likely to be disturbed during the refurbishment works.

Removal of the paper **does require the use of a licensed asbestos removal contractor and is subject to a 14-day notification period to the HSE.** The removals should also be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.4 Asbestos Textiles

Asbestos Textiles were identified as a rope seal to the internals of a sanitary burner within 3.05 / Refuse Room, as flash guards loose and in old fuse boxes within 2.02 / Meter Room and 5.03 / Lift Motor Room and as brake shoe to the lift motor (right of door) within 5.03 / Lift Motor Room. The textiles were in fair condition, posing a low risk and require removal if likely to be disturbed during the refurbishment works.

Removal of the textiles **does require the use of a licensed asbestos removal contractor and is subject to a 14-day notification period to the HSE.** The removals should also be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.5 Asbestos Cement

Asbestos Cement was identified as down pipes and cowls running from the roof and down through 2 of the flats (please see plans, register and inspection sheets for further details) and as the brake shoe to the lift motor (left of door) within 5.03 / Lift Motor Room. The cement products were in fair condition, posing a very low to low risk and require removal if likely to be disturbed during the refurbishment works.

Removal of the cement products does not necessitate the use of a licensed asbestos removal contractor, although it should be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.6 Asbestos Containing Floor Tiles with Bitumen Adhesive Backing

Asbestos Containing Floor Tiles with Bitumen Adhesive Backing were identified to the floors within a majority of the building (please see plans, register and inspection sheets for further details). The floor tiles and adhesive were in good to fair condition, posing a very low risk and require removal if likely to be disturbed during the refurbishment works.

Removal of the floor tiles and adhesive does not necessitate the use of a licensed asbestos removal contractor, although it should be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.7 Asbestos Bitumen

Asbestos Bitumen was identified to packers below window ledge within one flat. The bitumen packer was in fair condition, posing a very low risk and requires removal if likely to be disturbed during the refurbishment works.

NB: Several window ledges were removed throughout the building but be aware that the packers may be present beneath window ledges that have not been removed.

Removal of the bitumen product does not necessitate the use of a licensed asbestos removal contractor, although it should be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.8 Asbestos Composite Material

Asbestos Composite Material was identified as the nosing strips of the stairwell from the ground to the first floor and as toilet cisterns within several areas of the property (please see plans, register and inspection sheets for further details). The composite materials were in fair to poor condition, posing a very low to low risk and require removal if likely to be disturbed during the refurbishment works.

Removal of the composite material does not necessitate the use of a licensed asbestos removal contractor, although it should be carried out in line with current asbestos legislation and guidance documents to ensure safe and appropriate working practice. An air-monitoring regime appropriate to the works undertaken should also be instigated to accompany any removal works. Key legislation and guidance that should be adhered to during the course of such works highlighted in section 6.2.

6.9 Further Investigation

There is a possibility that asbestos material may be present in those areas that were not accessed at the time of the survey.

6.10 General

If asbestos removal is required, a site-specific asbestos removal specification, risk assessment and method statement shall be produced in order to facilitate any asbestos removal works.

The waste generated from asbestos removal should be notified and disposed of in accordance with the Hazardous Waste (England & Wales) Regulations 2005.

The contractor must ensure that adequate Duty of Care provisions are put in place for the transportation and disposal of wastes from the site in line with the obligations of the Environmental Protection Act 1990.

In accordance with Regulation 4 of The Control of Asbestos Regulations 2012, it is advised that a management plan is produced and a duty holder be appointed to coordinate and oversee the management of the asbestos at the site.

Where asbestos insulation materials are removed, the building manager should ensure that non-asbestos replacement materials are installed, to maintain fire proofing.

6.11 Asbestos Management Plan (AMP)

The Control of Asbestos Regulations 2012 stipulates under Regulation 4, that persons responsible by virtue of ownership, contract or tenancy of a non-domestic premise are responsible for undertaking a suitable and sufficient assessment for the presence of asbestos materials within those premises and implement an appropriate Asbestos Management Plan (AMP).

Areas highlighted in Sections 1.3.2 and 4.2 as areas of 'no access' should be presumed to contain amphibole asbestos and appropriate management planning should be implemented in order to control access and maintenance activities to these areas until such a time as they can be accessed and the presence or absence of asbestos containing materials can be confirmed.

Asbestos materials were encountered in the survey as detailed in Section 5.0. The AMP should stipulate the requirements for working in these areas identified as containing asbestos as well as the areas of 'no access' as stated in Sections 1.3.2 & 4.2. For example the requirements for working in these areas may be a permit to work system, appropriate risk assessments or by other means to ensure people are not exposed to asbestos.

In accordance with Regulation 4 of The Control of Asbestos Regulations 2012, it is advised that a 'Duty Holder' be appointed to coordinate and oversee the management of asbestos at the site. The most appropriate person to be considered to be a Duty Holder is the person responsible for coordinating maintenance activities for the premises.

The Duty Holder has the responsibility to incorporate the results of this survey into an AMP for the building. The Duty Holder must ensure that an appropriate Priority Assessment is undertaken as detailed in HSG 227: [A Comprehensive Guide to Managing Asbestos in Premises, taking into account factors such as:](#)

- **Normal Occupant Activity** – assessment based upon the interaction of occupants and the area being assessed.
- **Likelihood of disturbance** – assessment based upon location of asbestos, its accessibility and quantity of material that has the potential to be disturbed.
- **Human Exposure Potential** – assessment based upon number of occupants, frequency of use and

- duration of use.
- **Maintenance Activity** – assessment based upon type of maintenance activity and frequency.

Combining the Material Risk Assessment with the Priority Assessment provides an overall assessment with respect to ACM's present within a building. This overall assessment will then determine the management requirements for the building.

CBC can assist in the process of risk assessment to further develop the AMP in accordance with L127 and HSG 227.

6.12 MMMF

A number of materials associated with Machine Made Mineral Fibre (MMMF) are present within areas of the building. These materials are covered by the COSHH regulations and persons working on or near these materials should undertake sufficient risk assessments and/or wear appropriate Personal Protective Equipment.

7.0 Glossary of Terms

ACM	Asbestos Containing Material
AIB	Asbestos Insulating Board
AMP	Asbestos Management Plan
CAR	Control of Asbestos Regulations
CBC	Corby Borough Council
EA	Environment Agency
HSE	Health and Safety Executive
HSG	Health and Safety Guidance
MMMF	Machine Made Mineral Fibre
NADIS	No Asbestos Detected in Sample
UKAS	United Kingdom Accreditation Service

8.0 References

- | | |
|----------|---|
| HSG 264 | Asbestos: The Surveyors Guide, 2012. |
| HSG 248 | Asbestos: The Analysts Guide for Sampling, Analysis and Clearance Procedures, 2005. |
| CAR 2012 | The Control of Asbestos Regulations 2012. |

Appendix A

Inspection Reports

Photo Number	1	Reference number	220316MW01
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW02
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Poor	2
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	3 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	2	Reference number	220316MW03
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Black and grey floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	3 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	3	Reference number	220316MW02
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Poor	2
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	10 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	4	Reference number	220316MW17
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW16
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	02 / Kitchen	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	5	Reference number	220316MW04
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Black and grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	6	Reference number	220316MW05
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	04 / Cupboard	Material Friability	Low	1
Feature	Top section of down pipe	Asbestos Type	Chrysotile (White)	1
Material Type	Cement			
Extent	1 m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	7	Reference number	220316MW06
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 3	Material Friability	Low	1
Feature	Packer below window ledge	Asbestos Type	Chrysotile (White)	1
Material Type	Bitumen			
Extent	<1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	8	Reference number	220316MW16
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	05 / Bedroom 3	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	9	Reference number	220316MW07
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 3	Material Friability	Low	1
Feature	Brown floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	10	Reference number	220316MW08
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	10 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	11	Reference number	220316MW10
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW08
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Coating to wall (high level)	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	3 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	12	Reference number	220316MW09
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Good	0
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Green floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	7 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	13	Reference number	220316MW13
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	10 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	14	Reference number	220316MW14
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Medium	2
Feature	Putty to windows	Asbestos Type	N.A.D.I.S	0
Material Type	Gasket / Seal			
Extent	1 m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	15	Reference number	220316MW18
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW16
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	07 / Bedroom 1	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	16	Reference number	220316MW12
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Good	0
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	17	Reference number	220316MW11
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW12
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Good	0
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	18	Reference number	220316MW15
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Balcony	Material Friability	Low	1
Feature	Floor covering	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	1 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	19	Reference number	220316MW26
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW05
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	10 / Cupboard	Material Friability	Low	1
Feature	Pipe in riser	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Cement			
Extent	3 m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	20	Reference number	220316MW19
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW09
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	21	Reference number	220316MW20
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	22	Reference number	220316MW22
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	4 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	23	Reference number	220316MW23
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW13
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Lounge	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	24	Reference number	220316MW24
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	25	Reference number	220316MW25
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	13 / Bedroom 2	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	26	Reference number	220316MW27
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW25
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 12 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	14 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	27	Reference number	220316MW41
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Coating to stairwell walls	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	28	Reference number	220316MW36
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW25
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	29	Reference number	220316MW37
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW42
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	30	Reference number	220316MW38
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Acoustic pad to underside of sink	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	1 No.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
---	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	---

Photo Number	31	Reference number	220316MW39
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	32	Reference number	220316MW40
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	04 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	33	Reference number	220316MW42
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	34	Reference number	220316MW43
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW41
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Coating to walls	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	12 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	35	Reference number	220316MW44
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW15
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	12 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	36	Reference number	220316MW45
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	3 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	37	Reference number	220316MW46
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	11 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	38	Reference number	220316MW47
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	39	Reference number	220316MW48
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW03
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	40	Reference number	220316MW49
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 11 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	10 / Bedroom 2	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	41	Reference number	220316MW50
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW25
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bedroom 2	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	42	Reference number	220316MW51
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW25
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	43	Reference number	220316MW52
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW22
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 11 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	4 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	44	Reference number	220316MW55
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	45	Reference number	220316MW56
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	11 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	46	Reference number	220316MW57
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW56
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	47	Reference number	220316MW58
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW24
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 10 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	48	Reference number	220316MW59
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	49	Reference number	220316MW60
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bathroom	Material Friability	Low	1
Feature	Brown and blue floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	3 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	50	Reference number	220316MW61
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Bedroom 1	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	8 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	51	Reference number	220316MW62
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Bedroom 1	Material Friability	Low	1
Feature	Brown floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	52	Reference number	220316MW63
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW62
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Low	1
Feature	Brown floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	53	Reference number	220316MW64
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Medium	2
Feature	Backing to lino	Asbestos Type	N.A.D.I.S	0
Material Type	Paper			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	54	Reference number	220316MW65
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bedroom 2	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	12 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	55	Reference number	220316MW66
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	56	Reference number	220316MW67
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW66
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	57	Reference number	220316MW68
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW66
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	58	Reference number	220316MW69
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW64
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 10 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Cupboard	Material Friability	Medium	2
Feature	Backing to lino	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Paper			
Extent	1 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	59	Reference number	230316MW70
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Good	0
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		2
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	60	Reference number	230316MW71
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	12 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	--

Photo Number	61	Reference number	230316MW72
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	62	Reference number	230316MW73
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	63	Reference number	230316MW74
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 9 - Neville House	Condition	Good	0
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Lounge	Material Friability	Low	1
Feature	Lino to floor	Asbestos Type	N.A.D.I.S	0
Material Type	Floor Tile / Covering			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	64	Reference number	230316MW21
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Lounge	Material Friability	Low	1
Feature	Bitumen to duct flange	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	<1 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	65	Reference number	230316MW75
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	66	Reference number	230316MW76
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	67	Reference number	230316MW77
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	68	Reference number	230316MW78
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	69	Reference number	230316MW79
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bedroom 1	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	70	Reference number	230316MW80
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW79
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	1 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	--

Photo Number	71	Reference number	230316MW81
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 9 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	13 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	4 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	72	Reference number	230316MW82
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	73	Reference number	230316MW83
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Coating to walls	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	5 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	74	Reference number	230316MW84
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	75	Reference number	230316MW85
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW82
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	76	Reference number	230316MW86
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Surround to door bell	Asbestos Type	N.A.D.I.S	0
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	77	Reference number	230316MW87
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	78	Reference number	230316MW88
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	79	Reference number	230316MW88A
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	80	Reference number	230316MW88B
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Coating to high level boxing (bottom of stairs)	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	3 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	81	Reference number	230316MW89
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Lounge	Material Friability	Low	1
Feature	Coating to high level boxing (behind stairs)	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	3 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	82	Reference number	230316MW90
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	83	Reference number	230316MW91
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	84	Reference number	230316MW92
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	85	Reference number	230316MW93
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	08 / Bedroom 2	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	86	Reference number	230316MW94
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Bedroom 2	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	87	Reference number	230316MW95
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	88	Reference number	230316MW96
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	89	Reference number	230316MW97
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	90	Reference number	230316MW98
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 8 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	91	Reference number	230316MW99
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	92	Reference number	230316MW100
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	93	Reference number	230316MW101
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW24
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	04 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	94	Reference number	230316MW102
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	95	Reference number	230316MW103
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	96	Reference number	230316MW104
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	97	Reference number	230316MW105
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	98	Reference number	230316MW106
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Bedroom 1	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	99	Reference number	230316MW107
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	100	Reference number	230316MW108
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	---

Photo Number	101	Reference number	230316MW109
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 7 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	102	Reference number	230316MW110
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Hallway	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	103	Reference number	230316MW111
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	104	Reference number	230316MW112
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW24
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	04 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	105	Reference number	230316MW113
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Hallway	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	7 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	106	Reference number	230316MW114
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	107	Reference number	230316MW115
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	3 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	108	Reference number	230316MW116
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 2	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	109	Reference number	230316MW117
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	110	Reference number	230316MW118
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	111	Reference number	230316MW119
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	112	Reference number	230316MW120
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 6 - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	113	Reference number	230316MW121
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	114	Reference number	230316MW122
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	115	Reference number	230316MW123
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	116	Reference number	230316MW124
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 3	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	117	Reference number	230316MW125
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	118	Reference number	230316MW126
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	119	Reference number	230316MW127
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	120	Reference number	230316MW128
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	16 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	121	Reference number	230316MW129
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	122	Reference number	230316MW130
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	123	Reference number	230316MW131
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	124	Reference number	230316MW132
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	125	Reference number	230316MW133
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	12 / Bedroom 2	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	126	Reference number	230316MW134
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 5 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	13 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	127	Reference number	230316MW135
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	12 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	128	Reference number	230316MW136
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	129	Reference number	230316MW140
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	04 / Bedroom 3	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	130	Reference number	230316MW137
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Landing	Material Friability	Low	1
Feature	Grey floor tiles	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Neville House Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
---	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	---

Photo Number	131	Reference number	230316MW138
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	132	Reference number	230316MW139
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	133	Reference number	230316MW141
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	134	Reference number	230316MW142
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 4 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	4 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	135	Reference number	230316MW143
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	136	Reference number	230316MW144
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	137	Reference number	230316MW145
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	138	Reference number	230316MW146
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	139	Reference number	230316MW147
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	140	Reference number	230316MW148
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 3 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	141	Reference number	230316MW149
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	20 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	142	Reference number	230316MW150
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW148
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Lounge	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	143	Reference number	230316MW151
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW128
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	144	Reference number	230316MW152
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW86
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Lounge	Material Friability	Low	1
Feature	Surround to door bell	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	145	Reference number	230316MW153
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	146	Reference number	230316MW154
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 3 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	147	Reference number	230316MW155
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	148	Reference number	230316MW156
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	15 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	149	Reference number	230316MW157
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	04 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	150	Reference number	230316MW158
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 3	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	151	Reference number	230316MW159
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	152	Reference number	230316MW160
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	153	Reference number	230316MW161
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Cupboard	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	154	Reference number	230316MW162
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	155	Reference number	230316MW163
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	156	Reference number	230316MW164
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	157	Reference number	230316MW165
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW128
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	20 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	158	Reference number	230316MW166
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	12 / Bedroom 2	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	159	Reference number	230316MW167
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW70
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 2 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	13 / Cupboard	Material Friability	Low	1
Feature	Red floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	160	Reference number	230316MW170
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW172
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textured Coating			
Extent	4 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	--

Photo Number	161	Reference number	230316MW171
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	01 / Lobby	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	4 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	162	Reference number	230316MW172
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	10 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	163	Reference number	230316MW173
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	02 / Kitchen	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	164	Reference number	230316MW174
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	03 / Cupboard	Material Friability	Low	1
Feature	Grey and black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	165	Reference number	230316MW175
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	04 / Cupboard	Material Friability	Low	1
Feature	Cement down pipe	Asbestos Type	Chrysotile (White) and Crocidolite (Blue)	3
Material Type	Cement			
Extent	2 m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		6
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	166	Reference number	230316MW176
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	05 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	167	Reference number	230316MW177
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	10 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	168	Reference number	230316MW178
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	06 / Landing	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	10 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	169	Reference number	230316MW179
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	07 / Bedroom 1	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	8 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	170	Reference number	230316MW180
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Lounge	Material Friability	Low	1
Feature	Coating to ceiling	Asbestos Type	N.A.D.I.S	0
Material Type	Textured Coating			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	--

Photo Number	171	Reference number	230316MW181
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW128
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	08 / Lounge	Material Friability	Low	1
Feature	Bitumen adhesive beneath parquet flooring	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	15 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	172	Reference number	230316MW182
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Bathroom	Material Friability	Low	1
Feature	Toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	173	Reference number	230316MW183
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW81
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	09 / Bathroom	Material Friability	Low	1
Feature	Blue and green floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	2 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	174	Reference number	230316MW184
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	10 / Cupboard	Material Friability	Low	1
Feature	Grey floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	0.5 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	175	Reference number	230316MW185
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Flat 1 - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	11 / Bedroom 2	Material Friability	Medium	2
Feature	Panelling beneath window	Asbestos Type	N.A.D.I.S	0
Material Type	Insulating Board			
Extent	2 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	176	Reference number	230316MW186
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	230316MW72
			
Notes	ACM: Asbestos Containing Material		

Building	Flat 1 - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	11 / Bedroom 2	Material Friability	Low	1
Feature	Black floor tiles and adhesive	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	6 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

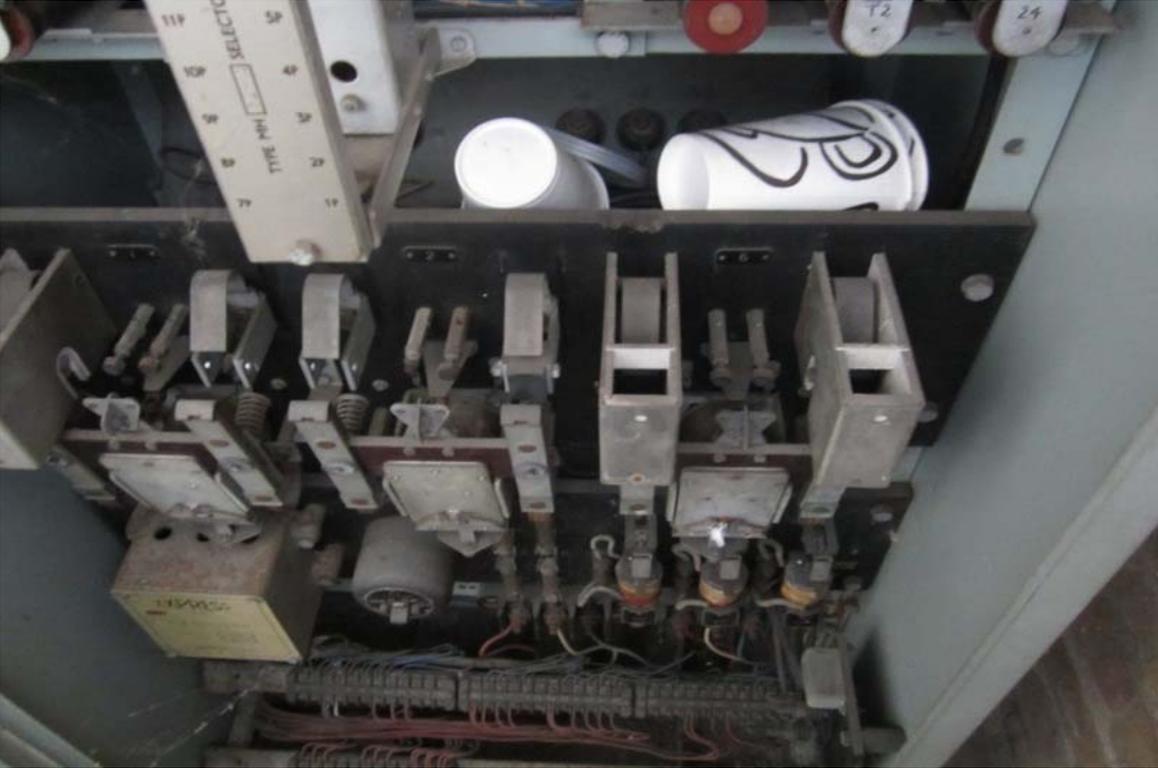
Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	177	Reference number	220316MW31
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Unsealed AIB or encapsulated lagging and spray	2
Location	5.03 / Lift Motor Room	Material Friability	Medium	2
Feature	Relay block and breakers within 2 Switch gear boxes to lifts	Asbestos Type	Chrysotile (White)	1
Material Type	Insulating Board			
Extent	Throughout			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		6
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	178	Reference number	220316MW32
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW29
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.03 / Lift Motor Room	Material Friability	Medium	2
Feature	Flash guard within fuses box to back wall	Asbestos Type	Strongly Presumed Chrysotile (White)	1
Material Type	Textile			
Extent	1 Box			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	179	Reference number	220316MW33
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW28
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.03 / Lift Motor Room	Material Friability	Medium	2
Feature	Rope seal within fuses box to back wall	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textile			
Extent	1 Box			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

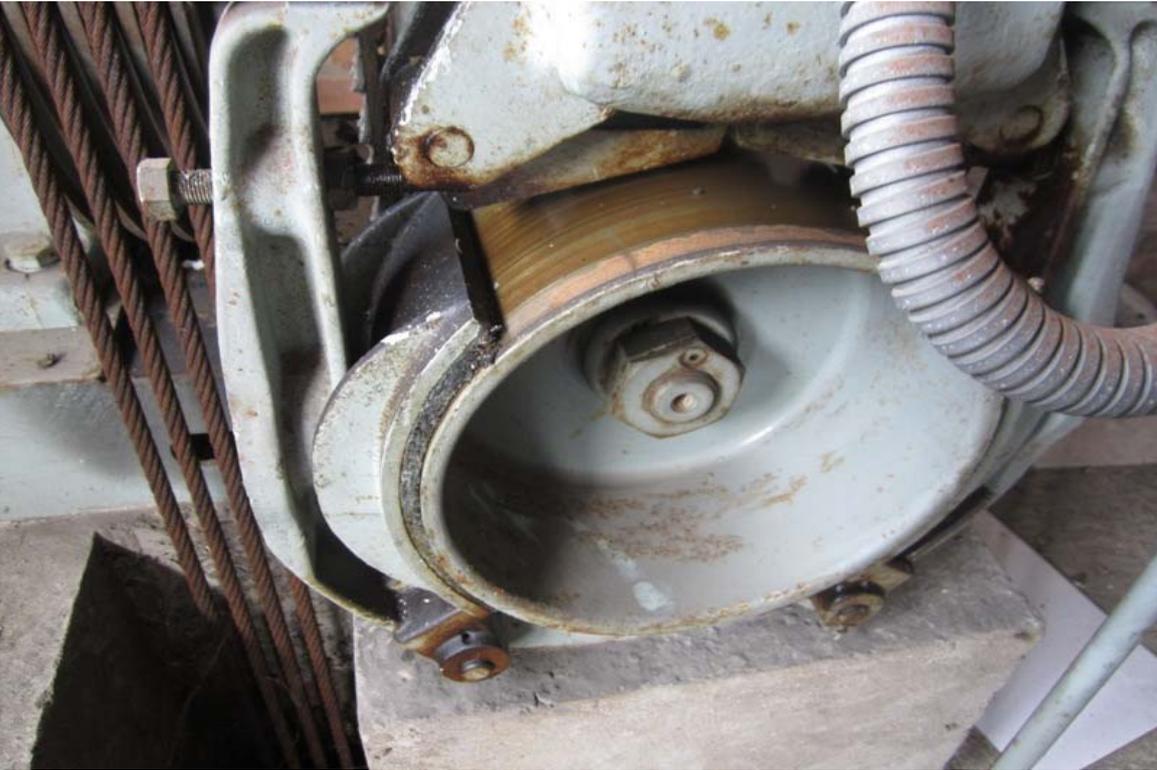
Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	180	Reference number	220316MW34
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.03 / Lift Motor Room	Material Friability	Low	1
Feature	Brake shoe to lift motor (left of door)	Asbestos Type	Chrysotile (White)	1
Material Type	Cement			
Extent	2 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		4
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	181	Reference number	220316MW35
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.03 / Lift Motor Room	Material Friability	Medium	2
Feature	Brake shoe to lift motor (right of door)	Asbestos Type	Chrysotile (White)	1
Material Type	Textile			
Extent	2 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	182	Reference number	240316MW190
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW28
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.03 / Lift Motor Room	Material Friability	Medium	2
Feature	Rope seal within fuses boxes to door wall	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textile			
Extent	2 No.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	183	Reference number	240316MW191
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	220316MW20
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Poor	2
Floor Level	5th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	5.05 / Store	Material Friability	Low	1
Feature	Redundant toilet cistern	Asbestos Type	Strongly Presumed Amosite (Brown)	2
Material Type	Composite / Resin			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	184	Reference number	240316MW194
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW193
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.06 / Roof (Right)	Material Friability	Low	1
Feature	Down pipe next to door	Asbestos Type	Strongly Presumed Chrysotile (White) and Crocidolite (Blue)	3
Material Type	Cement			
Extent	2 m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		6
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	185	Reference number	240316MW195
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW193
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.06 / Roof (Right)	Material Friability	Low	1
Feature	Cowl	Asbestos Type	Strongly Presumed Chrysotile (White) and Crocidolite (Blue)	3
Material Type	Cement			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		6
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	186	Reference number	240316MW196
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW192
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	5.06 / Roof (Right)	Material Friability	Low	1
Feature	Roof felt	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Bitumen			
Extent	300 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	187	Reference number	240316MW192
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	5th floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	5.07 / Roof (Left)	Material Friability	Low	1
Feature	Roof felt	Asbestos Type	N.A.D.I.S	0
Material Type	Bitumen			
Extent	2 m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	188	Reference number	240316MW193
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Poor	2
Floor Level	5th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	5.07 / Roof (Left)	Material Friability	Low	1
Feature	Down pipe near door	Asbestos Type	Chrysotile (White) and Crocidolite (Blue)	3
Material Type	Cement			
Extent	50 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		6
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	189	Reference number	240316MW197
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	4.04 / Tank Room	Material Friability	Medium	2
Feature	Pipe wrap string (top)	Asbestos Type	N.A.D.I.S	0
Material Type	Textile			
Extent	1 m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	190	Reference number	240316MW198
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW197
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Poor	2
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	4.04 / Tank Room	Material Friability	Medium	2
Feature	Pipe wrap string (bottom)	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Textile			
Extent	1 m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	191	Reference number	240316MW204
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	4th floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	4.05 / Lift Shaft	Material Friability	Low	1
Feature	Floor tiles and adhesive within lift car	Asbestos Type	Chrysotile (White)	1
Material Type	Floor Tile / Covering			
Extent	3 sq. m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	192	Reference number	240316MW199
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	3.01 / Landing and Stairs	Material Friability	Low	1
Feature	Blue floor covering	Asbestos Type	N.A.D.I.S	0
Material Type	Floor Tile / Covering			
Extent	30 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	193	Reference number	240316MW201
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW199
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	3.02 / Corridor	Material Friability	Low	1
Feature	Blue floor covering	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Floor Tile / Covering			
Extent	30 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	194	Reference number	240316MW200
Inspection / Sample	Inspection	Inspection Cross Reference / Visual I.D.	240316MW199
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	3.04 / Corridor	Material Friability	Low	1
Feature	Blue floor covering	Asbestos Type	Strongly Presumed N.A.D.I.S	0
Material Type	Floor Tile / Covering			
Extent	60 sq. m.			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	195	Reference number	220316MW53
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	3.05 / Refuse Room	Material Friability	Medium	2
Feature	Rope seal within sanitary burner	Asbestos Type	Chrysotile (White)	1
Material Type	Textile			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	196	Reference number	220316MW54
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	3rd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	3.05 / Refuse Room	Material Friability	Medium	2
Feature	Panel within sanitary burner	Asbestos Type	Chrysotile (White)	1
Material Type	Insulating Board			
Extent	1 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	197	Reference number	220316MW28
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	NADIS: No Asbestos Detected In Sample		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	2.02 / Meter Room	Material Friability	Medium	2
Feature	Rope seals within old fuse boxes	Asbestos Type	N.A.D.I.S	0
Material Type	Textile			
Extent	4 boxes			
Recommendation	No action necessary	Assessment Score		0
		Assessment Band		E

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	198	Reference number	220316MW29
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	2.02 / Meter Room	Material Friability	Medium	2
Feature	Flash guard loose and in old fuse boxes	Asbestos Type	Chrysotile (White)	1
Material Type	Textile			
Extent	1 loose + 2 boxes			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	199	Reference number	220316MW30
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	2nd floor	Surface Treatment	Enclosed sprays and lagging, encapsulated AIB, cement etc.	1
Location	2.02 / Meter Room	Material Friability	Medium	2
Feature	Core to ceramic fuses within fuse box and loose	Asbestos Type	Chrysotile (White)	1
Material Type	Paper			
Extent	aprox 20 No.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		5
		Assessment Band		C

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW
--	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk	
--	---	---

Photo Number	200	Reference number	240316MW202
Inspection / Sample	Sample	Inspection Cross Reference / Visual I.D.	Not Applicable
			
Notes	ACM: Asbestos Containing Material		

Building	Communal Areas - Neville House	Condition	Fair	1
Floor Level	Ground	Surface Treatment	Composite materials, reinforced plastics, resin, vinyl materials	0
Location	0.01 / Entrance Lobby and Stairs	Material Friability	Low	1
Feature	Nosing strip to stairs	Asbestos Type	Chrysotile (White)	1
Material Type	Composite / Resin			
Extent	20 m.			
Recommendation	Remove if likely to be disturbed during the refurbishment works	Assessment Score		3
		Assessment Band		D

Site Address Communal Areas 90 - 91 Bede Close Corby	Client Details Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	
--	---	---

Corby Borough Council 10 Fleming Road Corby Northants NN17 4SW	Contact Details: Tel: 01536 740060 Fax: 01536 740068 Email: asbestos.team@corby.gov.uk
--	---

Appendix B

Risk Assessment Criteria

Material Risk Assessment

Material Assessment Algorithm

The material risk assessment algorithm is detailed within HSG 264 and is a requirement for identifying areas of concern in order to develop an Asbestos Management Plan as required by the Control of Asbestos Regulations 2012.

The CBC Algorithm is based upon the HSG 264 algorithm, with the scoring shown below:

Product type (Friability)	Reinforced composites (plastics, resins, mastics, roofing felts, vinyl floor tiles, semi rigid paints or decorative finishes, cements, etc)	1
	AIB, millboards, other low density insulating boards, textiles, gaskets, ropes, woven textiles, paper and felt	2
	Thermal insulation (eg pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing	3
Extent of Damage (Condition)	Good: No visible damage	0
	Low damage: A few scratches or surface marks, broken edge to boards, etc	1
	Medium damage: significant breakage of materials or several small areas where material has been damaged revealing loose asbestos fibres	2
	High damage or delamination of materials, spray and thermal insulation. Visible asbestos debris	3
Surface Treatment	Composite materials, reinforced plastics, resins, vinyl tiles	0
	Enclosed sprays and lagging, encapsulated AIB, cement, etc	1
	Unsealed AIB, encapsulated laggings or sprays	2
	Unsealed lagging or spray	3
Fibre Type	No Asbestos Detected	0
	Chrysotile	1
	Amosite	2
	Crocidolite	3

Once the score from each criteria is totalled a material assessment score is provided. Generally the higher the score the higher associated risk posed by a particular ACM.

The hazard assessment criterion examines the risk posed by an asbestos material to release fibres that may be inhaled. This factor is the most significant when assessing asbestos. Therefore in order to consider if an asbestos material will release fibres the material assessments considers the type of asbestos, the extent of any damage to the material, whether people will come in contact with the material etc.

These assessments are required to establish an asbestos management plan as it identifies areas of risk in order that procedures can be put in place, remedial works can be undertaken etc.

Risk Bands

The total material assessment algorithm value for each item, is compared to Risk Bands as developed by CBC in close consultation with HSG 264. The risk bands are as follows:

Band A – (10 points or above) – High Risk Material - Materials in this category pose an immediate risk to anybody in their vicinity and as such, immediate plans for removal should be made. Until Removal can be achieved, access to the location of the material should be restricted and temporary measures to seal or repair the material should be put in place. Affixing asbestos warning labels can provide additional protection prior to removal.

Risk Band B – (7 – 9 Points) – Medium Risk Material – Materials in this category require remedial action as soon as reasonably practicable. Action may range from removal to repair, encapsulation and labelling. If left in-situ, the condition of the material should be monitored regularly, ideally as a minimum, at least on a six monthly basis and may require further repair or encapsulation if the condition has deteriorated.

Risk Band C – (5 – 6 Points) – Low Risk Material – This category indicates the need for regular monitoring although the current risk of fibre release is low, this material may suffer deterioration through age/accident. It is recommended that asbestos materials in this category be visually inspected on a six monthly basis to ascertain any change in condition. Where such a change occurs the material should be re-prioritisation to Risk Band B will be necessary. Approved warning labels (A Labels) should be positioned to prevent accidental damage to the material.

Risk Band D – (1 – 4 Points) – Very Low Risk Material – This category indicates Low priority. Visual inspections should be made on an annual basis to ascertain any change in condition. Where such a change occurs re-prioritisation to Risk Band C or B will be necessary. Approved warning labels (A Labels) should be positioned to prevent accidental damage to the material.


Risk Band E (0 points) – No Asbestos Detected – No action is required.

Appendix C

Site Sketches

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

Floor 5

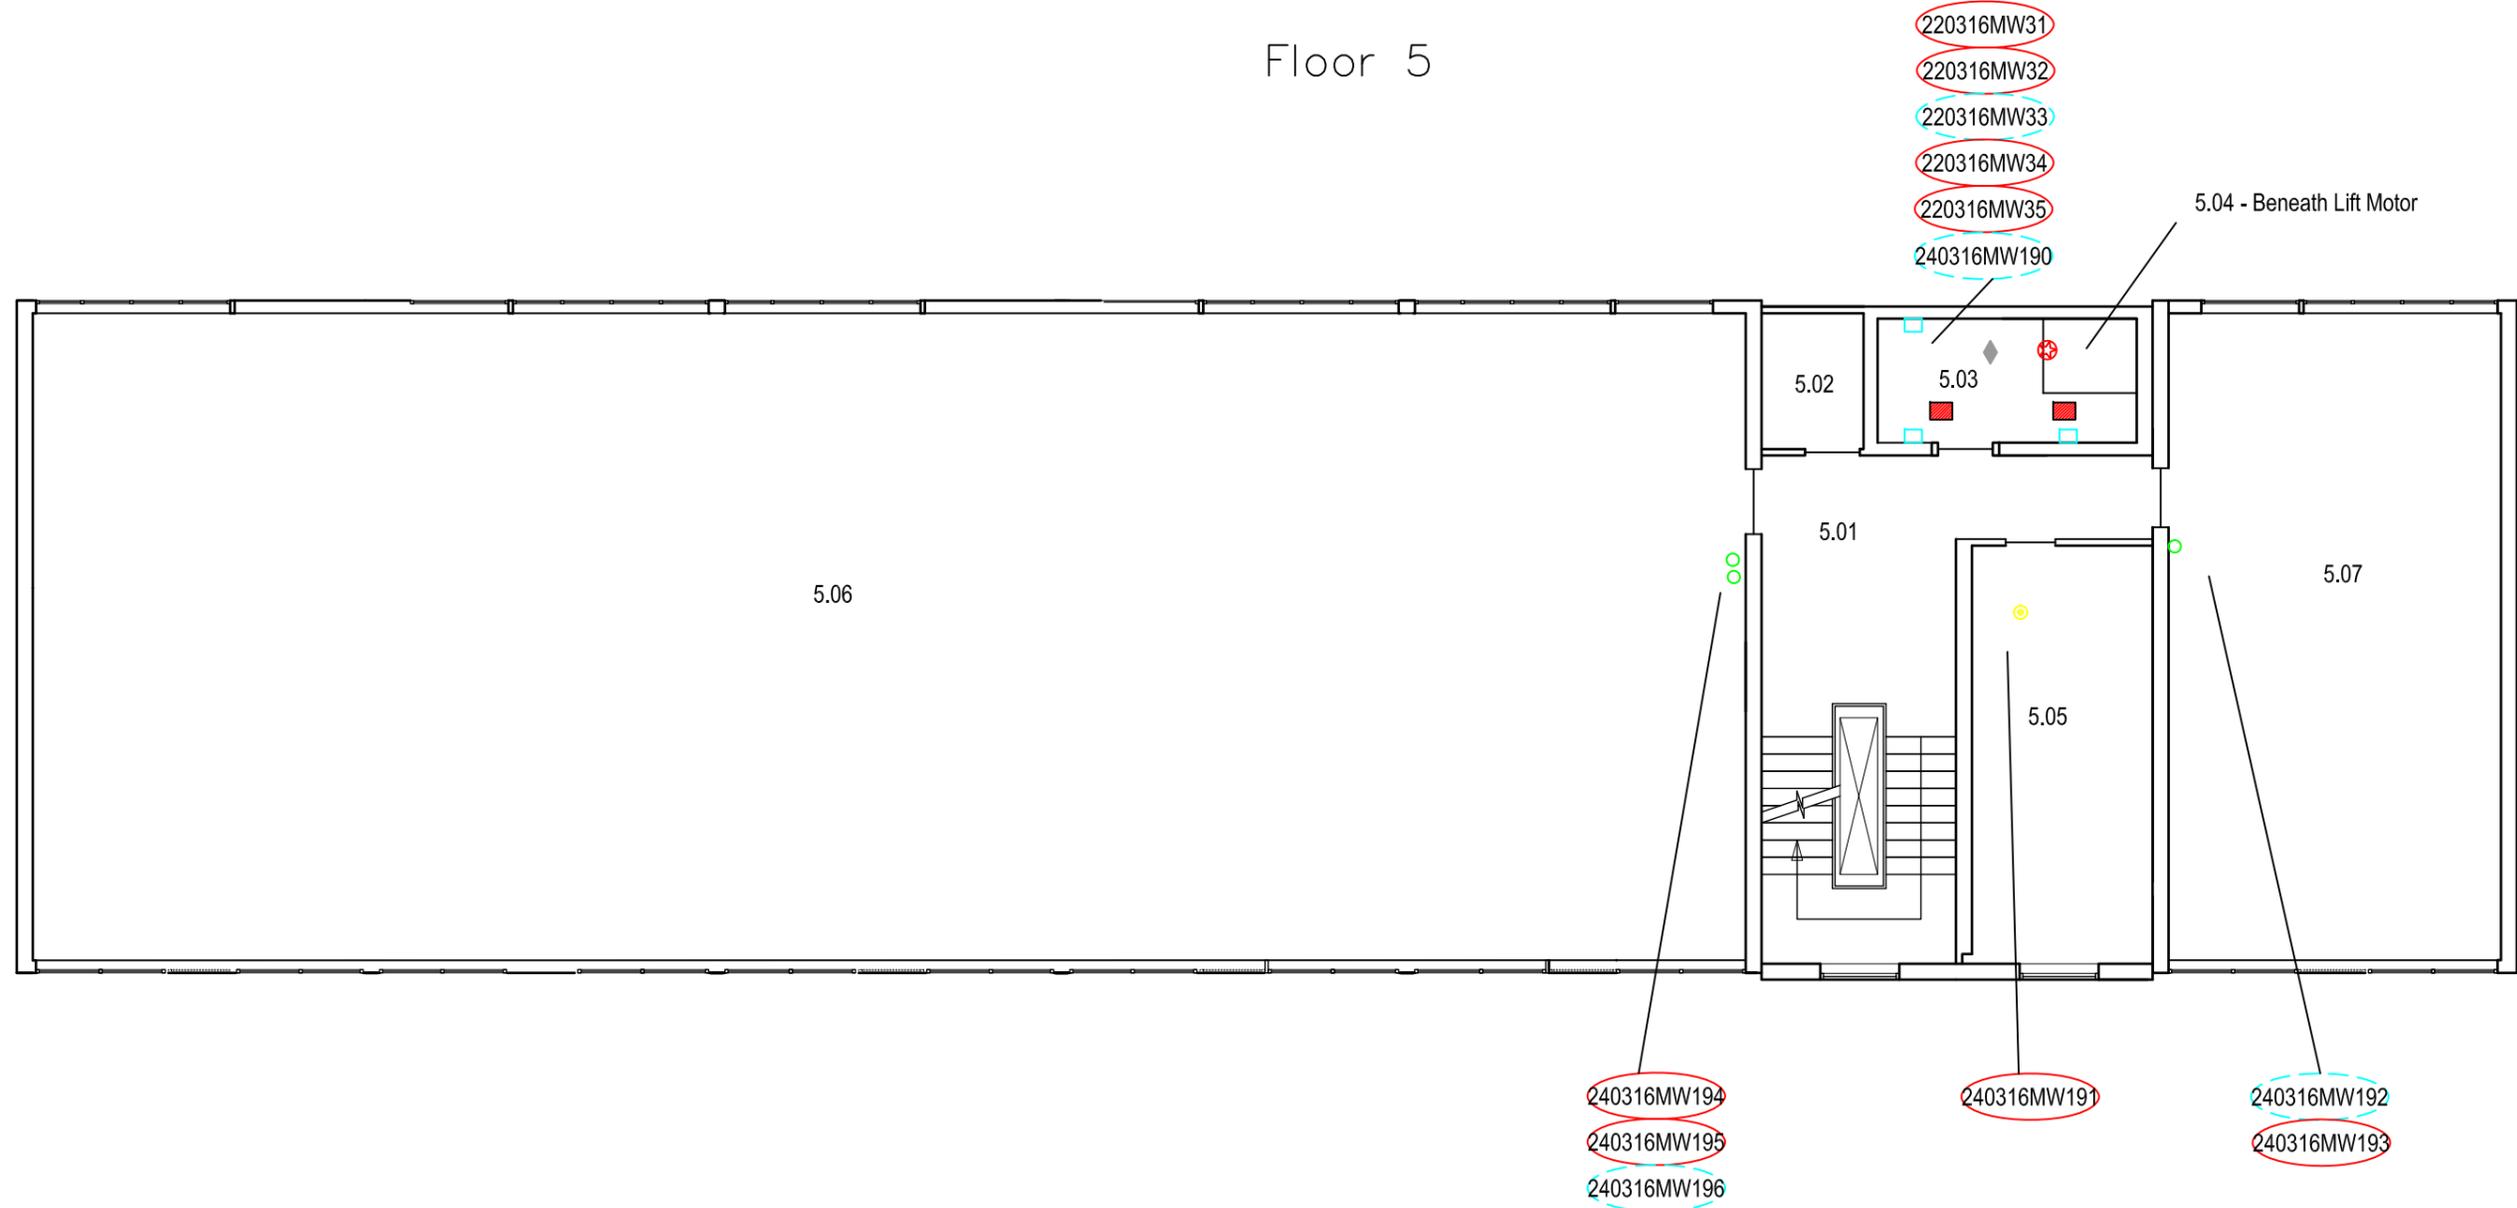

REFERENCE			
XXXXXXXXY01	Positive Inspection		Asbestos insulating board within lift switch
XXXXXXXXY01	Negative Inspection		Cement down pipe / cowl
	No access		Textile flash guard
			Cement brake shoe
			Textile brake shoe
			Toilet Cistern



5th Floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earltree industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNQ	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

Floor 4

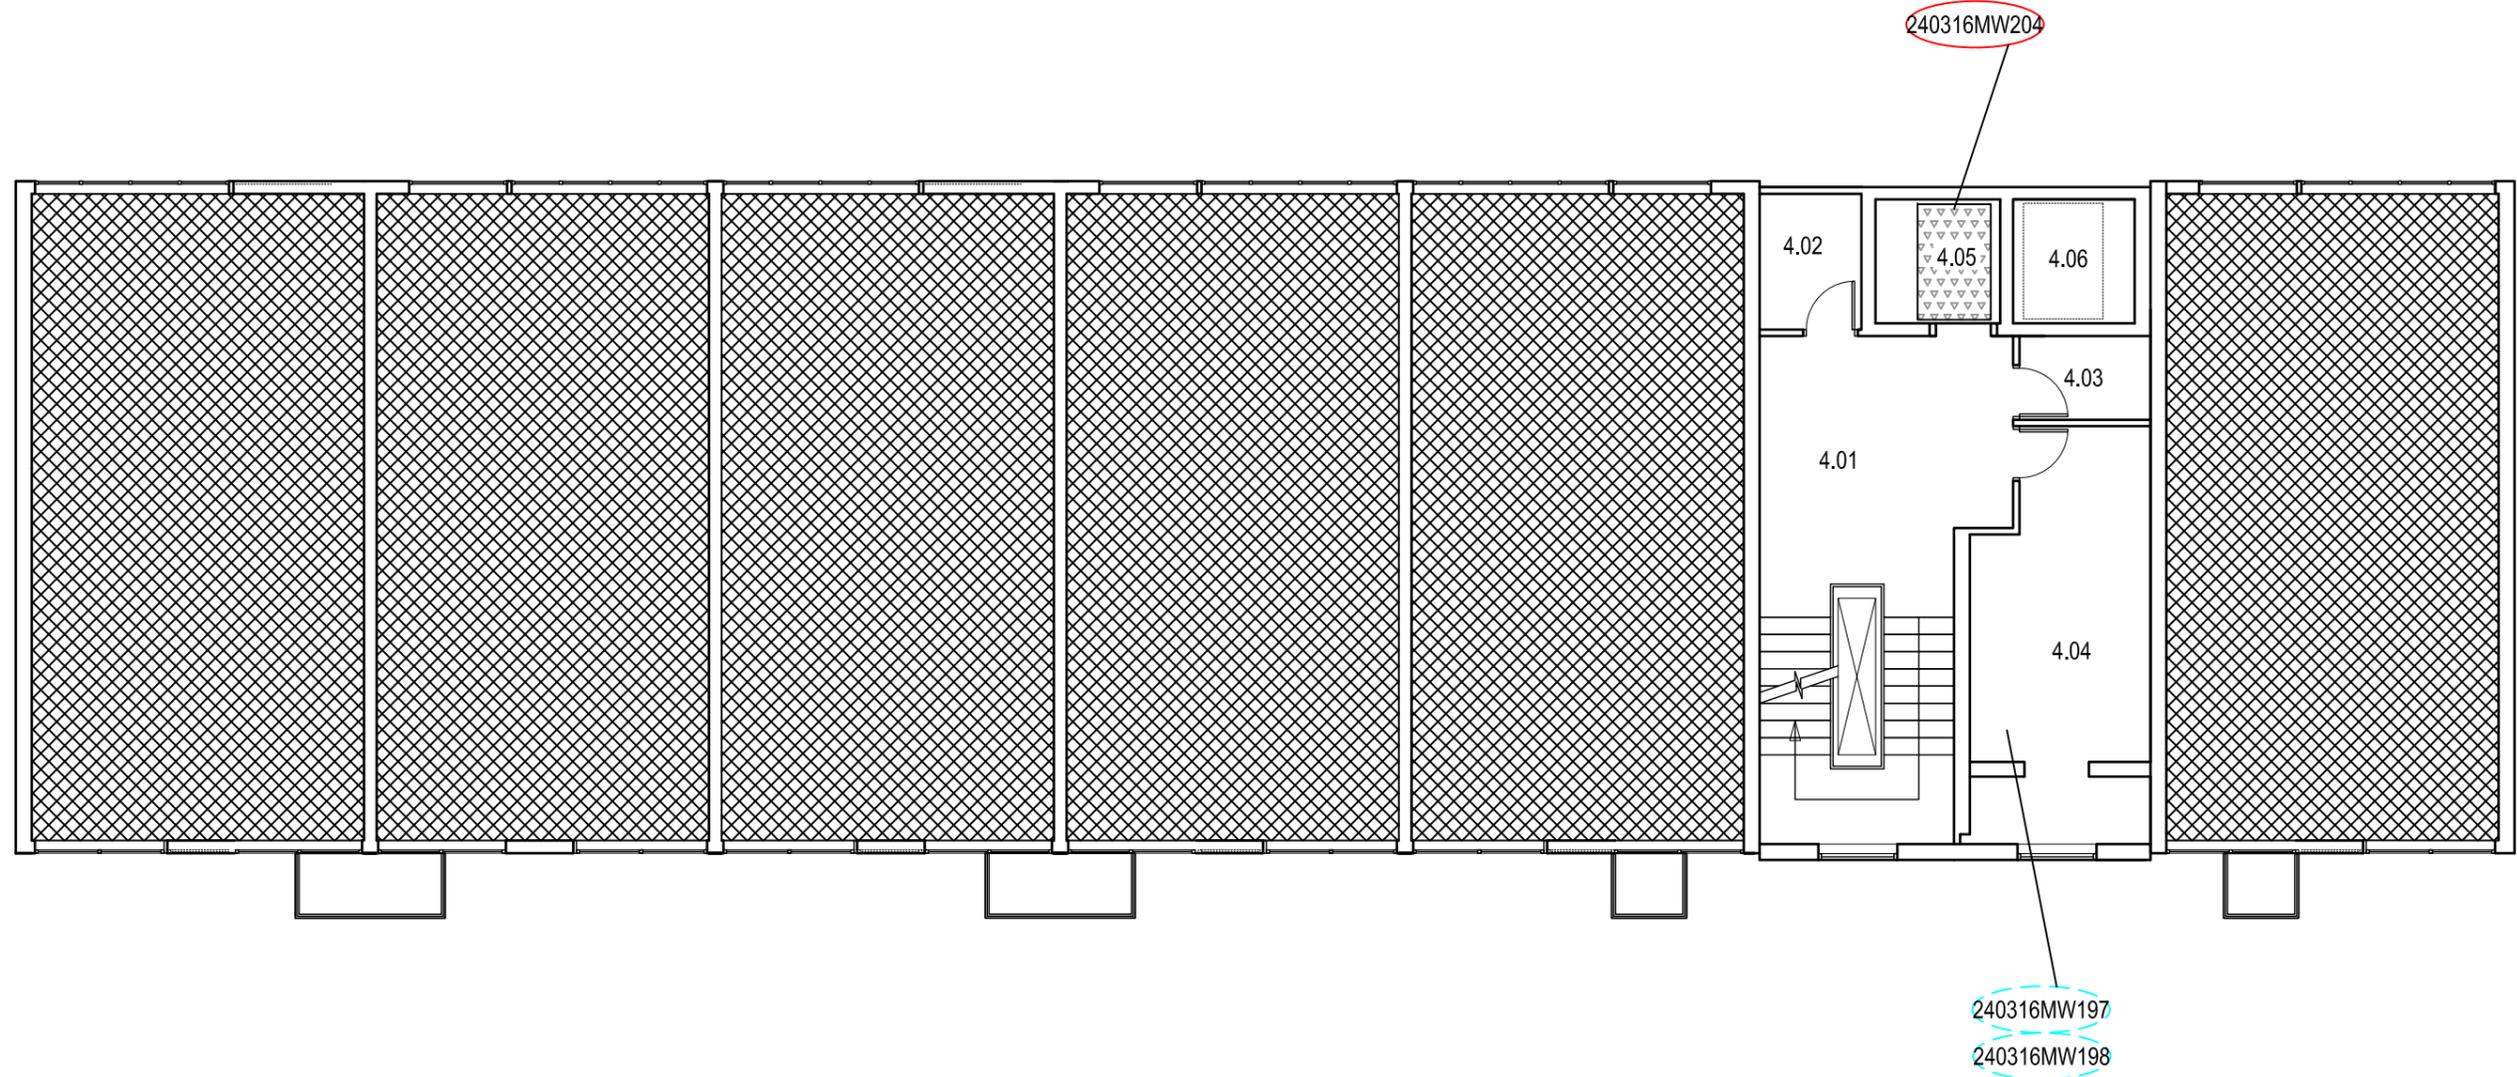

- REFERENCE
- XXXXXXXXY01 Positive Inspection
 - XXXXXXXXY01 Negative Inspection
 -  No access
 -  Floor tiles and adhesive within lift car



4th Floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstone industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNQ	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

Floor 3

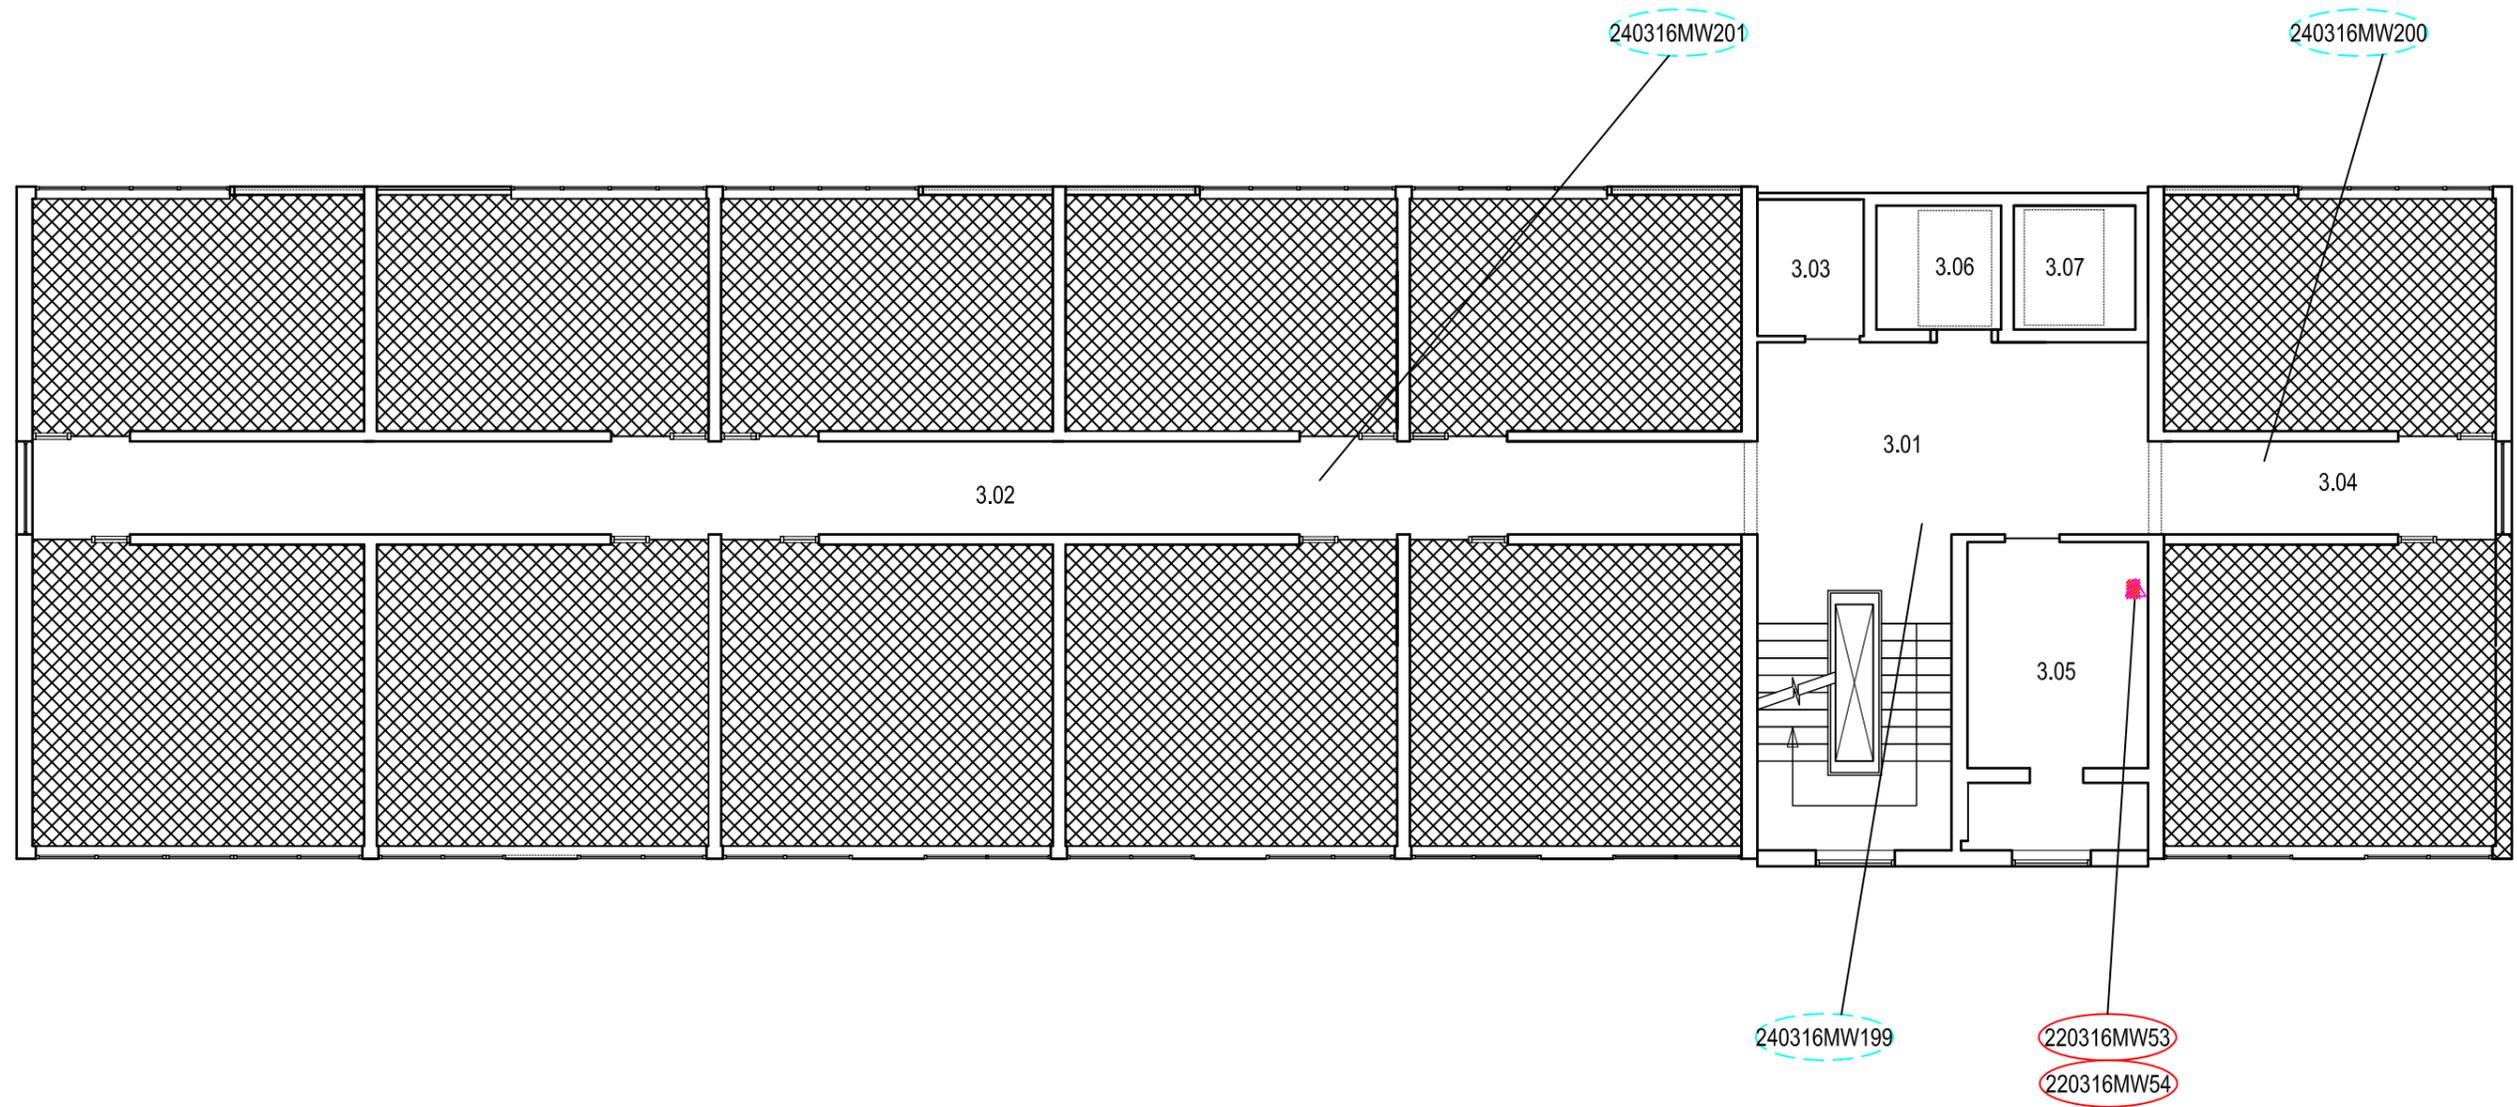

REFERENCE

- XXXXXXXXY01 Positive Inspection
- XXXXXXXXY01 Negative Inspection
- No access
- AIB panel within sanitary burner
- Rope seal



3rd Floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNQ	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

Floor 2

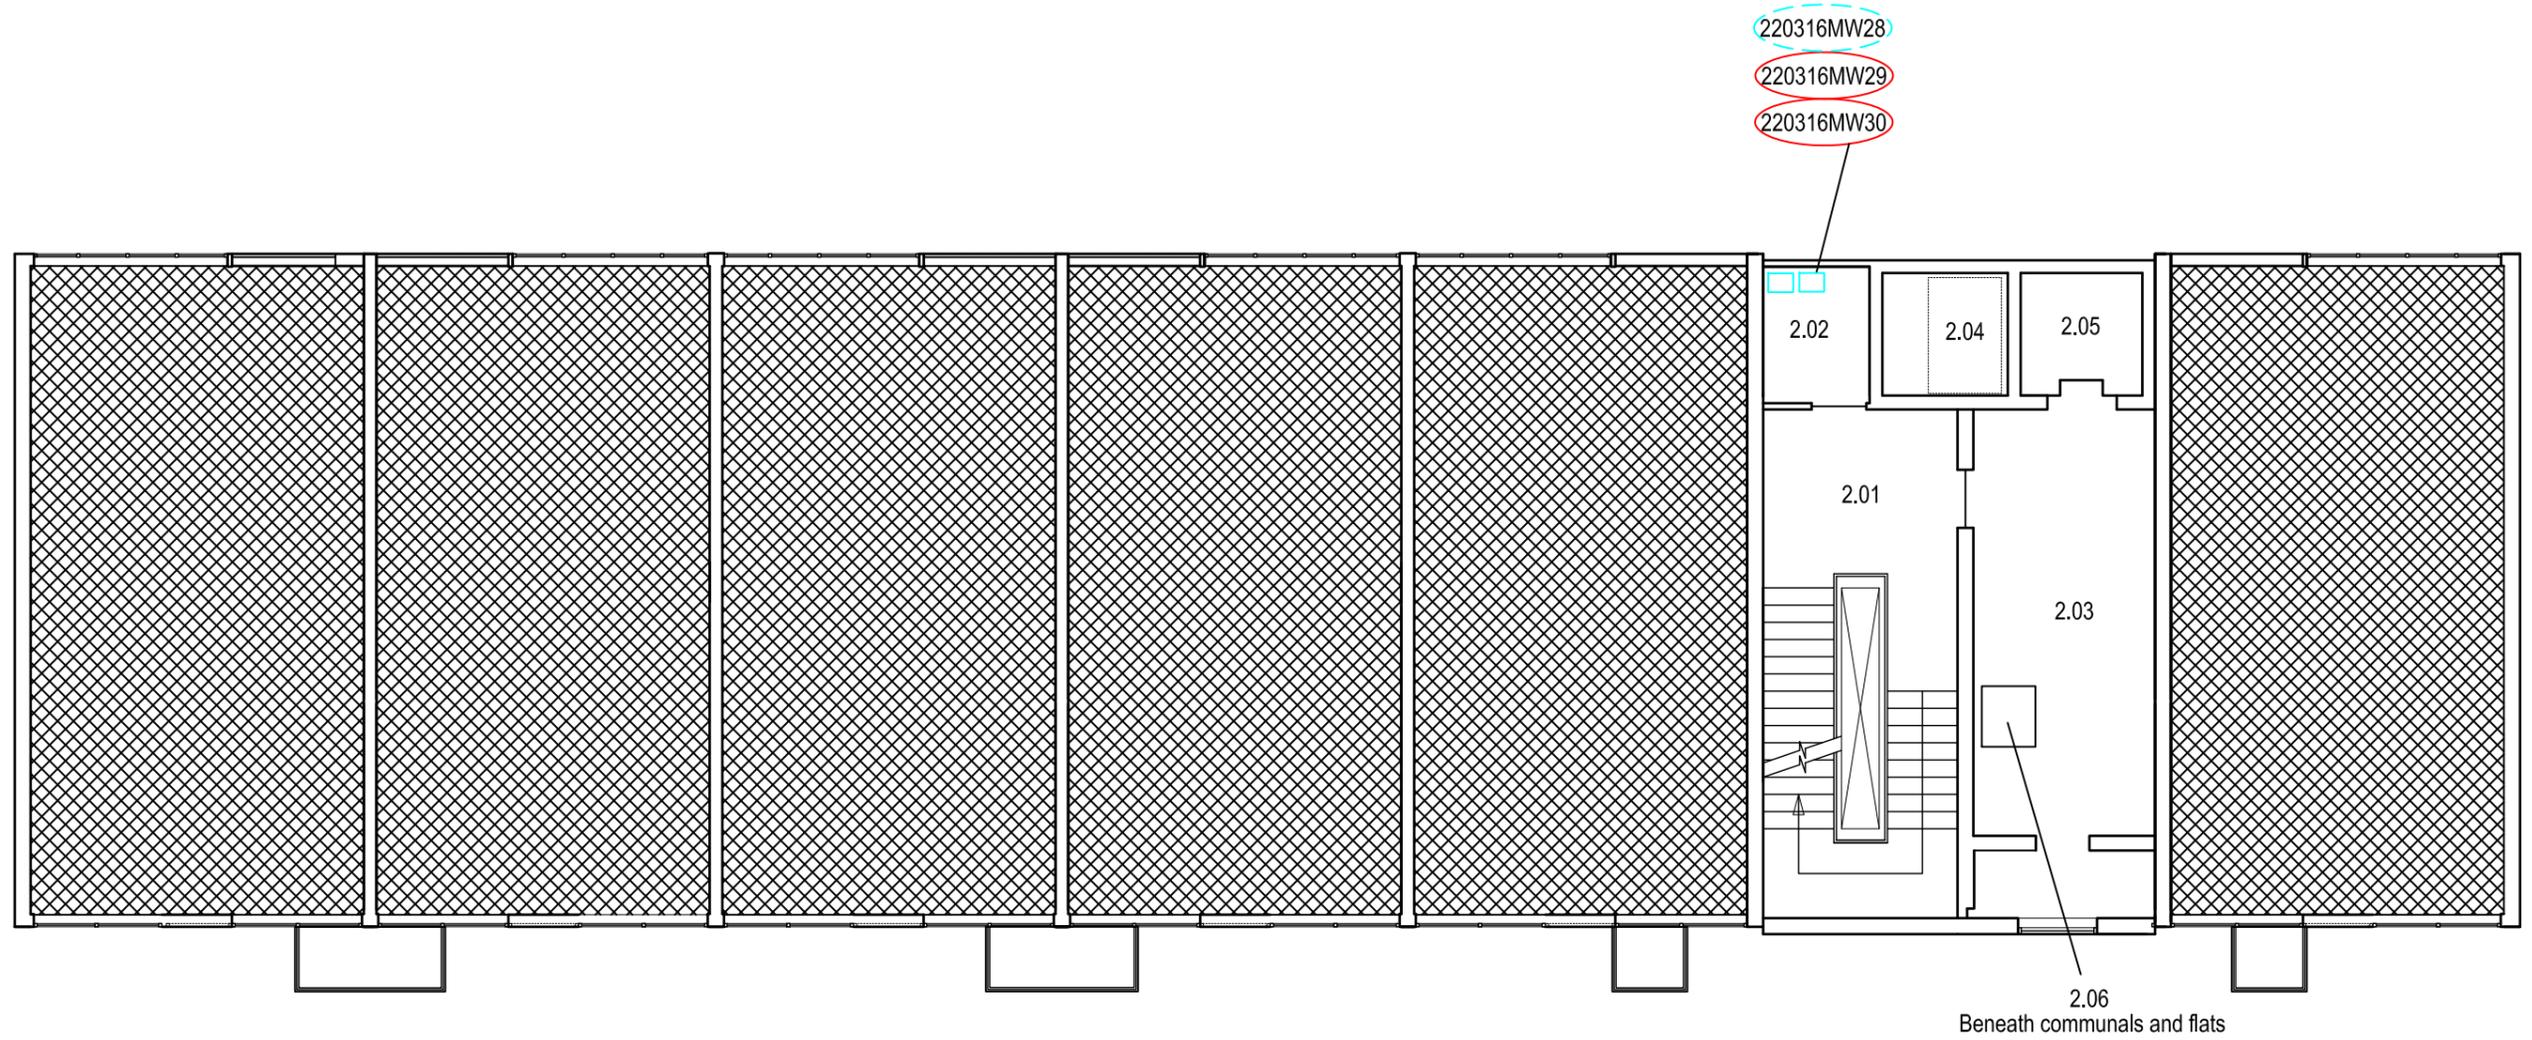

- REFERENCE
- XXXXXXXXY01 Positive Inspection
 - XXXXXXXXY01 Negative Inspection
 - No access
 - Flash guards and ceramic fuses



2nd floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNQ	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

First Floor

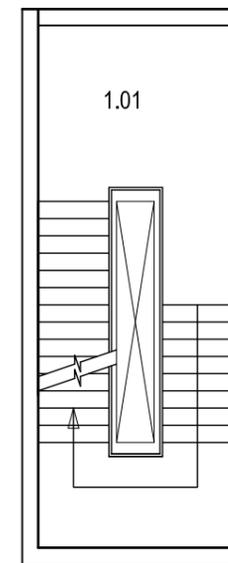

REFERENCE

XXXXXXYY01 Positive Inspection

XXXXXXYY01 Negative Inspection

 No access



1st floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNO	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

Ground Floor

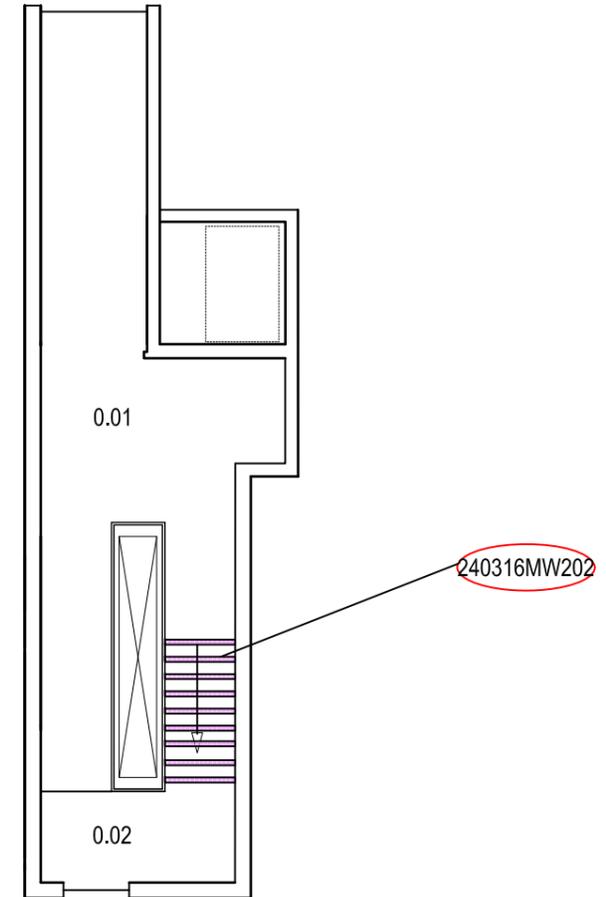

REFERENCE	
	Positive Inspection
	Negative Inspection
	No access
	Nosing strip to stairs



Ground floor, Neville House
Corby


Corby Borough Council
Asbestos Survey Plan

Client Address
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4	Drawn By	Checked By	Revision
Not to Scale	JNO	MW	1

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

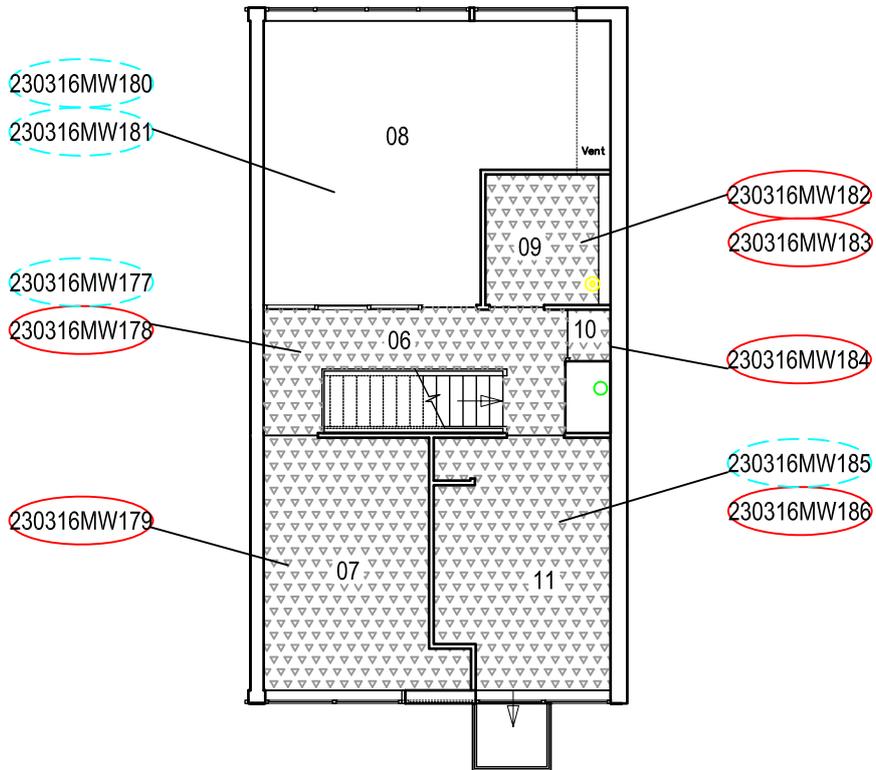

3rd Floor

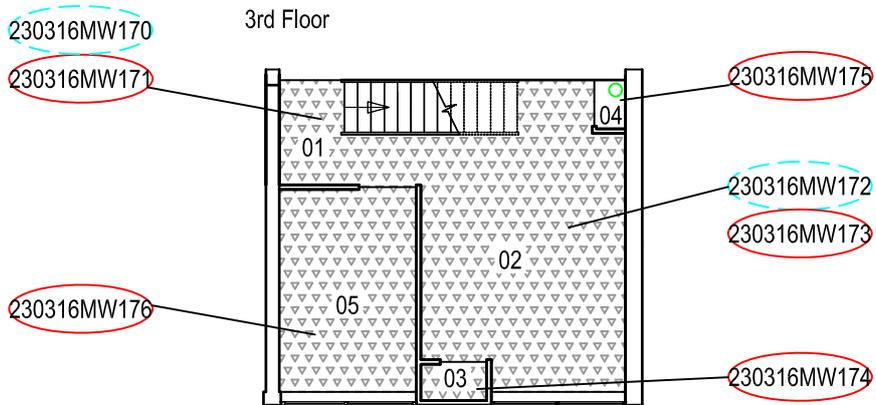

REFERENCE



Positive Inspection



Cement flue pipe



Negative Inspection



Floor tiles



No Access



Toilet cistern



Address:
Flat 1 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstreet industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

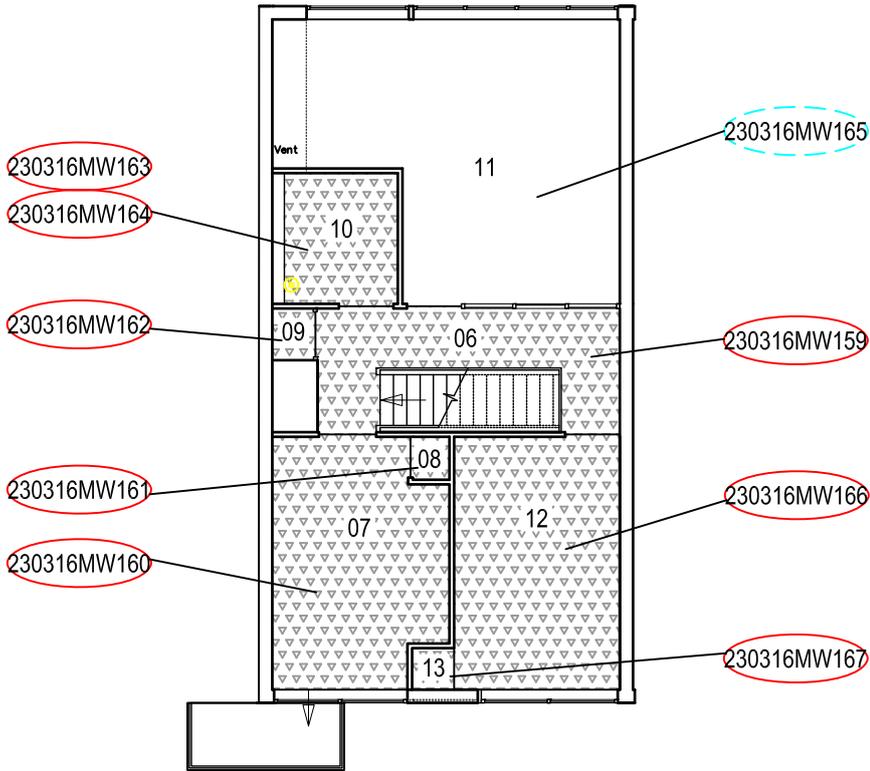

3rd Floor

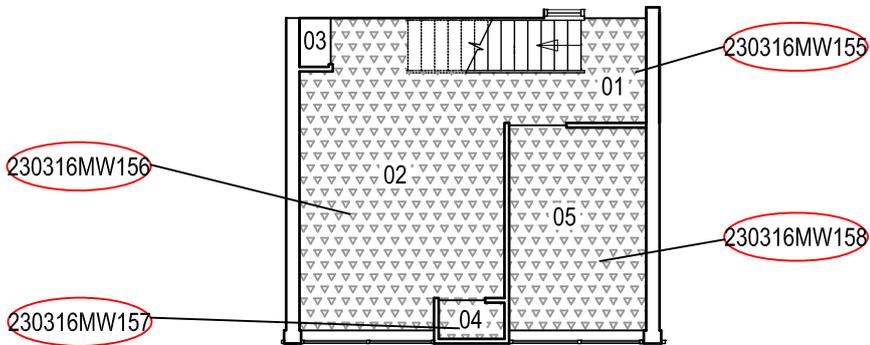

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



Toilet cistern



No Access



Address:
Flat 2 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

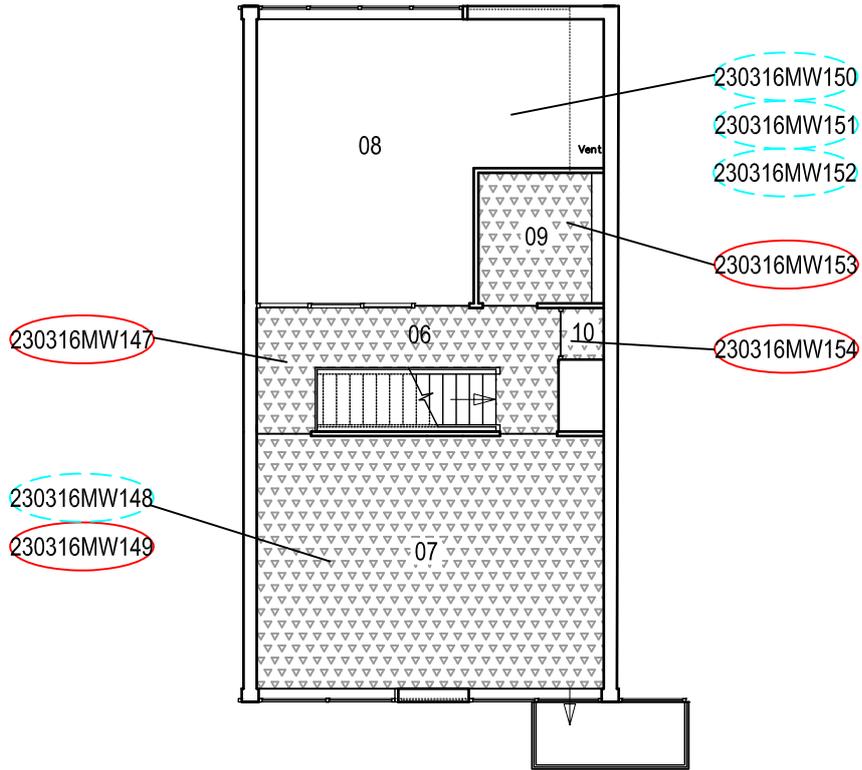

3rd Floor

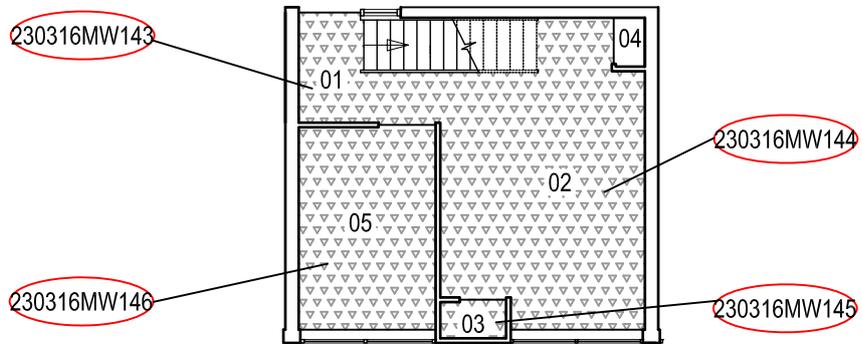

REFERENCE

XXXXXXYY01

Positive Inspection



Floor Tiles

XXXXXXYY01

Negative Inspection



No Access



Address:
Flat 3 Neville House
Corby


Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby

Drawing Title:
Corby Borough Council
Asbestos Survey Plan


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

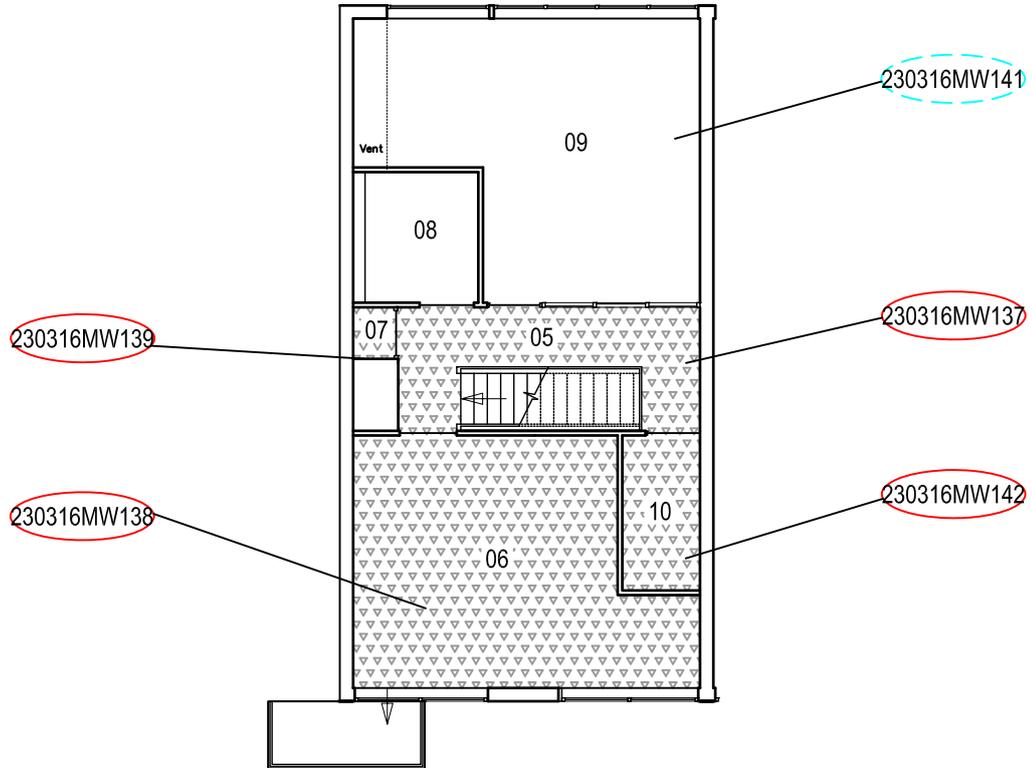

3rd Floor

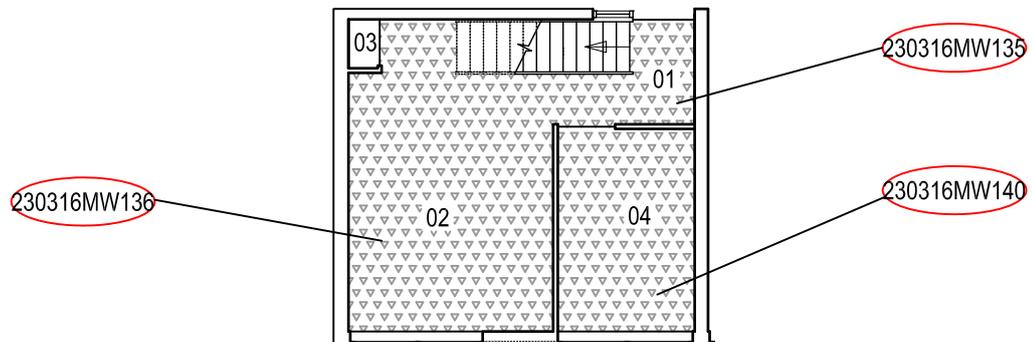

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



No Access



Address:
Flat 4 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

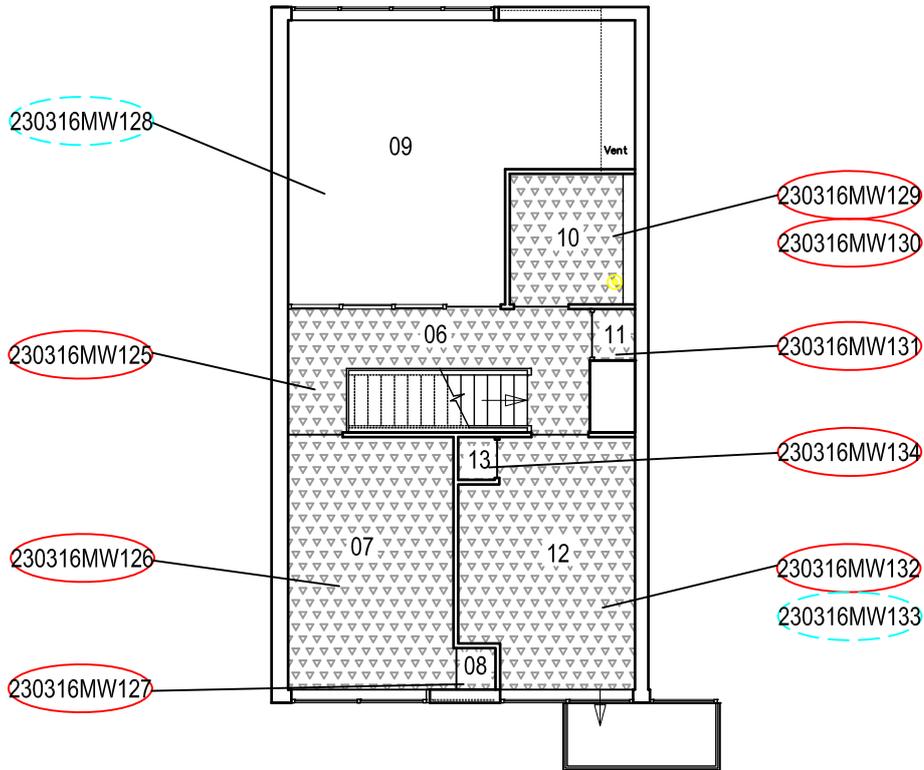

3rd Floor

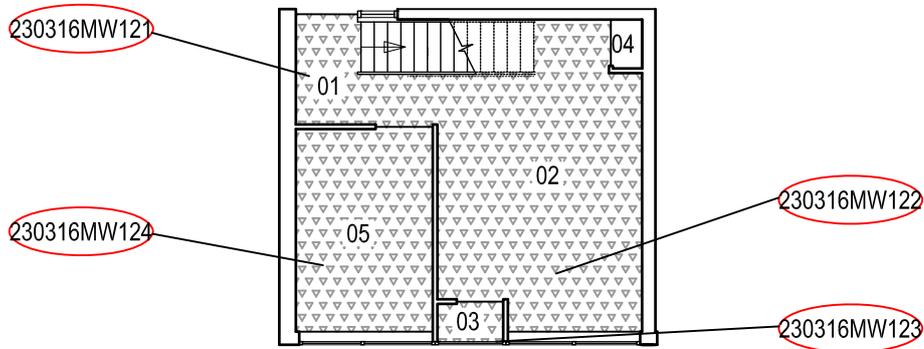

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



Toilet cistern



No Access



Address:
Flat 5 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

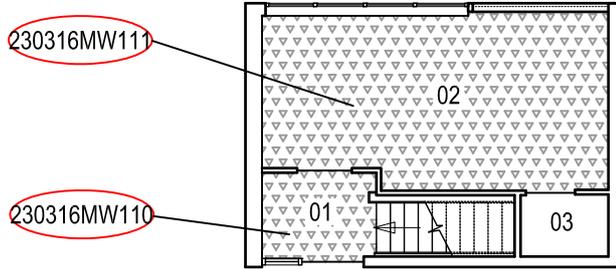

2nd Floor

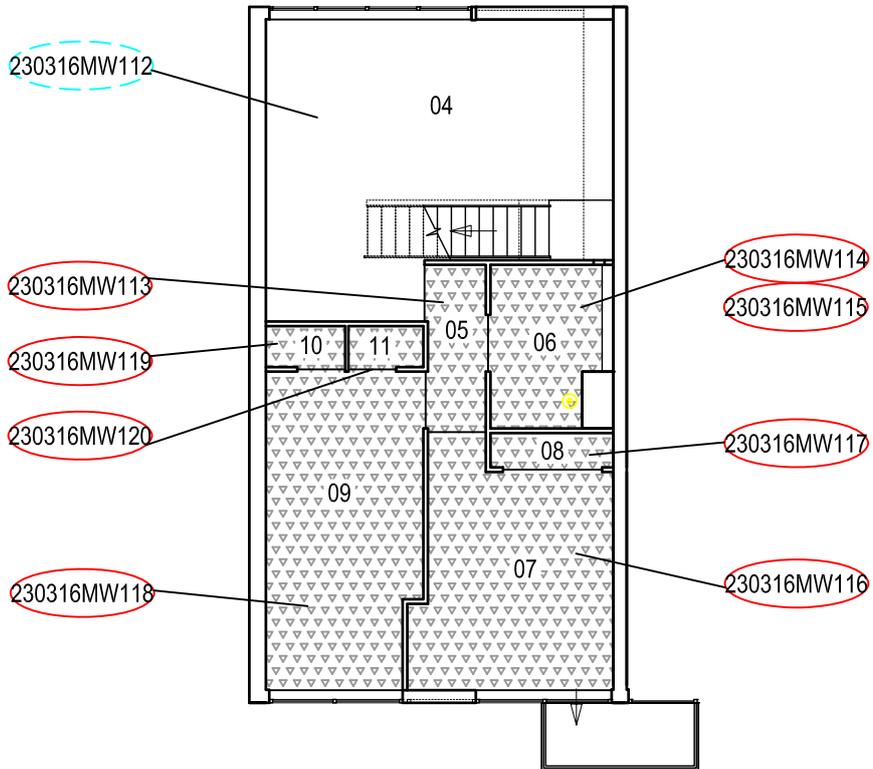

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



Toilet cistern



No Access



Address:
Flat 6 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

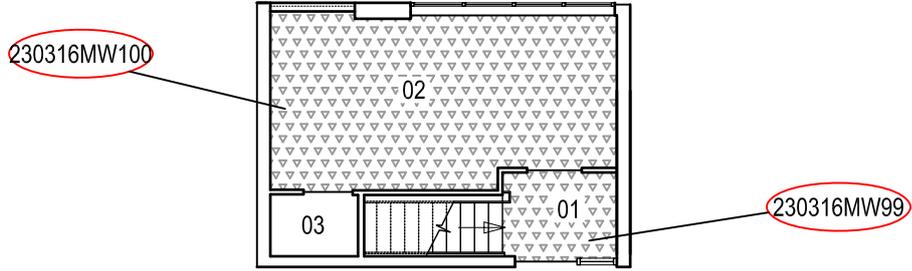

2nd Floor

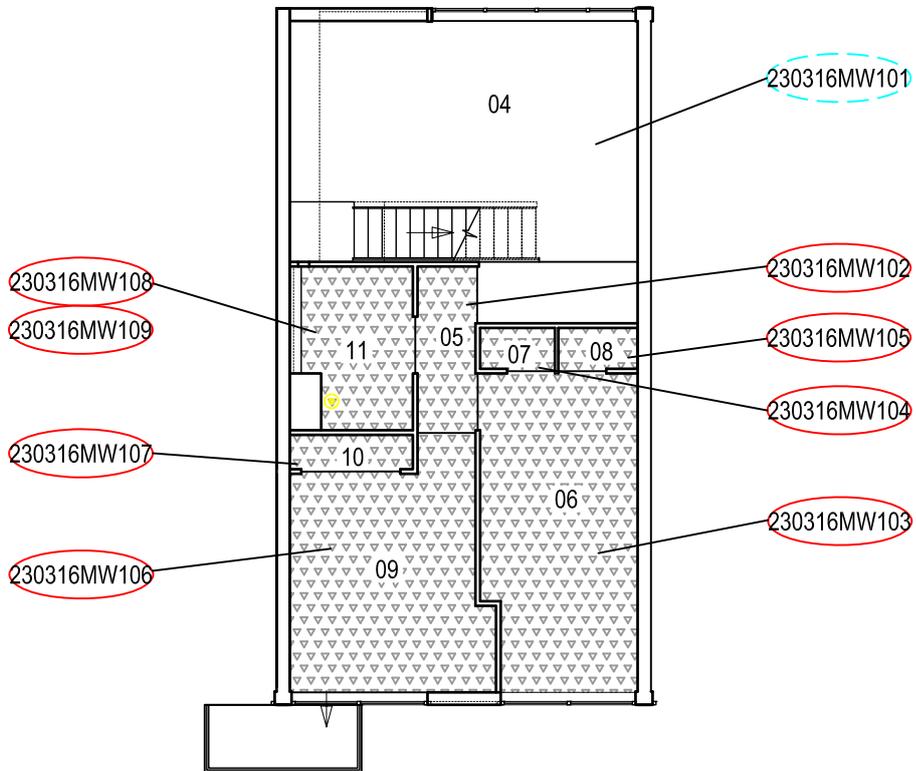

REFERENCE

XXXXXXYY01

Positive Inspection



Floor Tiles

XXXXXXYY01

Negative Inspection



Toilet cistern



No Access



Address:
Flat 7 Neville House
Corby


Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby

Drawing Title:
Corby Borough Council
Asbestos Survey Plan


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

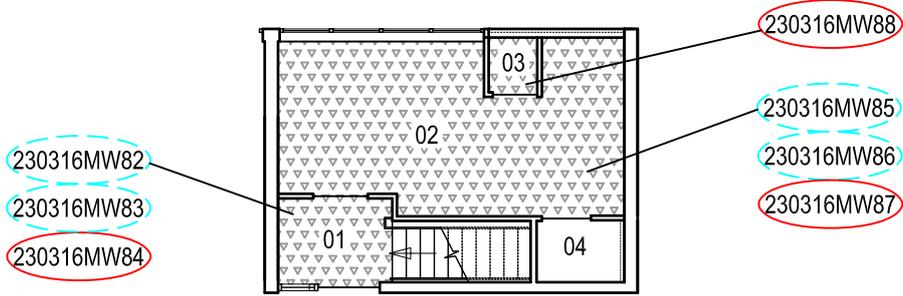

2nd Floor

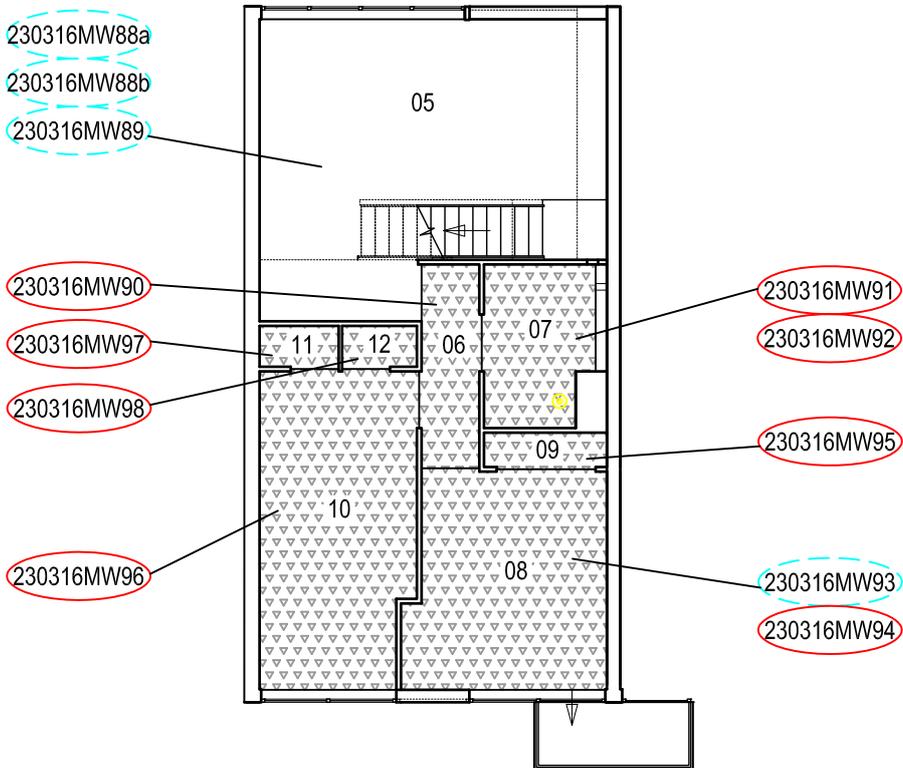

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



Toilet cistern



No Access



Address:
Flat 8 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

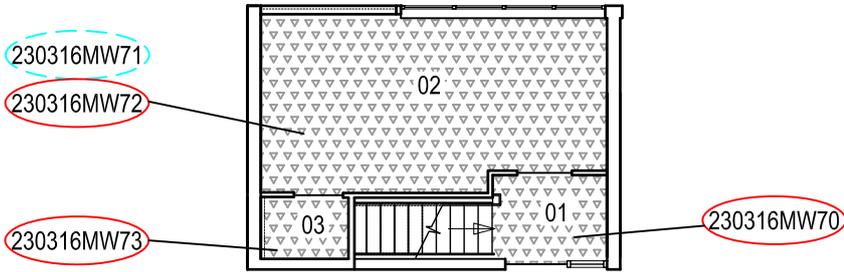

2nd Floor

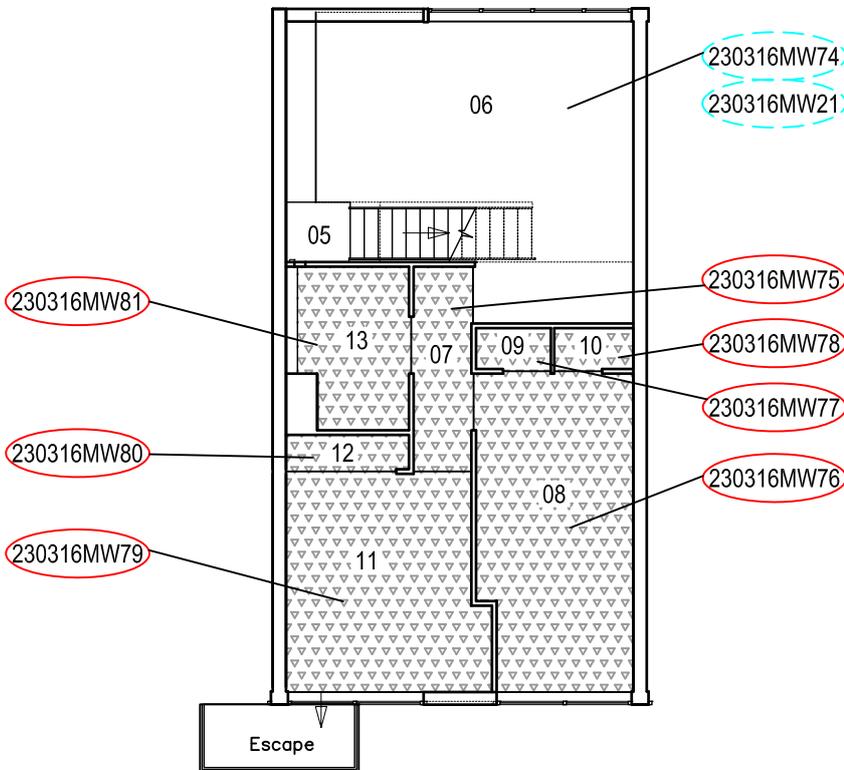

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



No Access



Address:
Flat 9 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

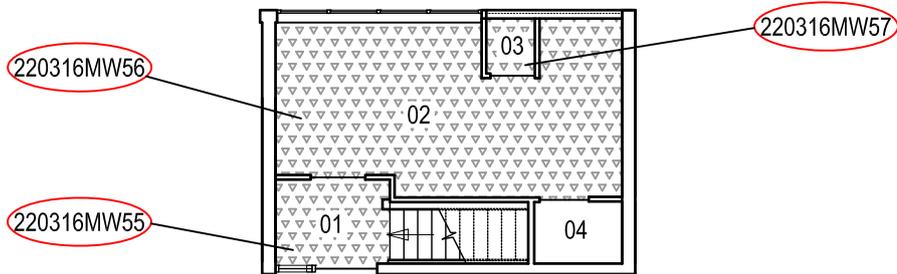

2nd Floor

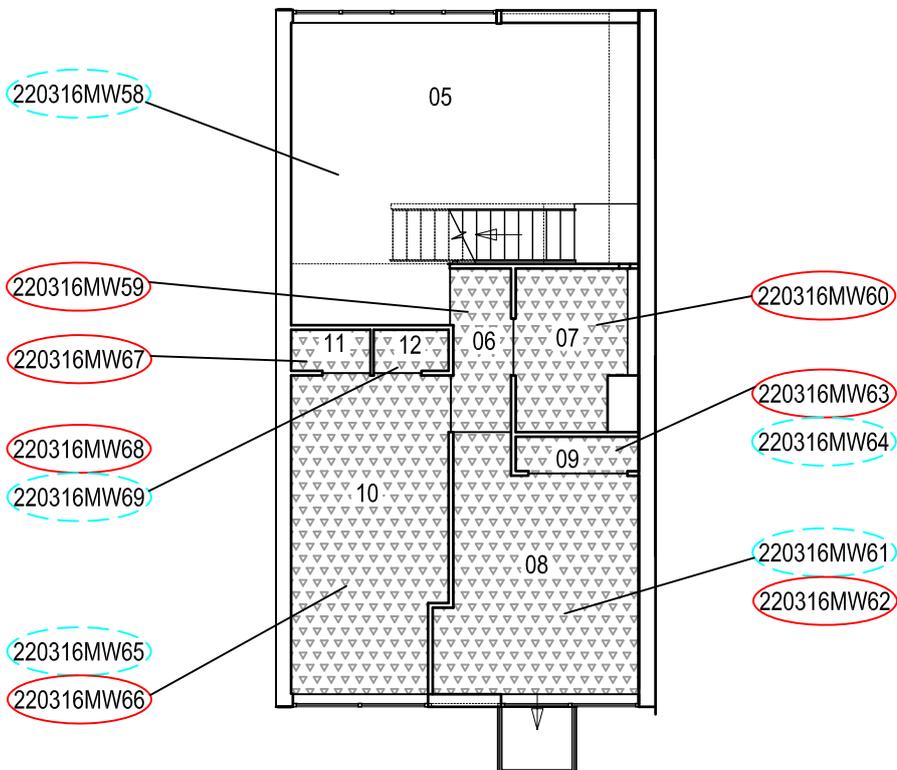

REFERENCE



Positive Inspection



Floor Tiles



Negative Inspection



No Access



Address:
Flat 10 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstreet industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

3rd Floor

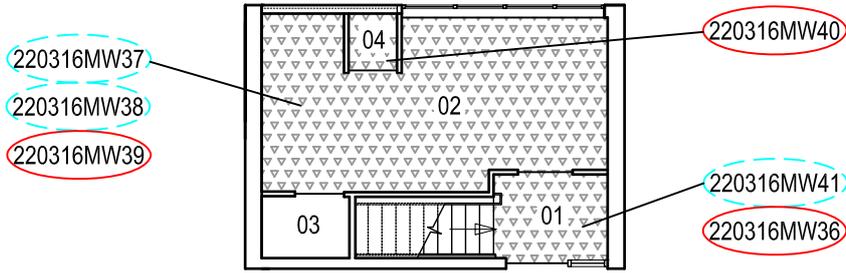

2nd Floor

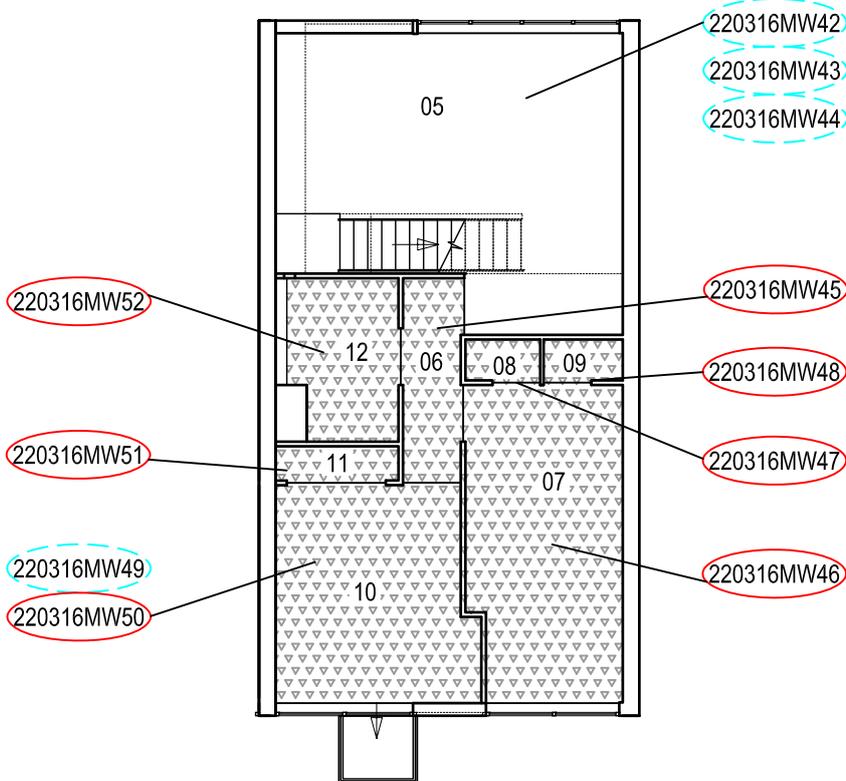


REFERENCE



Positive Inspection



Floor Tiles

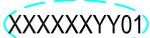

Negative Inspection



No Access



Address:
Flat 11 Neville House
Corby


Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstree industrial Estate, Corby


Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

NOTE: SKETCH TO BE READ IN CONJUNCTION WITH THE REPORT

4th Floor

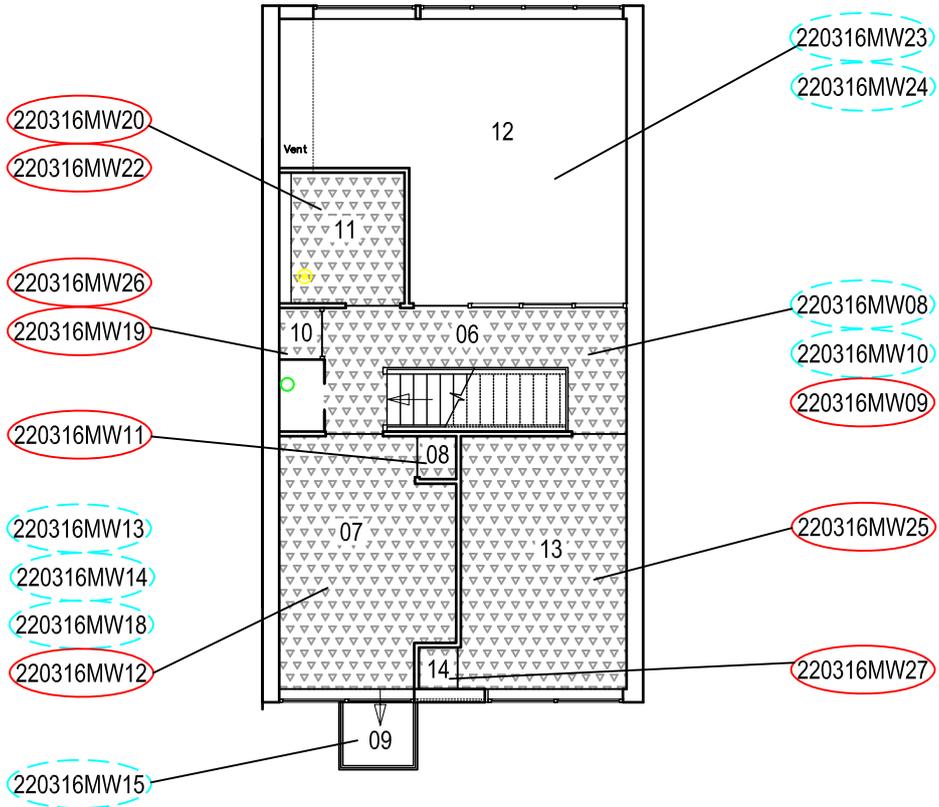

3rd Floor

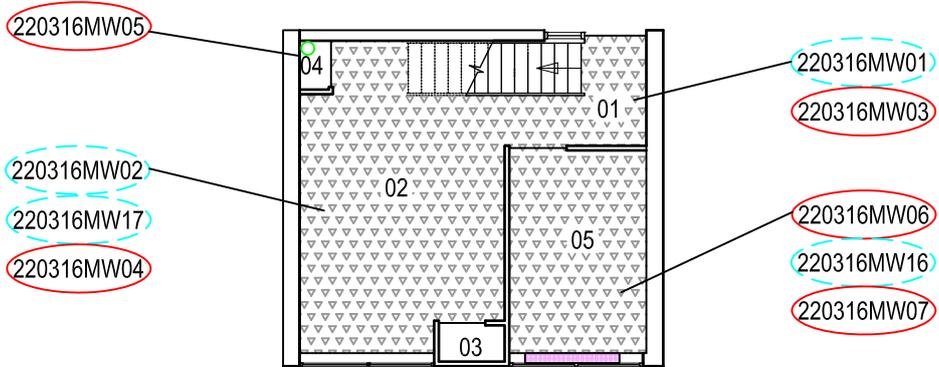

REFERENCE



Positive Inspection



Cement down pipe



Bitumen packer



Negative Inspection



Floor tiles



No Access



Toilet cistern



Address:
Flat 12 Neville House
Corby

Drawing Title:
Corby Borough Council
Asbestos Survey Plan

Client Address:
Depot Fleming Road
Earlstreet industrial Estate, Corby

Scale at A4 Not to Scale	Drawn By JNG	Checked By MW	Revision 1
-----------------------------	-----------------	------------------	---------------

Appendix D

Analysis Certificates

CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref. Description	Identification	Comments
BN/20013 Bill Norton	31/03/16 31/03/16	Neville House		Ground Floor	240316M Composite W202	Chrysotile	
BN/20014 Bill Norton	31/03/16 31/03/16	Neville House		2nd Floor	220316M Rope W28	Non-detected	
BN/20015 Bill Norton	31/03/16 31/03/16	Neville House		2nd Floor	220316M Rope W29	Chrysotile	
BN/20016 Bill Norton	31/03/16 31/03/16	Neville House		2nd Floor	220316M Ceramic fuse mount W30	Chrysotile	
BN/20017 Bill Norton	31/03/16 31/03/16	Neville House		3rd Floor	220316M Rope seal W53	Chrysotile	
BN/20018 Bill Norton	31/03/16 31/03/16	Neville House		3rd Floor	220316M Insulation board W54	Chrysotile	
BN/20019 Bill Norton	31/03/16 31/03/16	Neville House		3rd Floor	240316M Floor covering W199	Non-detected	

Certificate ID : 1

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20020 Bill Norton	31/03/16 31/03/16	Neville House		4th Floor	240316M W197	Rope/string	Non-detected	
BN/20021 Bill Norton	31/03/16 31/03/16	Neville House		4th Floor	230316M W204	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20022 Bill Norton	31/03/16 31/03/16	Neville House		5th Floor	220316M W31	Insulation board	Chrysotile	
BN/20023 Bill Norton	31/03/16 31/03/16	Neville House		5th Floor	220316M W34	Cement	Chrysotile	
BN/20024 Bill Norton	31/03/16 31/03/16	Neville House		5th Floor	220316M W35	Rope	Chrysotile	
BN/20025 Bill Norton	31/03/16 31/03/16	Neville House		5th Floor	240316M W192	Felt	Non-detected	
BN/20026 Bill Norton	31/03/16 31/03/16	Neville House		5th Floor	240316M W193	Cement	Chrysotile Crocidolite	
BN/20027 Bill Norton	31/03/16 31/03/16	Neville House		Flat 1	230316M W172	Textured coating	Non-detected	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20028 Bill Norton	31/03/16 31/03/16	Neville House		Flat 1	230316M W175	Cement	Chrysotile Crocidolite	
BN/20029 Bill Norton	31/03/16 31/03/16	Neville House		Flat 1	230316M W177	Textured coating	Non-detected	
BN/20030 Bill Norton	31/03/16 31/03/16	Neville House		Flat 1	230316M W180	Textured coating	Non-detected	
BN/20031 Bill Norton	31/03/16 31/03/16	Neville House		Flat 1	230316M W185	Insulation board	Non-detected	
BN/20047 Bill Norton	31/03/16 31/03/16	Neville House		Flat 3	230316M W148	Textured coating	Non-detected	
BN/20048 Bill Norton	31/03/16 31/03/16	Neville House		Flat 4	230316M W141	Bitumen	Non-detected	
BN/20049 Bill Norton	31/03/16 31/03/16	Neville House		Flat 5	230316M W128	Bitumen	Non-detected	
BN/20050 Bill Norton	31/03/16 31/03/16	Neville House		Flat 5	240316M W133	Insulation board	Non-detected	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20051 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W82	Textured coating	Non-detected	
BN/20052 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W83	Textured coating	Non-detected	
BN/20053 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W86	Bitumen	Non-detected	
BN/20054 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W88a	Textured coating	Non-detected	
BN/20055 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W88b	Textured coating	Non-detected	
BN/20056 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W89	Textured coating	Non-detected	
BN/20057 Bill Norton	31/03/16 31/03/16	Neville House		Flat 8	230316M W93	Insulation board	Non-detected	
BN/20075 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W21	Bitumen	Non-detected	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20076 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W70	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20077 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W71	Textured coating	Non-detected	
BN/20078 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W72	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20079 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W74	Floor tile	Non-detected	
BN/20080 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W79	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20081 Bill Norton	01/04/16 01/04/16	Neville House		Flat 9	230316M W81	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20082 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W55	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20083 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W56	Floor tile	Chrysotile	Chrysotile located in adhesive

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20084 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W59	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20085 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W60	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20086 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W61	Textured coating	Non-detected	
BN/20087 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W62	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20088 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W64	Paper backed linoleum	Non-detected	
BN/20089 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W65	Textured coating	Non-detected	
BN/20090 Bill Norton	01/04/16 01/04/16	Neville House		Flat 10	220316M W66	Floor tile	Chrysotile	Chrysotile in tile & adhesive
BN/20091 Bill Norton	01/04/16 01/04/16	Neville House		Flat 11	220316M W38	Bitumen	Non-detected	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20092 Bill Norton	01/04/16 01/04/16	Neville House		Flat 11	220316M W41	Textured coating	Non-detected	
BN/20093 Bill Norton	01/04/16 01/04/16	Neville House		Flat 11	220316M W42	Textured coating	Non-detected	
BN/20094 Bill Norton	01/04/16 01/04/16	Neville House		Flat 11	220316M W49	Insulation board	Non-detected	
BN/20100 Bill Norton	01/04/16 01/04/16	Neville House		Flat 12	220316M W02	Textured coating	Non-detected	
BN/20101 Bill Norton	01/04/16 01/04/16	Neville House		Flat 12	220316M W03	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20102 Bill Norton	01/04/16 01/04/16	Neville House		Flat 12	220316M W05	Cement	Chrysotile	
BN/20103 Bill Norton	01/04/16 01/04/16	Neville House		Flat 12	220316M W06	Bitumen packer	Chrysotile	
BN/20104 Bill Norton	01/04/16 01/04/16	Neville House		Flat 12	220316M W07	Floor tile	Chrysotile	Chrysotile located in tile & adhesive

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory. : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref.	Description	Identification	Comments
BN/20105 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W08	Textured coating	Non-detected	
BN/20106 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W09	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20107 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W012	Floor tile	Chrysotile	Chrysotile located in tile & adhesive
BN/20108 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W013	Textured coating	Non-detected	
BN/20109 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W014	Window putty- bitumen	Non-detected	
BN/20110 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W015	Bitumen	Non-detected	
BN/20111 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W016	Insulation board	Non-detected	
BN/20112 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M W020	Composite	Amosite	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :



CERTIFICATE OF BULK SAMPLE ANALYSIS

BDA 069 Last Revised: 12/11/2012 Revision No.: 6

ClientCorby Borough Council
Fleming Road Depot
10 Fleming Road, Earlstrees Ind
Estate
Corby
Northamptonshire
NN17 4SWContact Name

Mr Mike Warburton

Sample AddressNeville House
Flats 1-12 & Communal Areas

Job No : CBC/BS/BN/02283

Number of Samples : 66

Collected By : Mike Warburton

Date Bulks Received : 30/03/2016

Bulk Laboratory : BDA Office Laboratory

Sample No Bulk Analyst	Date Analysed / Issued	Location Sample Address	Building	Room	Client Ref. Description	Identification	Comments
BN/20113 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M Floor tile W022	Chrysotile	Chrysotile located in tile & adhesive
BN/20114 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M Bitumen W024	Non-detected	
BN/20115 Bill Norton	04/04/16 04/04/16	Neville House		Flat 12	220316M Floor tile W025	Chrysotile	

BDA Surveying Ltd bear no responsibility for samples taken by a third party, or interpretation of results due to having no involvement in sampling locations, methods of sampling or sample size. All analysis carried out as described in BDA Surveying in-house methods, which is in accordance with HSG248. Certificate shall not be reproduced except in full without the written approval of the laboratory.

Analyst : Bill Norton

Signed :

