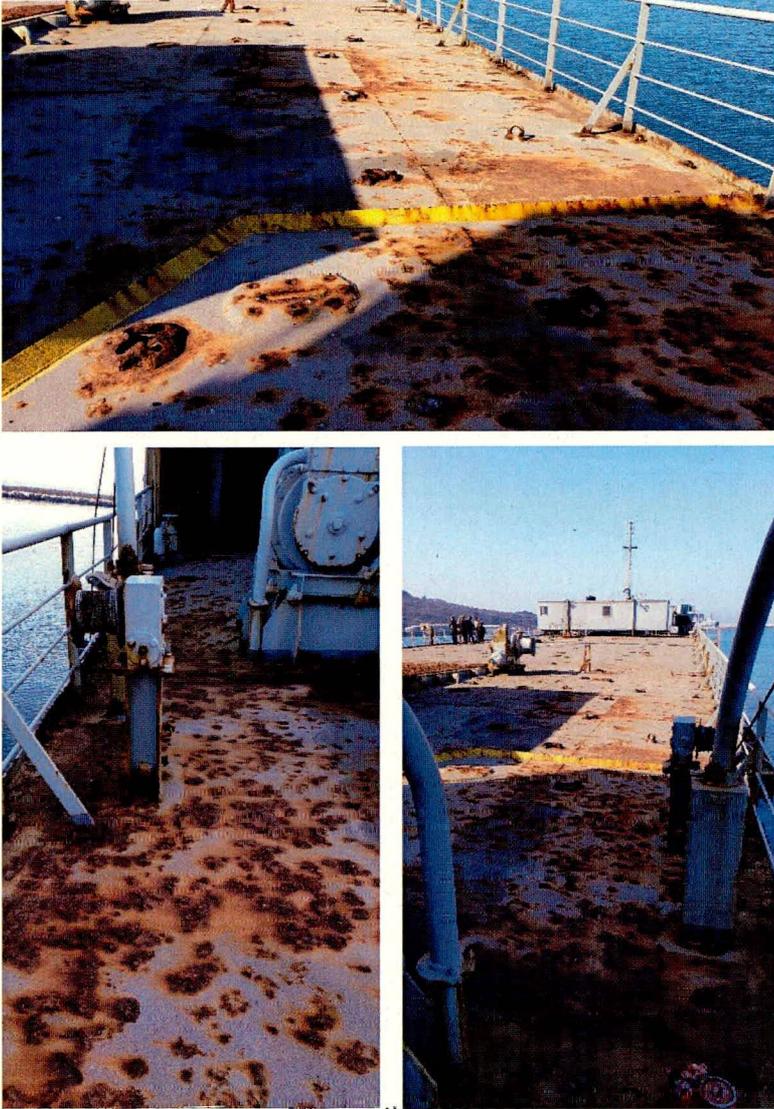
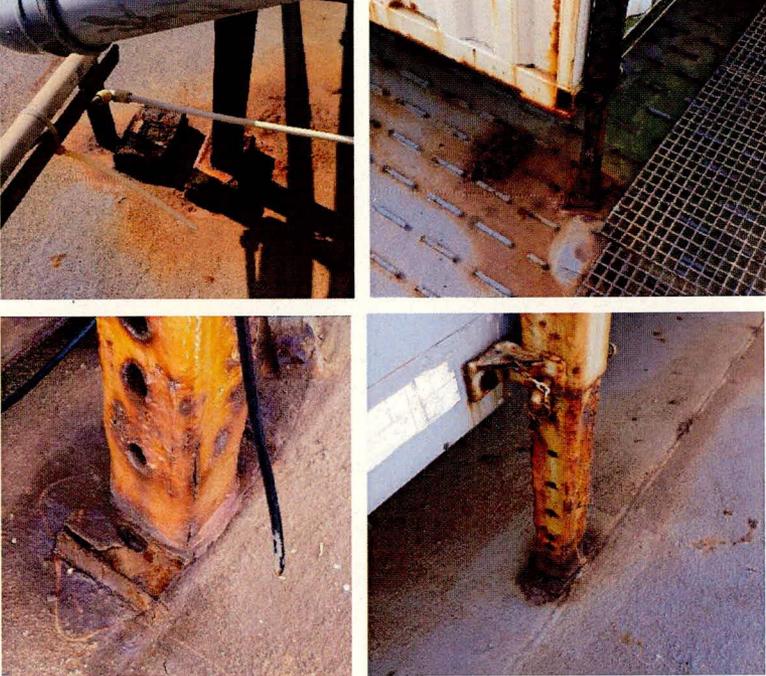


TASK NO.	TASK/DESCRIPTION	NOTES
H2	HULL AND STRUCTURE – EXTERNAL DECKS AND ASSOCIATED FITTINGS	
H2.16	<p><b>Vehicle Deck</b></p>  <p>The vehicle deck has breakdown of paint coatings throughout with active corrosion evident, particularly at the aft end either side of the vehicle ramp. The total area both sides of the vehicle ramp to have <b>REPRESERVATION</b> carried out, and the remainder of the vehicle deck patch repair <b>REPRESERVATION</b>.</p> <p>ALLOW for 250m<sup>2</sup> <b>REPRESERVATION</b>.</p>	<p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>To be completed in conjunction with H2.01, H2.02, H2.09, H2.10, H2.18, H3.01 and 3.02.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H2.17	<p data-bbox="451 327 1161 383"><b>H2 HULL AND STRUCTURE – EXTERNAL DECKS AND ASSOCIATED FITTINGS</b></p> <p data-bbox="400 416 938 450"><b>Office and Toilet Block Securing Points</b></p> <div data-bbox="400 461 1166 1137">  </div> <p data-bbox="400 1155 1246 1294">Current Office and toilet block support legs are not securely fixed to deck (welds suffering active corrosion). Following removal of existing facilities, hold-down points to be welded to deck to facilitate securing of new office and toilet block facilities. Total deck area beneath existing fit to be assessed and REPRESENTED accordingly.</p> <p data-bbox="400 1312 1070 1368">ALLOW for 8 in number securing points. ALLOW for 80m<sup>2</sup> REPRESENTATION.</p>	<p data-bbox="1249 416 1450 584">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1249 618 1450 730">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1249 763 1450 875">To be completed in conjunction with H2.17 and H9.02.</p>