



ASBESTOS SURVEYING, PROJECT MANAGEMENT,  
HEALTH & SAFETY AND TRAINING

## ASBESTOS MANAGEMENT SURVEY REPORT



**Site:** Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset, BA16 0HA

**Job Number:** J091121

**Survey Date:** 25th September 2018

**Client:** Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset, BA16 0HA

**Report Prepared By:** Amy Gulley

---

CHALLENGE COMMERCIAL INVESTIGATIONS LIMITED T/A ENSAFE CONSULTANTS  
THE FORGE, BLISWORTH HILL FARM, STOKE ROAD, BLISWORTH, NORTHAMPTON, NN7 3DB  
♦ TEL: 01604 878190 ♦ FAX: 01604 878199 ♦ EMAIL: [admin@ensafe.co.uk](mailto:admin@ensafe.co.uk)  
DIRECTORS: G Kirkman R Assenheim J Clements A Ali M Wright S Savage  
REGISTERED IN ENGLAND NO: 03426833, VAT NO:669400520

# CONTENTS

EXECUTIVE SUMMARY	Section 1.0
INTRODUCTION	Section 2.0
SURVEY LIMITATIONS	Section 3.0
ACCREDITATIONS	Section 4.0
SURVEYING AND SAMPLING METHOD	Section 5.0
BULK ANALYSIS METHOD	Section 6.0
MATERIAL RISK ASSESSMENT	Section 7.0
PRIORITY RISK ASSESSMENT	Section 8.0
GENERAL GUIDANCE	Section 9.0
Appendix A SAMPLE RESULTS & RECOMMENDATIONS	
Appendix B ASBESTOS REGISTER	
Appendix C CERTIFICATE OF ANALYSIS ASBESTOS FIBRE IDENTIFICATION IN BULK MATERIAL	
Appendix D SURVEY SITE PLANS	

## 1.0 EXECUTIVE SUMMARY

Type of survey	Management Survey (with MA and PA)
Survey Scope	To conduct a Management Survey to the entire property.
Risk Category	LOW RISK
Report Authorised	This report has been reviewed & authorised by Daniel Gooding

## ASBESTOS CONTAINING MATERIAL SUMMARY

Sample Number	Building	Floor	Room	Material	Location Description	Recommendation	MA Score	PA Score	Overall Risk
PQ002349	01 Main Building	Ground Floor	Reception Area (002)	Bitumen / felt	Bitumen residue to underside of vinyl sheeting to floor	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary	3	6	Low Risk
Visual 017	01 Main Building	External	External (001)	Cement	Cement undercloak to high level roof	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary	6	2	Low Risk

Please note that priority risk assessment scoring is not included in Ensafe Consultants UKAS scope of accreditation

## NO ACCESS AREAS SPECIFIC TO THIS SITE

The following section details specific areas that were inaccessible during the time of the survey, either as agreed prior to commencement or during the survey. All of the following areas should be presumed to contain asbestos. If during future refurbishment or demolition projects these areas are likely to be disturbed or exposed then a 'Refurbishment' or 'Pre Demolition' survey should be undertaken to highlight possible asbestos containing materials.

Building	Floor	Room	Access Restriction
At the time of the survey there were no specific non-accessed areas.			

## AREAS VISUALLY INSPECTED AND NO SAMPLES TAKEN

The following areas have been 'visually' inspected and no suspect materials were identified within the scope of the survey, therefore no samples have been taken to these areas.

Building	Floor	Room
01 Main Building	Ground Floor	Female WC (003)
01 Main Building	Ground Floor	Disabled WC (004)
01 Main Building	Ground Floor	Male WC (005)
01 Main Building	Ground Floor	Lobby (007)
01 Main Building	Ground Floor	Store (008)
01 Main Building	Ground Floor	WC (010)
01 Main Building	Ground Floor	Office (012)
01 Main Building	Ground Floor	Lobby (013)
01 Main Building	Ground Floor	Clerks Office (014)
01 Main Building	Ground Floor	Stairwell (016)
01 Main Building	Ground Floor	Council Chamber (017)
01 Main Building	1st Floor	Female/Disabled WC (003)
01 Main Building	1st Floor	Store (006)
01 Main Building	1st Floor	Office (007)
01 Main Building	1st Floor	Store (008)
01 Main Building	1st Floor	Hall (009)
01 Main Building	1st Floor	Office (010)
01 Main Building	1st Floor	Office (011)
01 Main Building	Roof Void	Roof Void (002)
01 Main Building	Roof Void	Roof Void (003)
01 Main Building	Roof Void	Roof Void (004)
01 Main Building	Roof Void	Roof Void (005)

## **2.0 INTRODUCTION**

The purpose of the survey was to locate and identify the presence of any asbestos containing materials and ascertain any associated risk during normal occupation and routine maintenance works. The survey was commissioned by Street Parish Council, and was conducted by the lead surveyor Daniel Gooding and assisted by Daniel Jacobs of Ensafe Consultants on the 25th September 2018

The site comprised of council offices made of masonry, approx age of the building 1900s.

## **3.0 SURVEY LIMITATIONS**

Due to the generally non-destructive nature of an Asbestos Management Survey there may be areas and locations that are inaccessible and hidden within the structure of the building. These void areas may only be discovered during the demolition of the building. Generally, areas that may not be inspected during the process of a management survey are within void areas without access points, inside live electrical / gas installation that would require specific isolation, within underground services, operational lift shafts and plant, linings to strong boxes and safes and beneath concrete shuttering to flooring slabs.

Areas specifically noted during the management survey as not being accessed are recorded within the executive summary.

## **4.0 ACCREDITATIONS**

Ensafe Consultants hold accreditation for inspection body activities (surveying) as a Type C organisation in accordance with ISO17020 (Inspection Body No. 220).

Ensafe Consultants also have accreditation of measurement and sampling in accordance with ISO 17025 granted by the United Kingdom Accreditation Service (UKAS) for all asbestos air and bulk sampling and analysis, and stages 1 to 4 of the clearance procedures (Laboratory No. 1703).

## **5.0 SURVEYING AND SAMPLING METHOD**

A strategy was established to keep the survey in line with the Health and Safety Executive's guidance HSG 264; 'Asbestos: Surveyor Guide', and Ensafe Consultants in-house procedures. This strategy involved both visual inspection and sample taking surveying techniques. The strategy was formulated from pre planning information from The client and the prevailing site conditions at the time of the survey. These conditions included but were not limited to the building construction, occupancy and overall condition.

Where during the survey inspection materials were suspected of containing asbestos, samples were taken. However, where a large area of visually homogenous material was observed, only a few samples were collected and these were considered to be representative of the whole surface. Similarly, where a number of identical items occurred, such as panels, then fewer samples were taken as being representative of all such items. In certain cases a sample may not have been taken due to various factors such as height restrictions or hazardous implications. Where applicable, these were detailed separately in the survey results section as 'presumed samples'.

The sampling method was undertaken in accordance with Ensafe Consultants UKAS accredited in-house methods and Health and Safety Executive Guidance note HSG248 'Asbestos: The Analysts' guide for sampling, analysis and clearance procedures.' These methods were designed to prevent the release of fibre during sampling operations and to ensure that adequate samples were collected. Samples were sealed and double bagged on site. Each bag was labelled with the date, the project reference number and a unique sample number.

## **6.0 BULK ANALYSIS METHOD**

Analysis was carried out utilising Ensafe Consultants in-house methods, which are in accordance with HSG248 'Asbestos: The Analysts' guide for sampling, analysis and clearance procedures.'

Each sample was viewed under a stereo microscope and each different fibre type established. Fibres were then mounted into Refractive Index Liquids and examined using polarised light and dispersion staining.

## **7.0 MATERIAL RISK ASSESSMENT**

Where asbestos had been identified an assessment has been made for the potential for fibre release from the material. The four main parameters upon which these assessment scores are calculated are material type, extent of damage or deterioration, surface treatment and asbestos type, by assigning subsection scores of 0 to 3.

Materials with assessment scores of 10 or more are regarded as having high potential to release fibres if disturbed. Scores of between 7 and 9 are regarded as having a medium potential, and between 5 and 6 a low potential. Scores of 4 or less have a very low potential to release fibres. Non asbestos containing materials are not scored.

The material assessment identifies the high-risk materials that will most readily release airborne fibres if disturbed. It does not automatically mean that those materials assigned the highest score in the material assessment will be the materials that should be given priority for a remedial action.

## **8.0 PRIORITY RISK ASSESSMENT**

The material assessment identifies materials that most readily release airborne fibre, whereas the priority risk assessment, which also uses a scoring system of 0 to 3 under each subsection, identifies the likelihood of the materials disturbance by taking into account factors such as:

- The location of the material.
- Its extent.
- The use to which the location is put.
- The occupancy of the area.
- The activities carried out in the area.
- The likelihood/frequency of possible maintenance activities.

The material risk and priority risk scores are then added together to give an overall risk assessment value from which the management action plans can be developed.

Overall risk scores of 7 or less are considered to be of a very low risk due to a combination of material assessment and the potential risk of exposure. Score between 8 – 12 are considered Low Risk, 13 – 18 Medium Risk with scores of 18 or above considered to be High Risk.

The risk assessment can only be carried out with a detailed knowledge of all of the above. Although a surveyor may have some of the information which will contribute to the risk assessment, the duty holder under the Control of Asbestos Regulations (CAR) is required to make the risk assessment using the information given in the survey and their detailed knowledge of the activities carried out within the premises. This will allow the Priority Risk Assessment to be formulated and established. The risk assessment will then form the basis of the management plan. For further information refer to relevant HSE Guidance, HSG 227 and the Control of Asbestos Regulations 2012. If the client is unsure of whom the duty holder is then specialist advice should be sought from Ensafe Consultants. Ensafe Consultants can carryout PRA's, however this procedure is currently outside the scope of UKAS accreditation.

## **9.0 GENERAL GUIDANCE**

Detailed within the executive summary and Appendix A were the materials sampled during the survey, including the identified or presumed asbestos containing materials. Each area identified gives the location, type of material, sample reference where applicable, condition and a specific recommendation. Additional information regarding the client's duties in undertaking the recommendations is located within this section.

Recommendations are based on all of the information supplied by the client at the time of the survey. As such the minimum requirements to place the asbestos materials in a safe and manageable condition given the current circumstances have been recommended. Should the client have further information on completion of the survey such as proposed refurbishment works or any other projects which are likely to disturb asbestos containing materials then specialist advice should be sought.

Where recommendations have included for certain asbestos containing materials to be considered for encapsulation and or labelling and then to be managed, these recommendations are to ensure the asbestos containing material is easily identifiable and to protect the surface of the material with an elastomeric sealant, which not only affords some impact damage protection and prevents fibre release but also may increase the life span of the material.

All encapsulation or labelling of asbestos containing materials should be carried out under suitably controlled conditions in full accordance with the Control of Asbestos Regulations 2012.

To aid in the management of identified asbestos containing materials they have been highlighted within the asbestos register for the premises, reference Appendix B. This register should be utilised to implement a continuous asbestos management programme whereby the detailed asbestos containing products at this site are periodically inspected for change in condition and where required the appropriate remedial action undertaken.

Where samples of floor coverings were collected, samples of the bitumen adhesive were also sampled. Where analysis of these samples has shown there to be an asbestos containing adhesive beneath the vinyl tiles, it can be presumed that beneath all floor coverings there is a consistent asbestos adhesive containing Chrysotile (White) asbestos.

Where samples of textured coatings and vinyl floor coverings have been collected, such products may contain a trace quantity of Chrysotile asbestos. Due to this low asbestos content, applications of this product may be non-homogenous and may elicit both positive and negative samples. Where both positive and negative samples are obtained on visually similar products it should be presumed that the products contain Chrysotile throughout even though a "No Asbestos Detected" result has been obtained.

All asbestos containing composite products (which includes asbestos cement, vinyl tiles, bitumen adhesives etc.) detailed within Appendix B which may require remedial or removal works are currently outside the licensing element of the Control of Asbestos Regulations 2012. Although work on these products does not normally require a contractor to hold a current asbestos removal licence all work must still be carried out in full accordance with these regulations. As part of the requirements under the said regulations there is a requirement for full method statements and risk assessments to be compiled, prior to the works commencing and in certain cases where the asbestos containing material is damaged and friable for the work to be notified to the local enforcing authority. It would be our recommendation that such works are carried out by a licensed asbestos removal contractor so as to ensure the competency of those involved in the asbestos removal or remedial works.

All asbestos containing materials used for fire protection and insulating materials (which includes spray coatings, insulation, insulating board, cloth electrical suppressors and boards) detailed within Appendix B, which may require removal or remedial works are covered by the licensing section of the Control of Asbestos Regulations (2012). As such, all works will generally require a formal fourteen day notification to the local enforcing authority prior to undertaking any asbestos abatement projects. In addition to this all removal and remedial works carried out on these materials must only be undertaken by a fully licensed asbestos removal contractor in full accordance with all current and relevant health and safety legislation, approved codes of practice and guidance notes.

The client should be aware that where asbestos containing materials have been given re-inspection intervals they have been recorded within this report an average interval as recommended for asbestos containing materials in a safe and manageable condition given a completed client priority risk assessment.

Where within this report asbestos remediation work has been recommended the inspection interval will only apply on completion of the said works.

The inspection interval may also be subject to change on completion of the priority risk assessments. This is due to high risk areas, which may require a shorter inspection interval and low risk areas which may require a longer inspection interval.

All asbestos waste arising from any remedial or removal works must be disposed of in full accordance with the Hazardous Waste Regulations (2005).

Any further asbestos surveys, removal or remedial project management and compilation of an asbestos management procedure should be carried out by an independent consultancy, accredited by The United Kingdom Accreditation Service (UKAS) for surveying, sampling and analysis and who also hold a Health and Safety Executive licence for the supervisory facet of their services.

In accordance with the Control of Asbestos Regulations 2012 the removal of ACM's fall into one of the three categories below:

#### Licensed Asbestos Removal

Is defined as any work, which is undertaken on a friable asbestos product or which is likely to exceed the control limit of 0.1f/cm<sup>3</sup>. A licensed asbestos removal contractor must undertake this work and a 14-day notice must be given to the HSE prior to the commencement of the work.

#### Notifiable Non Licensed Works

If work on an ACM causes the deterioration of the matrix material in which the asbestos fibres are firmly linked, then these works are Notifiable Non Licensed Work (NNLW). Work of this type does not require an asbestos removal licence, but the company undertaking the work must have the following:

- Notification of the work to the relevant enforcing authority prior to the work commencing.
- Medical examinations to assess each worker's state of health to be carried out, before any possible – exposure to asbestos. Then re-examinations every three years.
- Insurance for working with asbestos containing materials.
- A register of work to be kept by the employer for each employee exposed to asbestos.

#### Non Notifiable Non Licensed work

-Non-Licensed Works Is defined as any work, which involves short, non-continuous maintenance activities, during which only nonfriable materials are removed. It can also involve the removal of non-friable materials for refurbishment purposes. However, work of this type is only applicable where the matrix material in which the asbestos fibres are firmly linked remains intact.

-If a non-licensed contractor is appointed to undertake the removal works on the above materials, the following points must be adhered to:

- All operatives undertaking work on the material must have asbestos awareness training and practical asbestos training.

It is recommended that further intrusive investigations and sampling be carried out in accordance with HSG.264, where any major refurbishment, maintenance, installation or similar activity may expose asbestos materials that have remained inaccessible during the survey. This should be as a refurbishment/demolition survey as documented in HSG264.

**Reproduction of this report is not permitted without written consent from Ensaf Consultants**

**This report has been final approved by :** Sally Simpkin

**On:** 17 Oct 2018



**APPENDIX A**  
**SAMPLE RESULTS & RECOMMENDATIONS**

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	

<b>Building</b>	01 Main Building
-----------------	------------------

### Internal Notes

Ensafe Consultants attended the premises on 25/09/2018 to carry out a full Management Survey.

The property comprised of Offices, WCs, Kitchens, Lobbies, Corridors and Stairwells.

The general construction of the building consisted of a combination of modern vinyl sheeting and carpet over concrete and timber floorboards with areas of modern levelling screed and timber panelling. Also present were a combination of exposed and plaster finished masonry, plasterboard to masonry walls, plasterboard and timber partitions with areas of decorative paper lining and ceramic tiling. The ceilings were a combination of lathe plaster and plasterboard.

Throughout the premises there were timber and metal framed windows and doors, glass door headers, timber window sills, plastic and metal trunking housing electrical cables, metal radiators mounted to masonry, timber skirtings, and plasterboard and timber boxings.

All WCs had ceramic and plastic toilet facilities with associated, uninsulated plastic and metal pipework.

### GROUND FLOOR

001 Lobby had the addition of timber boxing which was inspected via an inspection panel to reveal timber panelling, timber studwork, uninsulated metal pipework, uninsulated metal down pipe and an insulating board panel.

006 Female WC had the addition of a masonry infill to wall.

005 Male WC had the addition of timber boxing adjacent to toilet cistern which was inspected inside to reveal timber studwork, a plastic waste pipe and uninsulated plastic and metal pipework.

006 Kitchen had the addition of timber constructed units which housed a metal sink with mastic pads, modern fire blanket and a Vaillant boiler mounted to masonry wall with associated, uninsulated metal pipework. Beneath the boiler unit was timber boxing which was inspected within to reveal uninsulated plastic and metal pipework, and modern levelling screed to the floor.

007 Lobby had the addition of a timber framed skylight.

008 Store had the addition of timber packers within masonry walls.

009 Store had the addition of a timber lintel above doorway, the underside of the masonry staircase was visible and bitumen residue to walls at low level.

011 Tea Room had the addition of timber constructed units which housed a metal sink with mastic pad.

014 Clerks office had the addition of a timber constructed cupboard which housed modern electrical and cabling mounted to timber panel and masonry wall, timber infill panel to timber and masonry constructed fireplace.

016 Stairwell had the addition of a masonry staircase with rubber stair nosings.

### FIRST FLOOR

002 Kitchen had the addition of timber constructed units which housed a metal sink with mastic pad, modern fire blanket and a Vaillant boiler mounted to masonry with associated, uninsulated metal pipework. Beneath the boiler unit there was timber boxing which was inspected within to reveal timber stud work and uninsulated metal and plastic pipework.

005 Landing had the addition of rubber nosings to stairs.

007 Office had the addition of a masonry constructed fireplace with masonry infill.

## ROOF VOIDS

001 Roof Void was accessed in 001 Lobby via a roof hatch and was inspected to reveal loose MMMF insulation, tops of plasterboard ceilings, tops of masonry walls, felt lined timber framed pitched roof with a plastic lining above and uninsulated plastic and metal downpipe.

002 Roof Void was accessed in 013 Lobby via a roof hatch and was inspected to reveal loose MMMF insulation, tops of plasterboard ceilings, tops of masonry walls and a modern nylon lined timber framed pitched roof.

003 Roof Void was accessed in 001 Office via a roof hatch and was inspected to reveal plastic lining to pitched roof, plastic and metal flexi ducting, loose MMMF insulation, tops of plaster and lathe and plaster ceilings, masonry gable ends and timber beams and joists.

004 Roof Void was accessed in 005 Store via a roof hatch and was inspected to reveal plastic lining to pitched roof, plastic and metal flexi ducting, loose MMMF insulation, tops of plaster and lathe and plaster ceilings, masonry gable ends and timber beams and joists.

005 Roof Void was accessed in 007 Office via a roof hatch and was inspected to reveal plastic lining to pitched roof, plastic and metal flexi ducting, loose MMMF insulation, tops of plaster and lathe and plaster ceilings, masonry gable ends and timber beams and joists.

## **External Notes**

The external construction of the building generally consisted of masonry walls with no visible damp proof course, natural clay tiled pitched roofs with a combination of cement and insulating board undercloaks, timber fascias, a combination of timber and insulating board soffits, metal and plastic rainwater goods, metal and timber windows and doors with areas of putty sealant.

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002345	<b>Description</b>	Insulating board panel
-------------------	----------	--------------------	------------------------

<b>Location ID</b>	001	<b>Position</b>	within timber boxing		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Lobby (001)
<b>Last Inspection Date</b>		25/09/2018	<b>Next Inspection Date</b>	N/A	

<b>Product Type</b>	Insulating board	<b>Extent</b>	<1m <sup>2</sup>
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material
<b>Damage Extent</b>	Medium Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>		
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>		

<b>Comments</b>	Medium damage due to broken and missing edges.
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002349	<b>Description</b>	Bitumen residue
-------------------	----------	--------------------	-----------------

<b>Location ID</b>	002	<b>Position</b>	to underside of vinyl sheeting to floor		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Reception Area (002)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	25/09/2019		

<b>Product Type</b>	Bitumen / felt	<b>Extent</b>	60m <sup>2</sup>		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>Chrysotile</b>				
<b>Material Risk No.</b>	3	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	Very Low Risk				

<b>Comments</b>	Found to be consistent throughout. Extent included.
<b>Recommendations</b>	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002347	<b>Description</b>	Mastic pad
-------------------	----------	--------------------	------------

<b>Location ID</b>	006	<b>Position</b>	to the underside of the metal sink		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Kitchen (006)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Mastic pad	<b>Extent</b>	2no.		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002348	<b>Description</b>	Bitumen residue
-------------------	----------	--------------------	-----------------

<b>Location ID</b>	009	<b>Position</b>	to walls at low level		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Store (009)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Bitumen / felt	<b>Extent</b>	4m <sup>2</sup>		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002350	<b>Description</b>	Mastic pad
-------------------	----------	--------------------	------------

<b>Location ID</b>	011	<b>Position</b>	to the underside of the metal sink		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Tea Room (011)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Mastic pad	<b>Extent</b>	1no.		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002351	<b>Description</b>	Bitumen residue
-------------------	----------	--------------------	-----------------

<b>Location ID</b>	015	<b>Position</b>	to the floor beneath carpet		
<b>Building</b>	01 Main Building	<b>Floor</b>	Ground Floor	<b>Room/Area</b>	Hall (015)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Bitumen / felt	<b>Extent</b>	6m <sup>2</sup>		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	Found to be consistent beneath carpet in 016 Stairwell
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002352	<b>Description</b>	Sash cord
-------------------	----------	--------------------	-----------

<b>Location ID</b>	001	<b>Position</b>	to small timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Office (001)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	String / cloth / ropes / yarns	<b>Extent</b>	2lm		
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Occasionally likely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002353	<b>Description</b>	Sash cord
-------------------	----------	--------------------	-----------

<b>Location ID</b>	001	<b>Position</b>	to left side of large timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Office (001)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	String / cloth / ropes / yarns	<b>Extent</b>	2lm
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material
<b>Damage Extent</b>	Medium Damage	<b>Accessibility</b>	Occasionally likely to be disturbed
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>		
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>		

<b>Comments</b>	Medium damage due to rope being frayed
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002354	<b>Description</b>	Sash cord
-------------------	----------	--------------------	-----------

<b>Location ID</b>	001	<b>Position</b>	to right side of large timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Office (001)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	String / cloth / ropes / yarns	<b>Extent</b>	2lm		
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Occasionally likely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002355	<b>Description</b>	Mastic pad
-------------------	----------	--------------------	------------

<b>Location ID</b>	002	<b>Position</b>	to the underside of the metal sink		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Kitchen (002)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Mastic pad	<b>Extent</b>	1no.		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	Ref PQ002352	<b>Description</b>	Sash cord
-------------------	--------------	--------------------	-----------

<b>Location ID</b>	004	<b>Position</b>	to timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Male WC (004)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	String / cloth / ropes / yarns	<b>Extent</b>	2lm		
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Occasionally likely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	Ref PQ002354	<b>Description</b>	Sash cord
-------------------	--------------	--------------------	-----------

<b>Location ID</b>	005	<b>Position</b>	to timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	1st Floor	<b>Room/Area</b>	Landing (005)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	String / cloth / ropes / yarns	<b>Extent</b>	2Im		
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Occasionally likely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002346	<b>Description</b>	Felt lining
-------------------	----------	--------------------	-------------

<b>Location ID</b>	001	<b>Position</b>	to the underside of the pitched roof		
<b>Building</b>	01 Main Building	<b>Floor</b>	Roof Void	<b>Room/Area</b>	Roof Void (001)
<b>Last Inspection Date</b>	25/09/2018	<b>Next Inspection Date</b>	N/A		

<b>Product Type</b>	Bitumen / felt	<b>Extent</b>	6m <sup>2</sup>		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	Visual 017	<b>Description</b>	Cement undercloak
-------------------	------------	--------------------	-------------------

<b>Location ID</b>	001	<b>Position</b>	to high level roof		
<b>Building</b>	01 Main Building	<b>Floor</b>	External	<b>Room/Area</b>	External (001)
<b>Last Inspection Date</b>		25/09/2018	<b>Next Inspection Date</b>		25/09/2019

<b>Product Type</b>	Cement	<b>Extent</b>	40lm		
<b>Surface Treatment</b>	Sealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>Crocidolite (or unknown)</b>				
<b>Material Risk No.</b>	6	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	Low Risk				

<b>Comments</b>	Presumed due to height restrictions.
<b>Recommendations</b>	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002356	<b>Description</b>	Insulating board soffit
-------------------	----------	--------------------	-------------------------

<b>Location ID</b>	001	<b>Position</b>	to entrance canopy		
<b>Building</b>	01 Main Building	<b>Floor</b>	External	<b>Room/Area</b>	External (001)
<b>Last Inspection Date</b>		25/09/2018	<b>Next Inspection Date</b>		N/A

<b>Product Type</b>	Insulating board	<b>Extent</b>	1m <sup>2</sup>		
<b>Surface Treatment</b>	Sealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002357	<b>Description</b>	Putty sealant
-------------------	----------	--------------------	---------------

<b>Location ID</b>	001	<b>Position</b>	to timber framed window		
<b>Building</b>	01 Main Building	<b>Floor</b>	External	<b>Room/Area</b>	External (001)
<b>Last Inspection Date</b>		25/09/2018	<b>Next Inspection Date</b>	N/A	

<b>Product Type</b>	Putty	<b>Extent</b>	10no.		
<b>Surface Treatment</b>	Composite (Self sealed)	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Low Damage	<b>Accessibility</b>	Occasionally likely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	Consistent to timber framed windows throughout.
<b>Recommendations</b>	No further action required

## SURVEY DATA SHEET

<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset	<b>Project Ref</b>	J091121
<b>Survey Type</b>	Management Survey (with MA and PA)	<b>UPRN</b>	



<b>Sample No.</b>	PQ002358	<b>Description</b>	Insulating board undercloak
-------------------	----------	--------------------	-----------------------------

<b>Location ID</b>	001	<b>Position</b>	to low level roof		
<b>Building</b>	01 Main Building	<b>Floor</b>	External	<b>Room/Area</b>	External (001)
<b>Last Inspection Date</b>		25/09/2018	<b>Next Inspection Date</b>		N/A


<b>Product Type</b>	Insulating board	<b>Extent</b>	81m		
<b>Surface Treatment</b>	Unsealed	<b>HSE Notifiable</b>	Non notifiable non licensed material		
<b>Damage Extent</b>	Medium Damage	<b>Accessibility</b>	Usually inaccessible or unlikely to be disturbed		
<b>Asbestos Type</b>	<b>No Asbestos Detected</b>				
<b>Material Risk No.</b>	0	<b>Certificate No.</b>	J091121		
<b>Material Risk</b>	<b>NO ASBESTOS DETECTED</b>				

<b>Comments</b>	Medium damage due to broken, raw edges and paint flaking away.
<b>Recommendations</b>	No further action required

**APPENDIX B**  
**ASBESTOS REGISTER**

### ASBESTOS REGISTER SHEET

Street Parish Council					
<b>UPRN</b>			<b>Building</b>	01 Main Building	
<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset		<b>Floor</b>	Ground Floor	
<b>Location</b>	002		<b>Room/Area</b>	Reception Area (002)	
<b>Sample No</b>	PQ002349	<b>Description</b>	Bitumen residue to underside of vinyl sheeting to floor	<b>Extent</b>	60m <sup>2</sup>

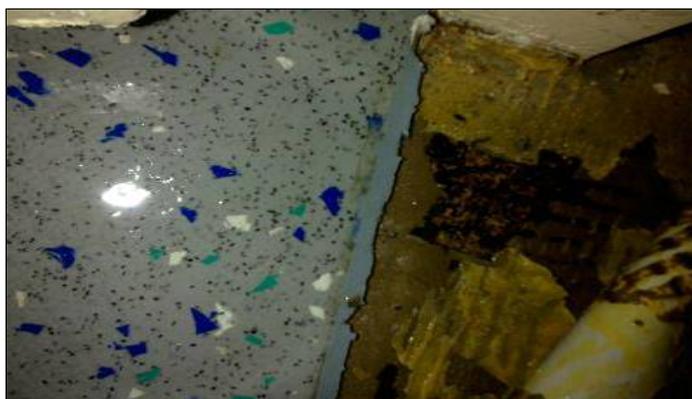

#### Material Risk (MA)

<b>Product Type</b>	Bitumen / felt	<b>Surface Treatment</b>	Composite (Self sealed)
<b>Asbestos Type</b>	Chrysotile	<b>Damage Extent</b>	Low Damage

#### Priority Assessment (PA)

<b>Occupancy Activity</b>	<b>Location</b>	<b>Accessibility</b>
Low disturbance	Rooms up to 100m <sup>2</sup>	Usually inaccessible or unlikely to be disturbed
<b>Extent of Material</b>	<b>No. of Occupants</b>	<b>Frequency of Use</b>
>50m <sup>2</sup> or >50m pipe run	4 to 10	Daily
<b>Average Time</b>	<b>Maintenance Activity</b>	<b>Frequency of Maintenance</b>
>6 hours	Minor disturbance	Unlikely

#### Scoring and Recommended Action

MA Score	PA Score	Overall Risk Score	Overall Risk Category	Recommended Action
3	6	9	Low Risk	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary
<b>Comment</b>				Found to be consistent throughout. Extent included.

**Please note that priority risk assessment scoring is not included in Ensaf Consultants UKAS scope of accreditation**

## ASBESTOS REGISTER SHEET

Street Parish Council					
<b>UPRN</b>			<b>Building</b>	01 Main Building	
<b>Site</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset		<b>Floor</b>	External	
<b>Location</b>	001		<b>Room/Area</b>	External (001)	
<b>Sample No</b>	Visual 017	<b>Description</b>	Cement undercloak to high level roof	<b>Extent</b>	40lm



### Material Risk (MA)

<b>Product Type</b>	Cement	<b>Surface Treatment</b>	Sealed
<b>Asbestos Type</b>	Crocidolite (or unknown)	<b>Damage Extent</b>	Low Damage

### Priority Assessment (PA)

<b>Occupancy Activity</b>	<b>Location</b>	<b>Accessibility</b>
Rare disturbance	External	Usually inaccessible or unlikely to be disturbed
<b>Extent of Material</b>	<b>No. of Occupants</b>	<b>Frequency of Use</b>
10m <sup>2</sup> - 50m <sup>2</sup> or 10m - 50m pipe run	None	Infrequent
<b>Average Time</b>	<b>Maintenance Activity</b>	<b>Frequency of Maintenance</b>
<1 hour	Low disturbance	<1 per year

### Scoring and Recommended Action

MA Score	PA Score	Overall Risk Score	Overall Risk Category	Recommended Action
6	2	8	Low Risk	The material was in a generally good condition and should therefore be managed, it may be prudent to consider labelling where necessary
<b>Comment</b>				Presumed due to height restrictions.

**Please note that priority risk assessment scoring is not included in Ensaf Consultants UKAS scope of accreditation**

**APPENDIX C**

**CERTIFICATE OF ANALYSIS**

**ASBESTOS FIBRE IDENTIFICATION IN BULK MATERIAL**



**CERTIFICATE OF ANALYSIS**  
**Certificate Number: J091121**

<b>Client:</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset, BA16 0HA
<b>Site:</b>	Street Parish Council, Street Parish Rooms, 6 Leigh Road, Street, Somerset, BA16 0HA

<b>Date Sampled:</b>	25/09/2018	<b>Date Analysed:</b>	02/10/2018
<b>Sampled By:</b>	Daniel Gooding	<b>Analysed By:</b>	Lorna Julian

<b>Certificate Number:</b> J091121					
<b>Sample Number</b>	<b>Floor</b>	<b>Room</b>	<b>Material</b>	<b>Description</b>	<b>Asbestos Fibre Type(s) Detected</b>
PQ002345	01 Main Building, Ground Floor	Lobby (001)	Insulating board	Insulating board panel within timber boxing	No Asbestos Detected
PQ002346	01 Main Building, Roof Void	Roof Void (001)	Bitumen / felt	Felt lining to the underside of the pitched roof	No Asbestos Detected
PQ002347	01 Main Building, Ground Floor	Kitchen (006)	Mastic pad	Mastic pad to the underside of the metal sink	No Asbestos Detected
PQ002348	01 Main Building, Ground Floor	Store (009)	Bitumen / felt	Bitumen residue to walls at low level	No Asbestos Detected
PQ002349	01 Main Building, Ground Floor	Reception Area (002)	Bitumen / felt	Bitumen residue to underside of vinyl sheeting to floor	Chrysotile
PQ002350	01 Main Building, Ground Floor	Tea Room (011)	Mastic pad	Mastic pad to the underside of the metal sink	No Asbestos Detected
PQ002351	01 Main Building, Ground Floor	Hall (015)	Bitumen / felt	Bitumen residue to the floor beneath carpet	No Asbestos Detected



1703



ASBESTOS SURVEYING, PROJECT MANAGEMENT, HEALTH & SAFETY AND TRAINING

<b>Certificate Number:</b> J091121					
<b>Sample Number</b>	<b>Floor</b>	<b>Room</b>	<b>Material</b>	<b>Description</b>	<b>Asbestos Fibre Type(s) Detected</b>
PQ002352	01 Main Building, 1st Floor	Office (001)	String / cloth / ropes / yarns	Sash cord to small timber framed window	No Asbestos Detected
PQ002353	01 Main Building, 1st Floor	Office (001)	String / cloth / ropes / yarns	Sash cord to left side of large timber framed window	No Asbestos Detected
PQ002354	01 Main Building, 1st Floor	Office (001)	String / cloth / ropes / yarns	Sash cord to right side of large timber framed window	No Asbestos Detected
PQ002355	01 Main Building, 1st Floor	Kitchen (002)	Mastic pad	Mastic pad to the underside of the metal sink	No Asbestos Detected
PQ002356	01 Main Building, External	External (001)	Insulating board	Insulating board soffit to entrance canopy	No Asbestos Detected
PQ002357	01 Main Building, External	External (001)	Putty	Putty sealant to timber framed window	No Asbestos Detected
PQ002358	01 Main Building, External	External (001)	Insulating board	Insulating board undercloak to low level roof	No Asbestos Detected


Laboratory Analyst

Sample analysis was conducted at Ensaf Consultants Permanent Laboratory, The Forge, Blisworth Hill Farm, Stoke Road, NN7 3DB.

The methodology is based on procedures within the HSE Document HSG248 'Asbestos: The Analysts' guide for sampling, analysis and clearance procedures' and in-house procedures.

Interpretation of material type is based upon the opinions of the bulk sampler and not that of the bulk analysts.

**APPENDIX D**  
**SURVEY SITE PLANS**

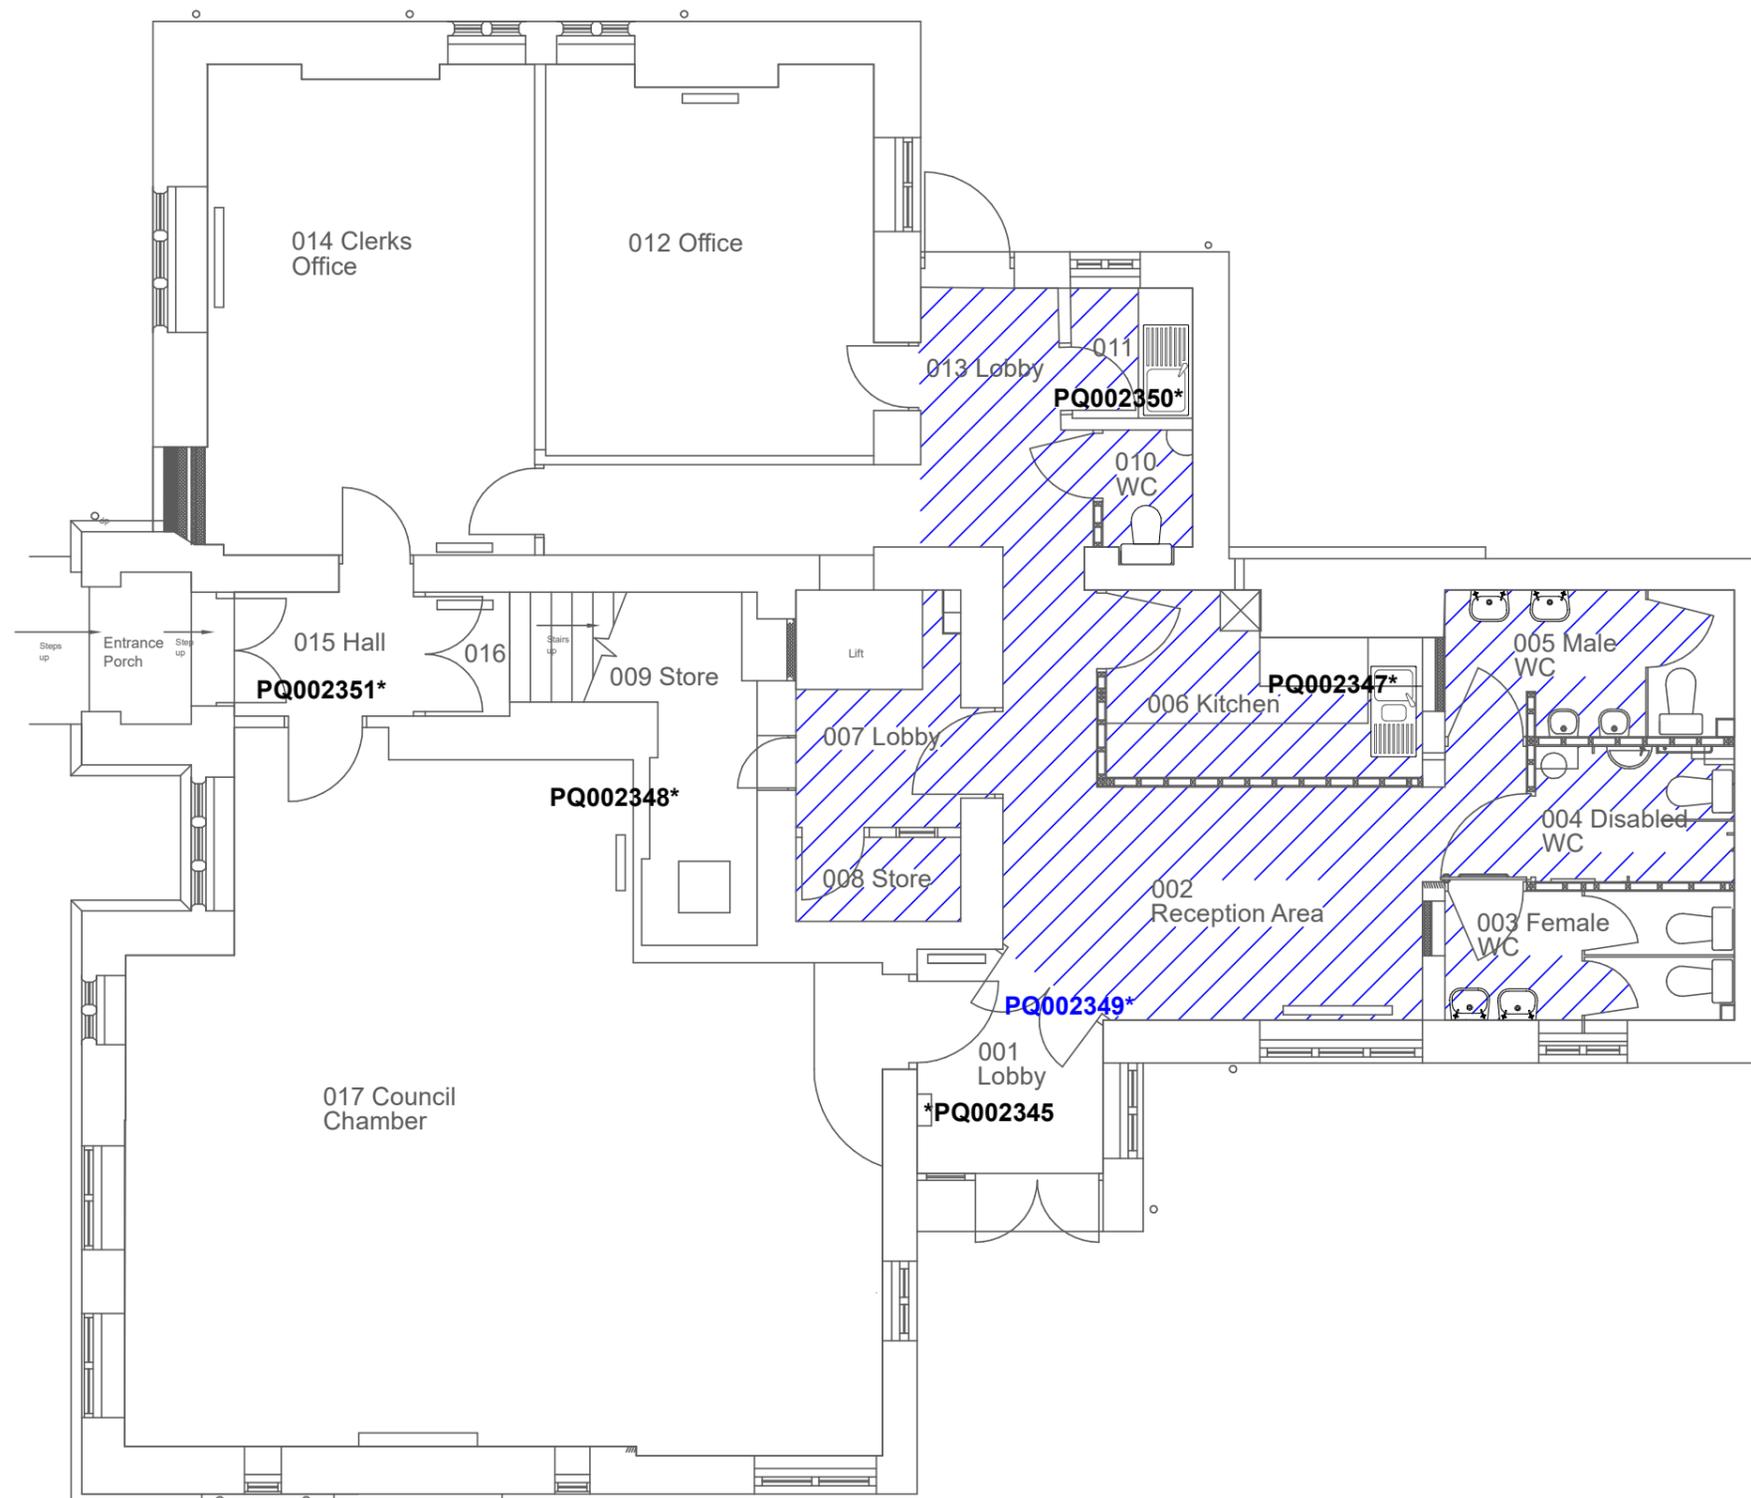

01 Main Building  
Ground Floor

Rev	Date	Description

Site

Street Parish Council,  
Street Parish Rooms,  
6 Leigh Road,  
Street,  
Somerset,  
BA16 0HA

Client

Street Parish Council

Job Number

J091121


Drwg No

Plan 1

Date	Scale
25/09/2018	NTS

Asbestos Product Key

<span style="color: red;">—</span>	Insulation
<span style="color: green;">—</span>	Board
<span style="color: orange;">—</span>	Cement
<span style="color: magenta;">—</span>	Floor Covering
<span style="color: blue;">—</span>	Other
<span style="color: black;">—</span>	Non Asbestos
<span style="color: cyan;">—</span>	No Access Area

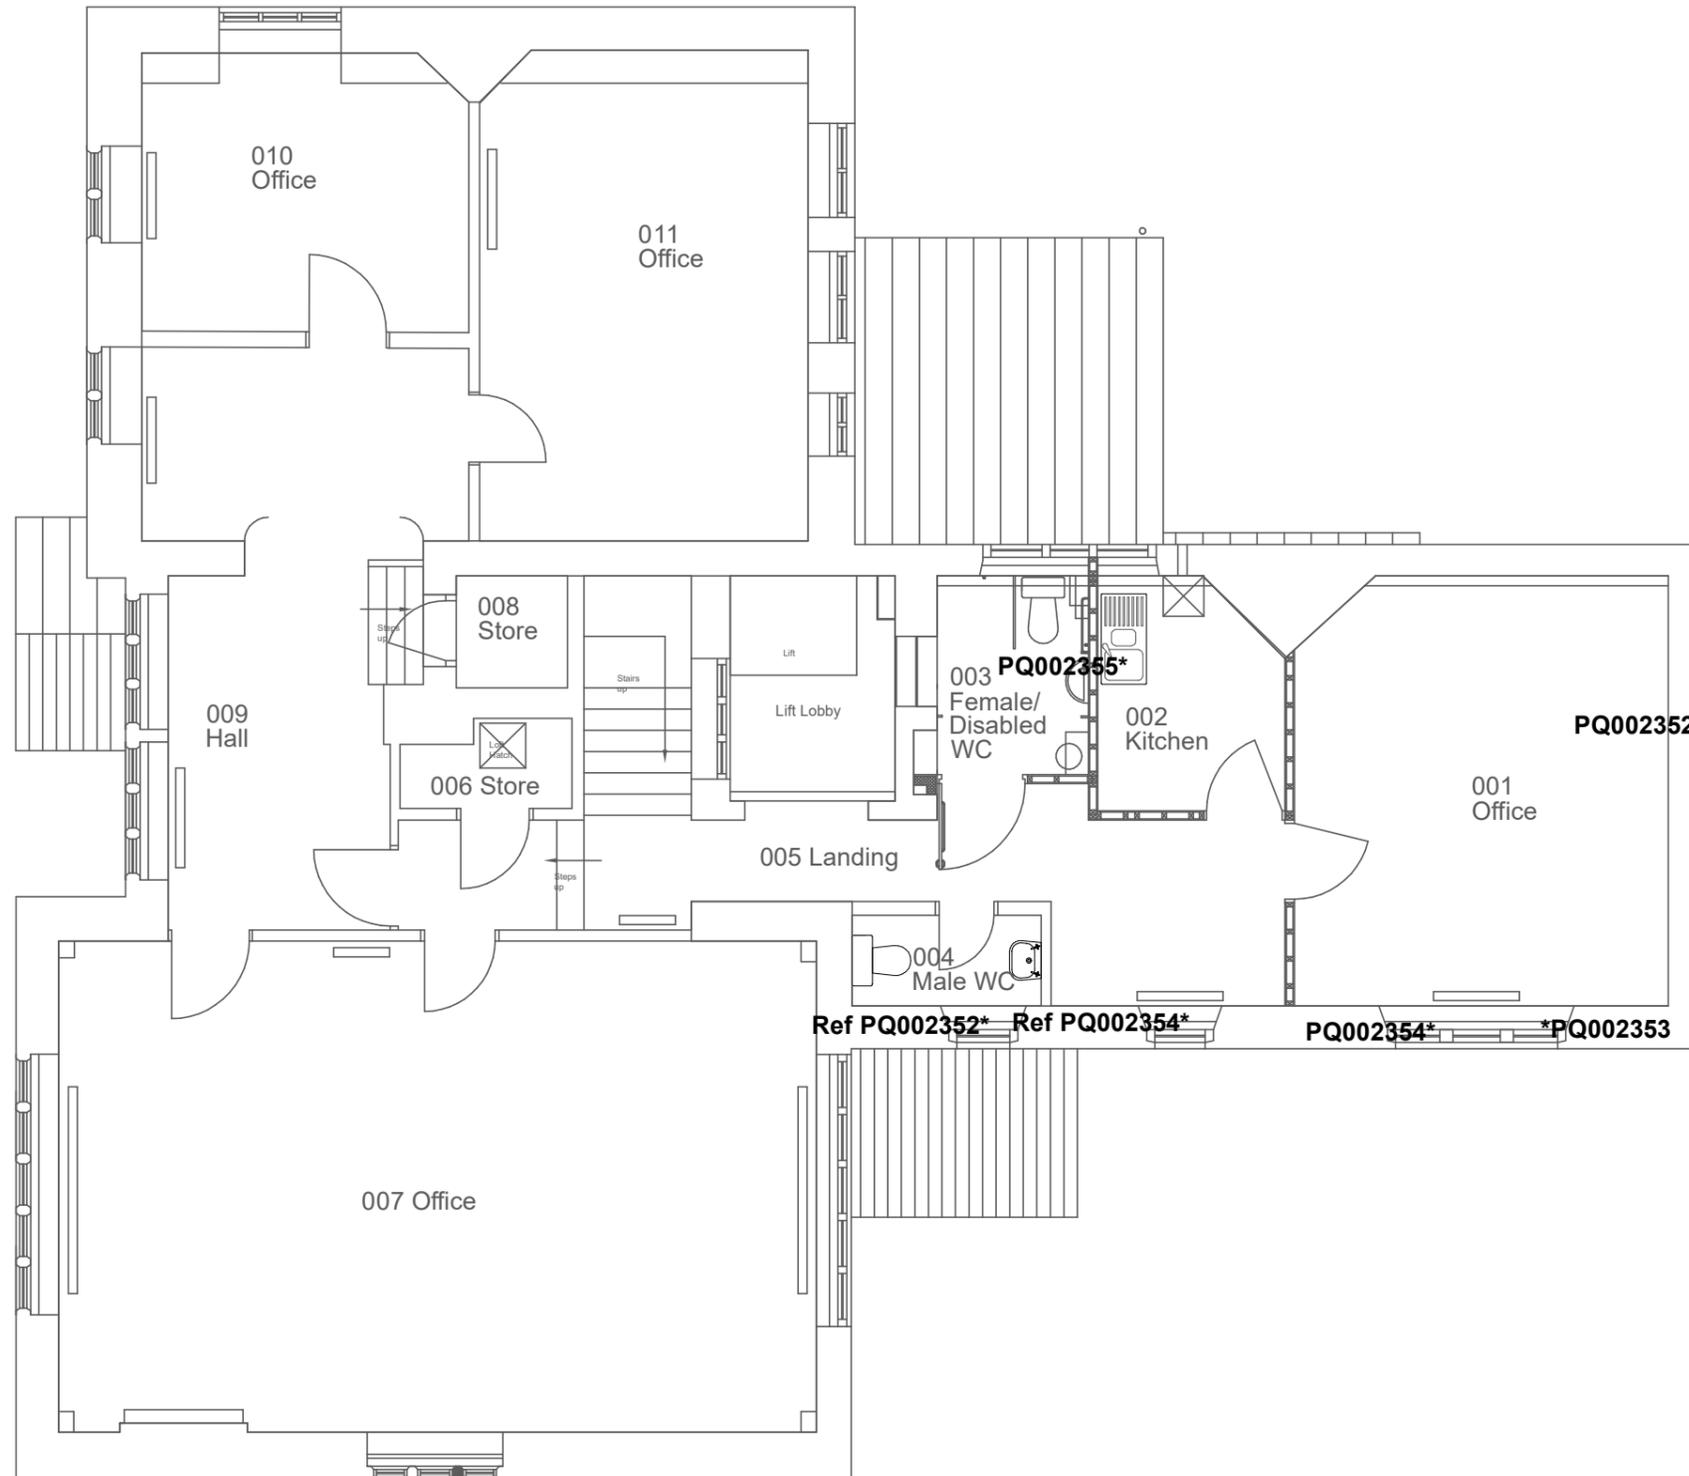

01 Main Building  
First Floor

Rev	Date	Description

Site

Street Parish Council,  
Street Parish Rooms,  
6 Leigh Road,  
Street,  
Somerset,  
BA16 0HA

Client

Street Parish Council

Job Number

J091121

Drwg No

Plan 2

Date	Scale
25/09/2018	NTS

Asbestos Product Key

	Insulation
	Board
	Cement
	Floor Covering
	Other
	Non Asbestos
	No Access Area

Rev	Date	Description

Site  
**Street Parish Council,  
Street Parish Rooms,  
6 Leigh Road,  
Street,  
Somerset,  
BA16 0HA**


Client  
**Street Parish Council**


Job Number  
**J091121**

Drwg No  
**Plan 3**

Date <b>25/09/2018</b>	Scale <b>NTS</b>
---------------------------	---------------------

Asbestos Product Key

	Insulation
	Board
	Cement
	Floor Covering
	Other
	Non Asbestos
	No Access Area

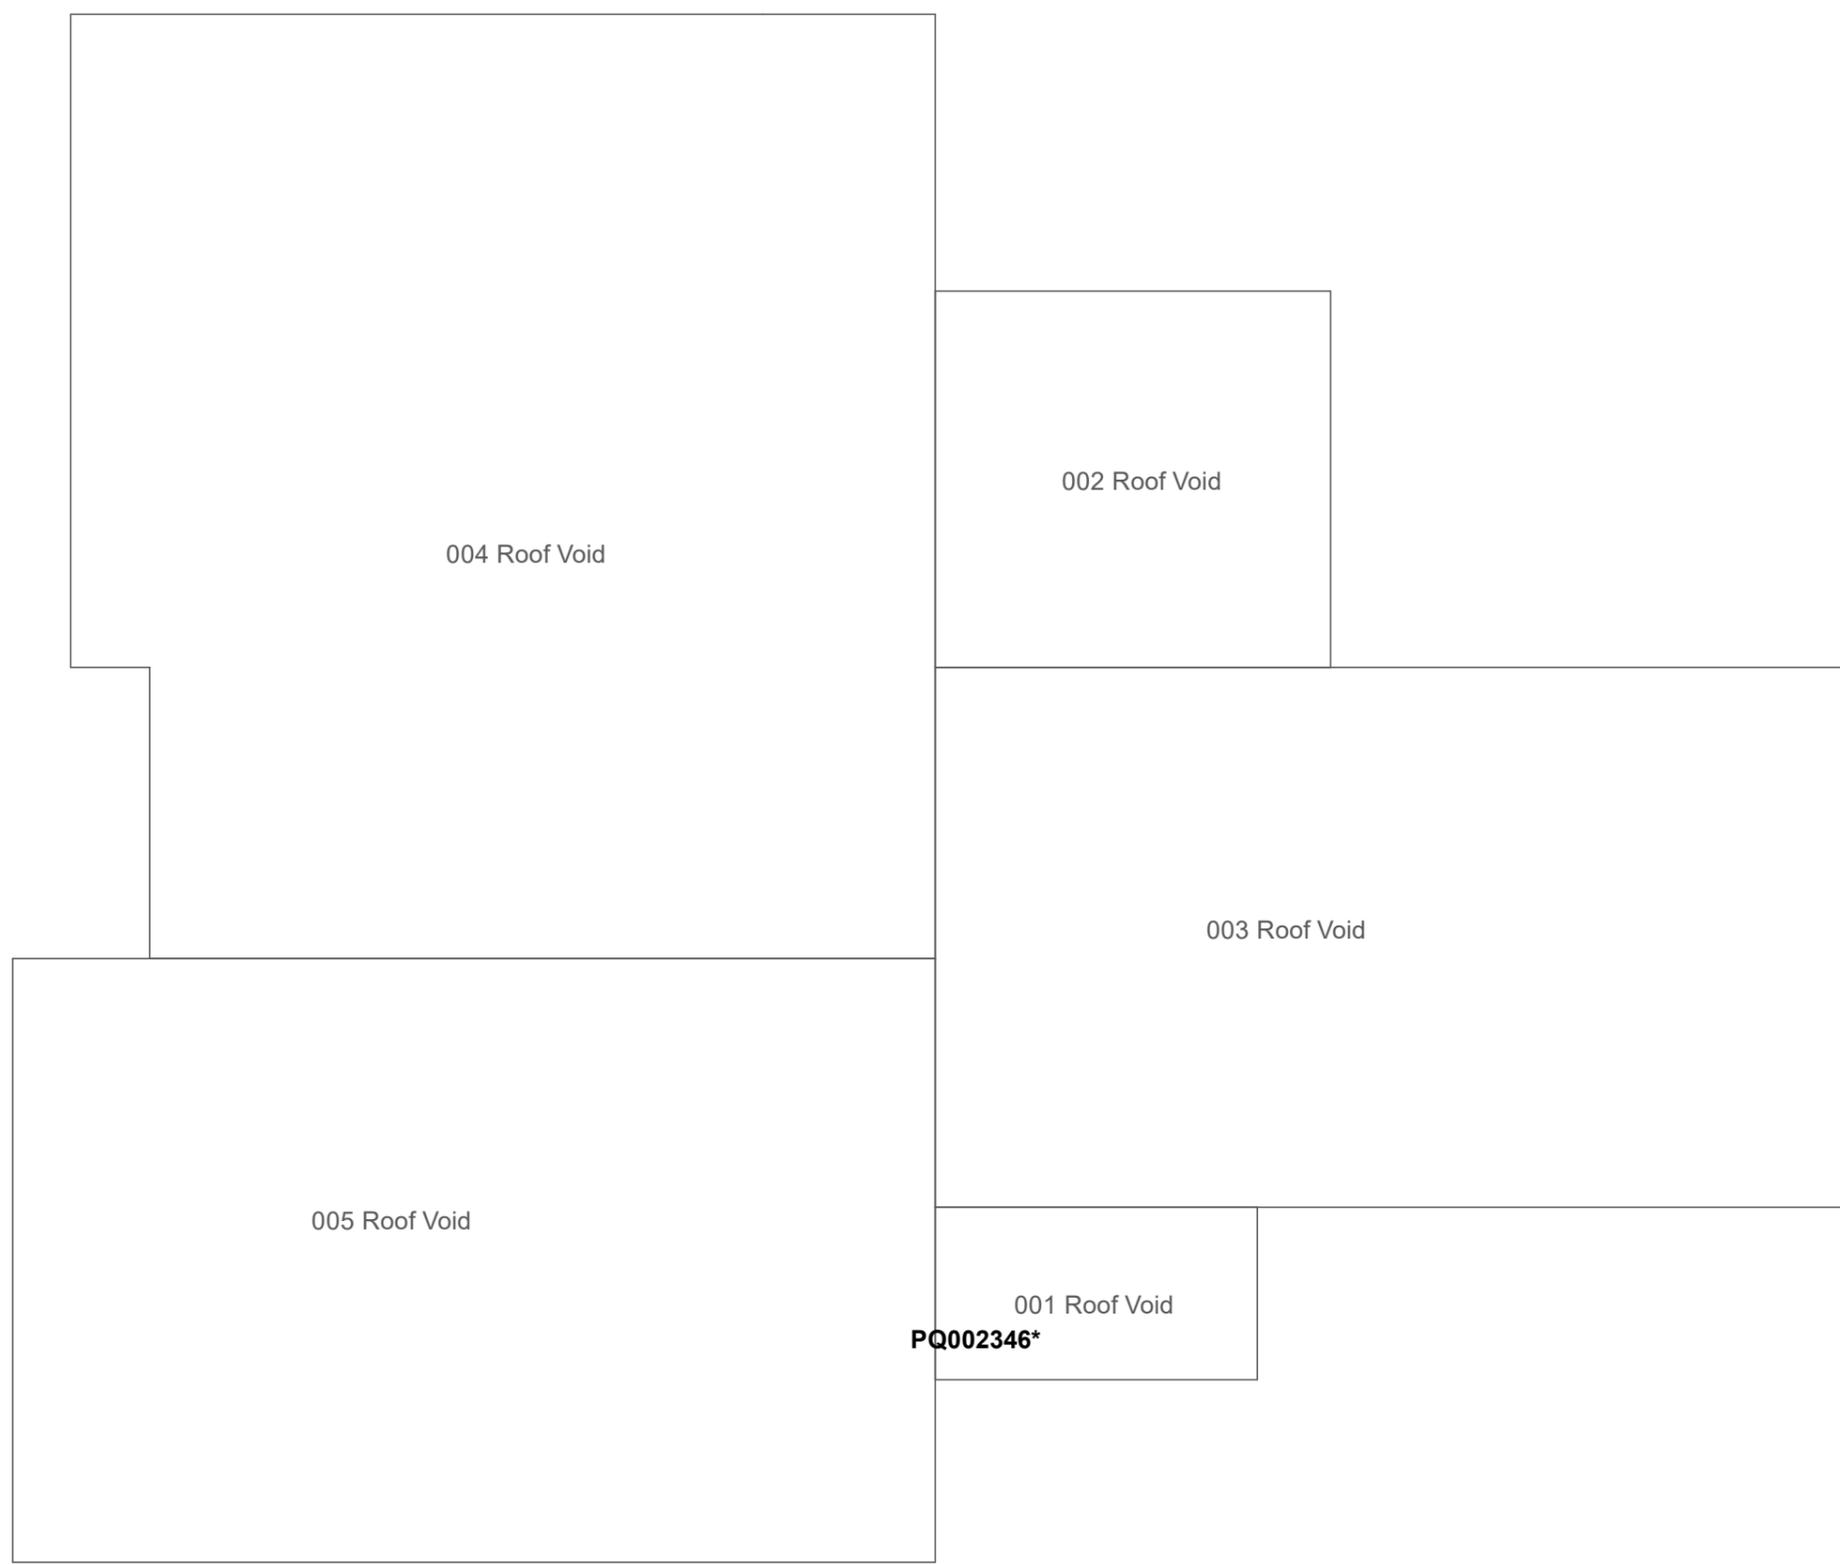

**01 Main Building  
Roof Void**

Rev	Date	Description

Site  
**Street Parish Council,  
 Street Parish Rooms,  
 6 Leigh Road,  
 Street,  
 Somerset,  
 BA16 0HA**

Client  
**Street Parish Council**


Job Number  
**J091121**

Drwg No  
**Plan 4**

Date <b>25/09/2018</b>	Scale <b>NTS</b>
---------------------------	---------------------

Asbestos Product Key

	Insulation
	Board
	Cement
	Floor Covering
	Other
	Non Asbestos
	No Access Area

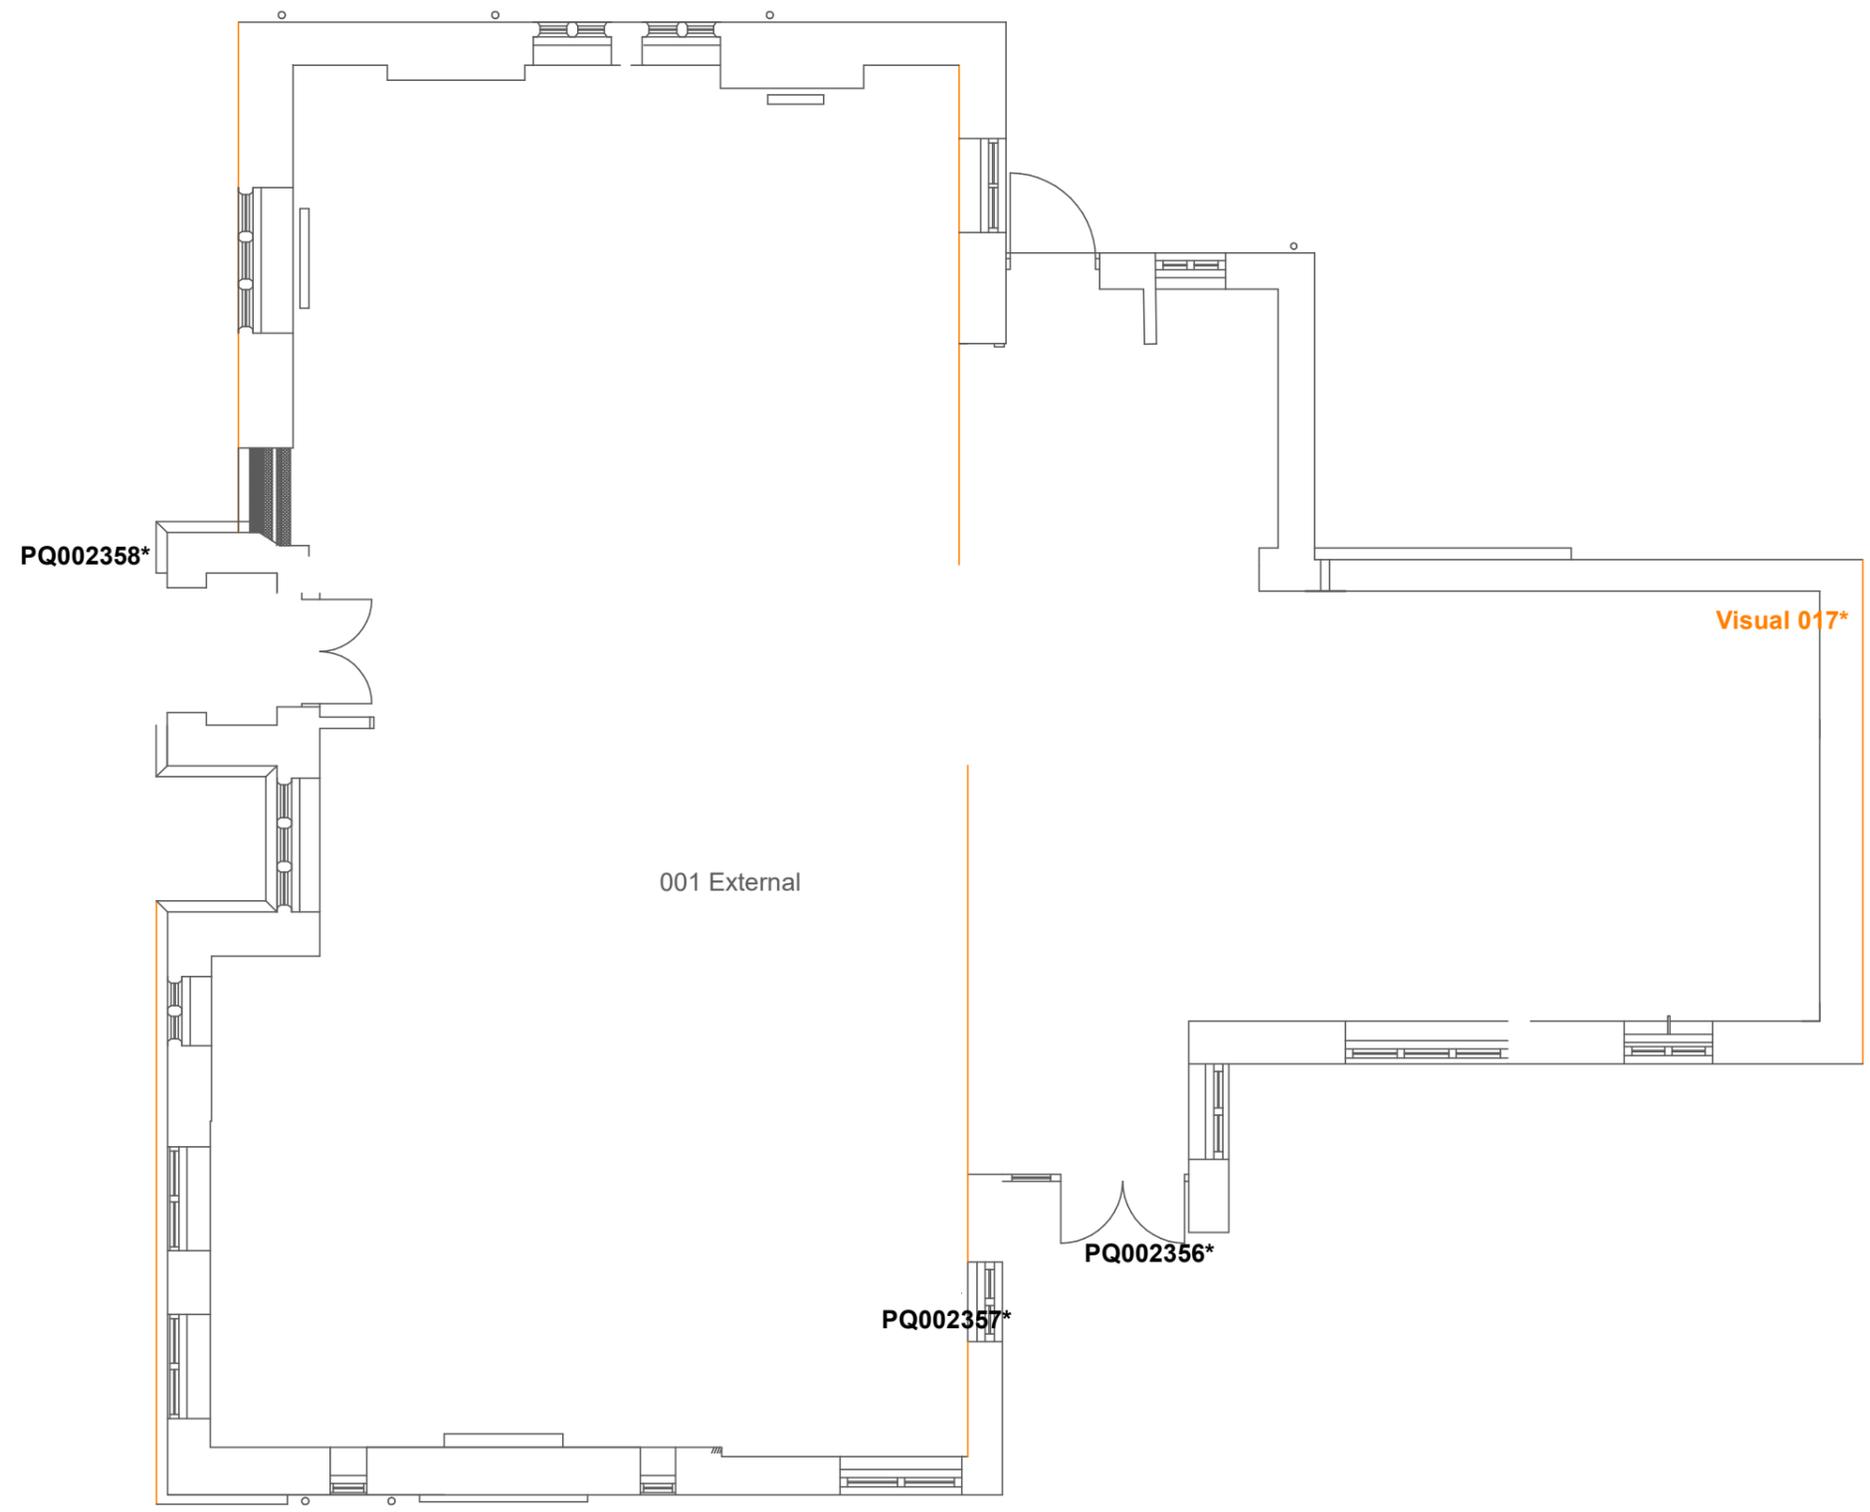

**01 Main Building  
 External**