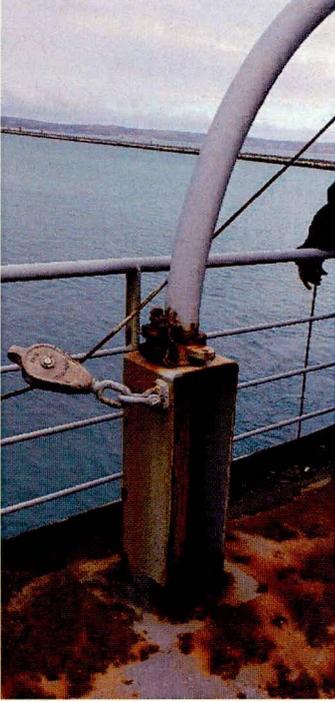


TASK NO.	TASK/DESCRIPTION	NOTES
H2.10	<p data-bbox="408 416 967 450">Redundant Accommodation Ladder Davit</p>  <p data-bbox="408 1182 1214 1294">Active corrosion and paint coating breakdown at base of redundant accommodation ladder davit. Davit no longer used therefore davit to be REMOVED and deck area REPRESENTED. Contractor to dispose of all removed materials on completion.</p> <p data-bbox="408 1312 836 1339">ALLOW for 1m² REPRESENTATION.</p>	<p data-bbox="1254 423 1452 591">Hotwork Required – Appropriate precautions to be taken in accordance with General 8.4.</p> <p data-bbox="1254 622 1406 734">To be completed in conjunction with H2.17</p> <p data-bbox="1254 766 1401 902">I/AW Paint scheme - General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H2.11	<p data-bbox="400 327 1150 383">H2 HULL AND STRUCTURE – EXTERNAL DECKS AND ASSOCIATED FITTINGS</p> <p data-bbox="400 416 512 450">02 Deck</p> <div data-bbox="400 465 1107 1070">  </div> <p data-bbox="400 1084 1214 1173">Port and stbd 02 deck waist decks have had deck screeding removed and are heavily corroded. Decks to be REPRESENTED with non slip paint coating.</p> <p data-bbox="400 1182 847 1211">ALLOW for 80m² REPRESENTATION.</p>	<p data-bbox="1249 421 1401 562">IAW Paint scheme - General 12 and Annex B refer.</p> <p data-bbox="1249 591 1449 674">To be completed in conjunction with H3.04.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
	H2 HULL AND STRUCTURE – EXTERNAL DECKS AND ASSOCIATED FITTINGS	
H2.12	<p>Gundeck Aerial Boxes</p>  <p>Port and stbd aerial mounting boxes have corroded to the extent aerials have now become detached. Aerials are redundant. Remove both mounting boxes and REPRESENT affected area. Contractor to dispose of removed items.</p> <p>ALLOW for 2m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p>