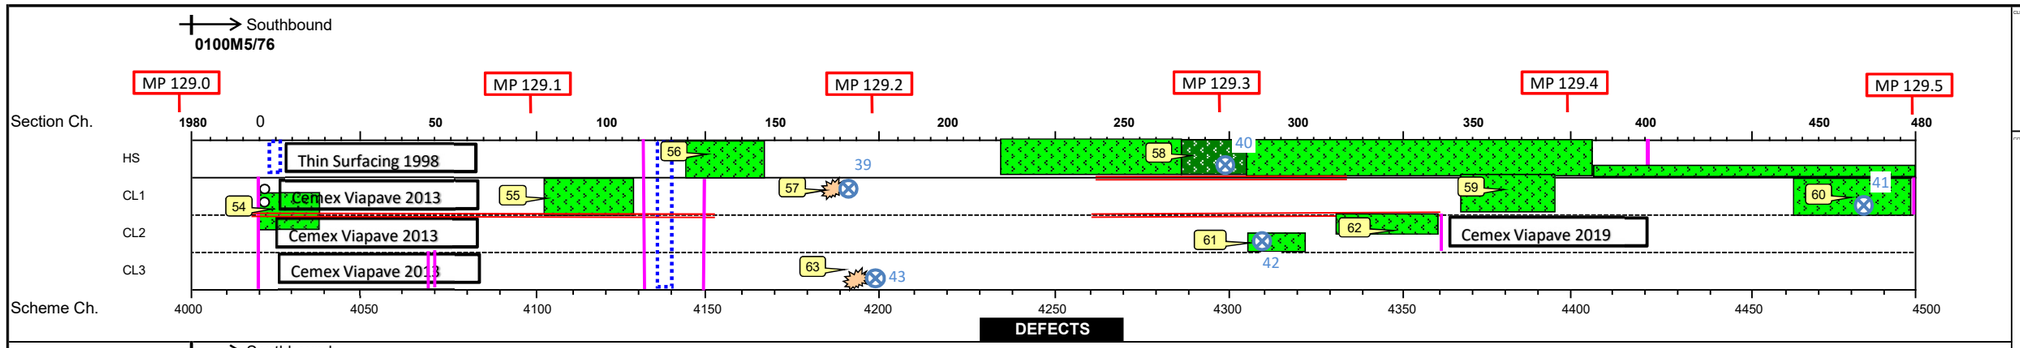

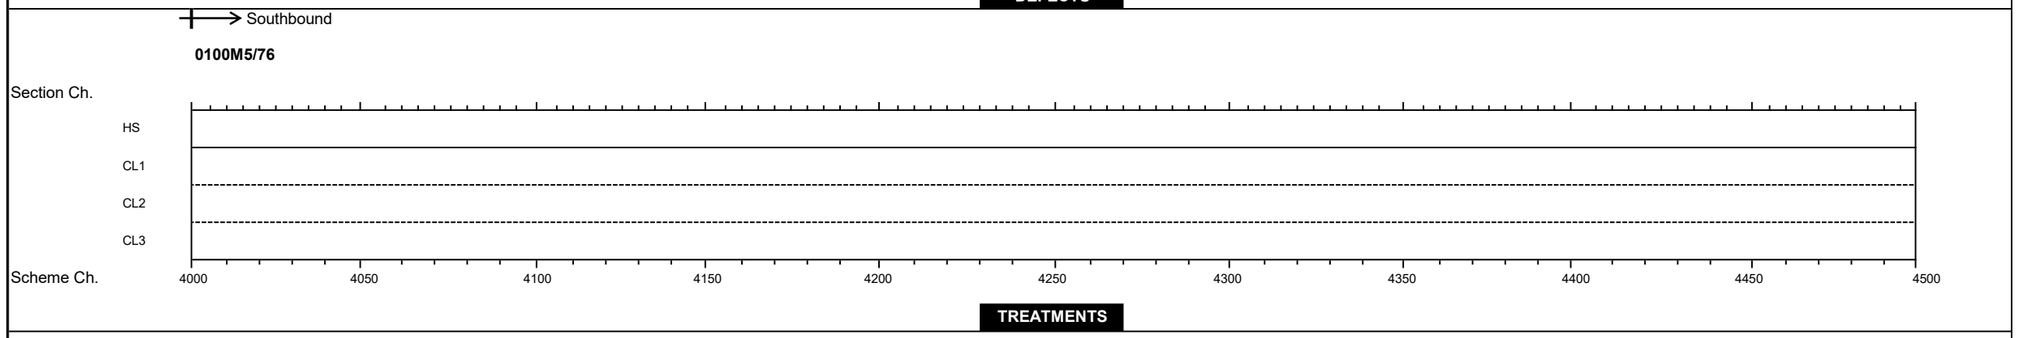

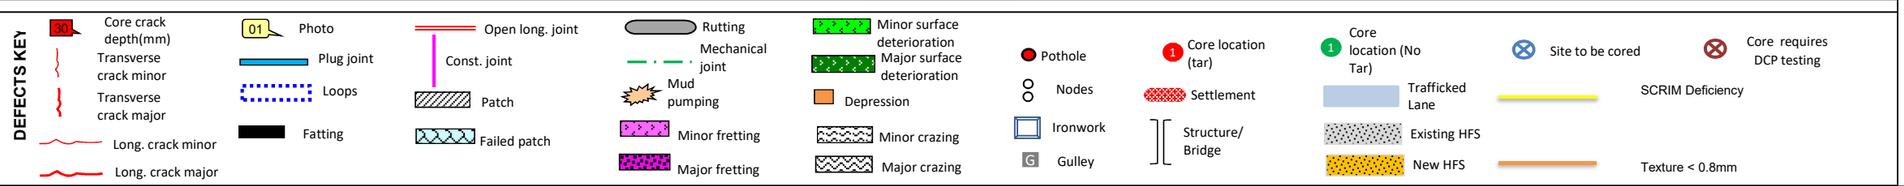

Not to scale - for illustrative purposes only

TREATMENT KEY:

- 50mm inlay TSCS (Do Min)
- Fill and overbanding repair system for crack exceeding 5mm but not exceeding 10mm wide (Do Min)
- Deep repair/ inlay (Do Something)

Notes

1) Dimensions are approximate and have been based on the most up-to-date AVIS video data

2) Only overhead power lines shown on the treatment plans. For other utilities please refer to the C2 plans for the area

3) Due to the potential inaccuracy of AVIS data regarding exact chainages, where Core locations are within the vicinity of a Gully, coring Contractor to adjust the location to avoid potential coring into/through carrier pipes

LOCATION:

M5 J14-15 SB MP 125 - 129.5

DRAWING No.

572 Defect Treatment Plan Sheet 5 of 5

DRAWN:	MT	DATE:	19/06/2020
DESIGN:	MT	DATE:	19/06/2020
CHECKED:	CC	DATE:	17/06/2020

Notes: