



Engineering Services Laboratory
Radnor Road, Scorrier, Redruth TR16 5EH
TEL : 01872 327381 FAX : 01209 821539



Asbestos Management Survey

Site Address:	The Coombe Toilets (Fishnabridge) Polperro PL13 2QR	Surveyors:	Dave Matthews Lin Noble
UPRN number:	12118	Report prepared by:	Paul Laban
Project number:	76832	Date of survey:	20 th September 2012
		Report Date:	2 nd October 2012

Executive Summary

A management survey has been undertaken within The Coombe Toilets, in which no asbestos materials have been identified.

Access was not possible within the Ladies WC cupboard and Male WC outside cupboard as these were locked at the time of the survey. It was also not possible to gain access to the ceiling voids as the trap hatches were locked. It should be presumed that any non access area contains asbestos materials until they have been inspected.

If any future refurbishment/ work is to be undertaken within the building a more comprehensive Refurbishment Survey may be required prior to the work commencing.

Introduction

Scope of work, purpose, aims and objectives:

To complete an asbestos survey within The Coombe Toilets a 1920's pitched roof block built building. The survey was undertaken in order to comply with Control of Asbestos Regulations 2012 (CAR 2012). The survey was carried out by CORMAC Solutions Engineering Services Laboratory on behalf of Roger Westcott, CORMAC Solutions.

The purpose and aim of this survey was to locate, as far as reasonably practicable, the presence and extent of any suspected Asbestos Containing Material's (ACM's) in the areas inspected/surveyed which could be damaged or disturbed during normal occupancy, including foreseeable maintenance and installation, and to assess their condition.

Representative samples are collected and analysed using polarised light microscopy. If, when tested, the material was found to contain asbestos, material assessment algorithms are assigned to assess the potential risk of fibre release (taken from HSG264). Other similar homogenous material used for the same purpose was also presumed to contain asbestos (strongly presumed).

Method

A management survey, carried out in accordance with Health & Safety Executives publication HSG264 'Asbestos: The survey guide' and the in-house 'Asbestos Surveying Technical Procedure A1', has been conducted on the areas listed below at the above site.

Areas Included In Survey (See attached plan Appendix 1)

The areas included in survey were:

- See Table 3

All other areas of the site, except those listed above, were not surveyed and are therefore not included within this report.

Inaccessible/ Excluded Areas

The areas included in the survey brief that could not be accessed were:

- See Table 3

The areas excluded from the survey (i.e. not reasonably practicable to access during the survey):

- concealed spaces which may exist within the fabric of the building where the extent and presence of these is not evident due to inaccessibility or insufficient knowledge of the structure at the time of the survey;
- fixed voids (under floors, within walls or above fixed ceilings, where the act of surveying/sampling would damage the fabric of the building);
- within live electrical equipment/ general equipment where the act of sampling would endanger the surveyor or affect the functional integrity of the item concerned. For example; fuses within electrical boxes, gaskets, fire doors, ropes associated with heating, glazing or power plant etc.

Any inaccessible/excluded areas must be presumed to contain asbestos, unless there is strong evidence that it does not. If access is required to these items the client must provide access/isolation certificates before areas/electrical appliances are inspected.

Survey Results/Findings

For survey results see Table 1 (within Appendix 2). This table shows all ACM's present (please note that only positive, Strongly Presumed and Presumed (highly likely to contain asbestos but not sampled) ACM's will be recorded) along with any areas not accessed. Samples of Non-ACM's are recorded on Table 2. Representative photographs of materials are shown in Appendix 3.

Where appropriate, samples of suspected ACM's were taken from the property, representative samples were also taken of any materials that may be confused with ACM's. Sample stickers, bearing the individual sample's unique number, were applied to the point of sampling, for future reference (unless requested not to be used by the client). Products that

were very unlikely to contain asbestos or have asbestos added were not sampled (e.g. wallpaper, plasterboard etc.).

Any samples taken were returned to the laboratory for analysis by Polarised Light Microscopy (PLM) using a documented In-House Procedure, No: A3 'Bulk Analysis', based on HSG 248 'Asbestos: The analysts' guide for sampling, analysis and clearance procedures' – results of which can be found in Appendix 4.

Variations/deviations

No variations or deviations from the In-House Procedure were recorded at the time of the survey.

Conclusions and actions

No asbestos containing materials were detected in the areas surveyed.

Authorised by:



Claire Stephen - Asbestos Manager

Surveyed by:




Dave Matthews- Geoenvironmental Technician

APPENDIX 1

PLAN


Legend

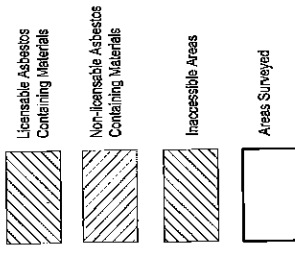

Rev	Description	Drawn	Check	Date

Property: The Coombe Toilets	
UPRN: 12118	
Title: ACM Location Plan	

Scale: 1:50	Drawn: P.	Reviewed:
Date: 07/07/17	Checked: G.	Drawn/Rev:
Sheet: 03/03/12	Job: 7052	
Total: 1 of 1		0

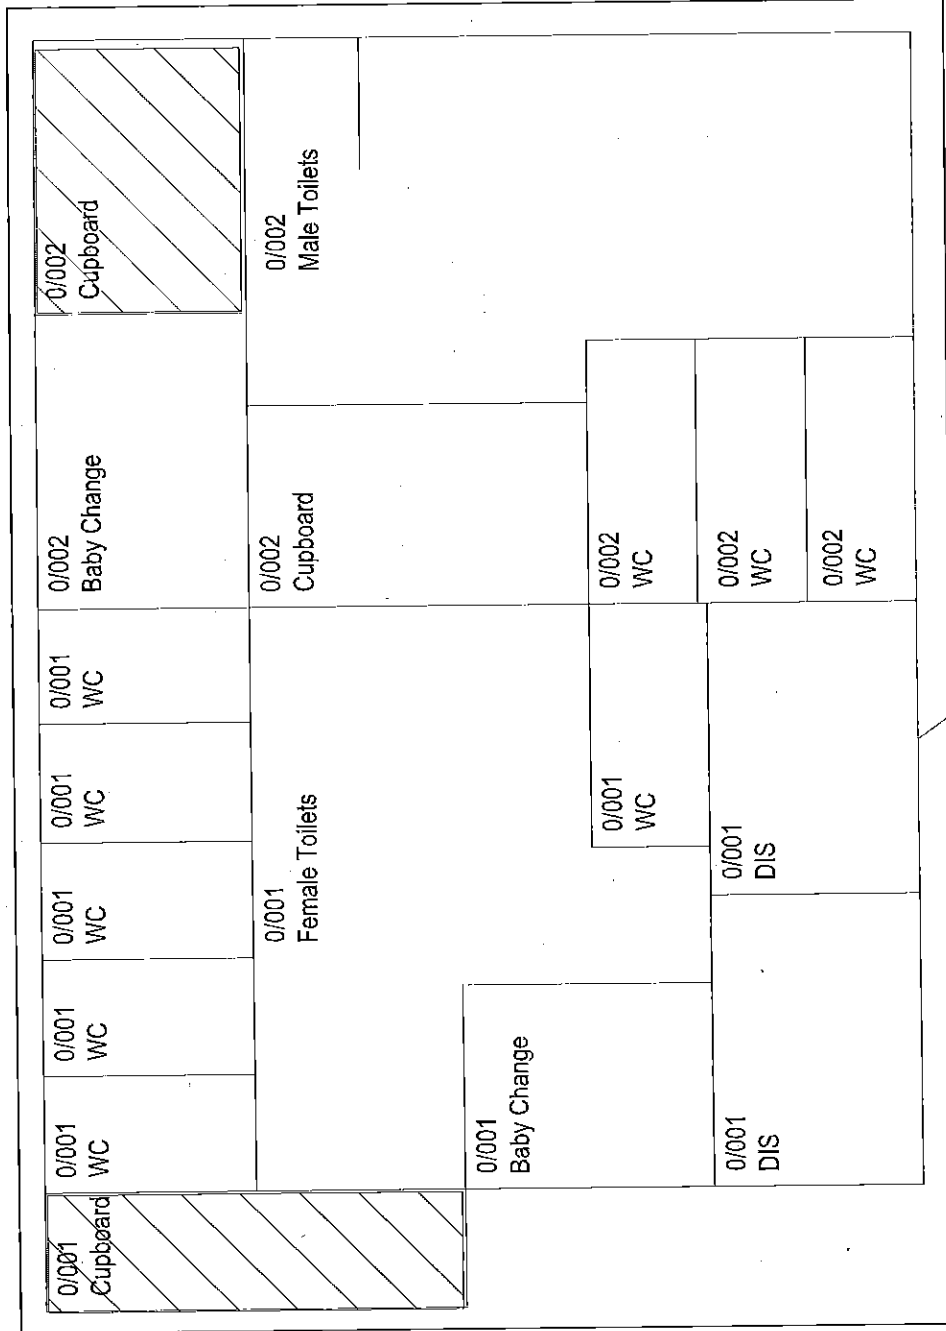

8121/01

APPENDIX 2

TABLES 1, 2 & 3



Table 1: Asbestos Containing Materials (including presumed materials not sampled and no access areas)

B	F	R	Room Description	Sample Ref. No.	Material Location	Approx. Quantity (m ²)	Product Type	Asbestos Type	Surface Treatment	Condition	Material Asses't Score	Accessibility	Comments
No asbestos materials detected during survey													

KEY: P = PRESUMED; SP = STRONGLY PRESUMED. Accessibility - low, medium or high based on surveyors opinion. N/A = Not Applicable

Table 2: Suspect Asbestos Containing Materials found not to contain asbestos


B	F	R	Room Description	Sample Ref No	Material Location	Material Type	Asbestos Not Detected	Comments
1	-	Ext	External	8121/01	Roof tiles	Slate	No Asbestos Detected	

Table 3: Areas inspected & areas not accessed (please note if not on this table or in area not accessed assume asbestos may be present until proven otherwise)

B	F	R	Room Description	Area/s requested to be Inspected	Areas not accessed & reason	Comments
1	0	001	Ladies WC	Full Management Survey	Ceiling void - trap hatch locked No access to cupboard - Locked	Includes baby changing area
1	0	001	Disabled WC's	Full Management Survey	Ceiling void - fixed ceiling	
1	0	002	Male WC	Full Management Survey	Ceiling void - trap hatch locked No access to outside cupboard - Locked	Includes baby changing area
1	-	Ext	External	Full Management Survey		

APPENDIX 3

PHOTOS

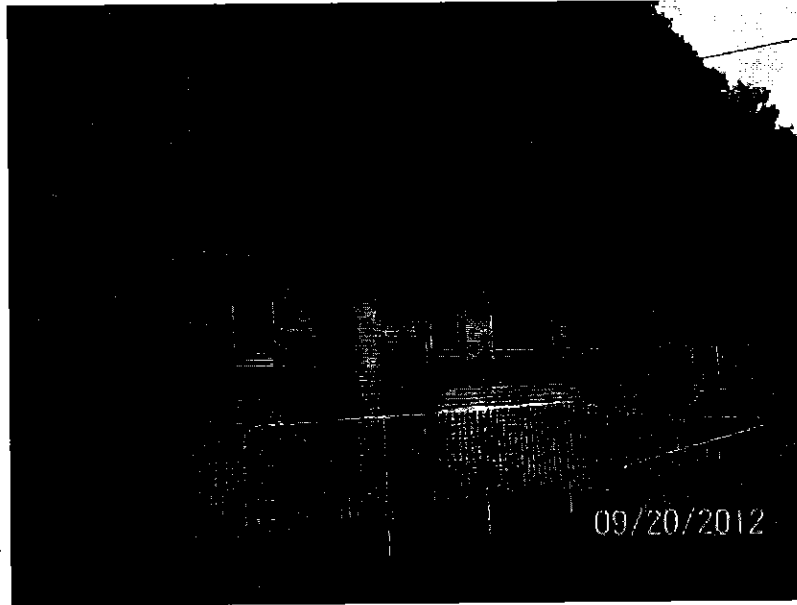

Photograph 1: Showing The Coombe Toilets

APPENDIX 4

BULK ANALYSIS REPORT



Engineering Services Laboratory
Radnor Road, Scorrier, Redruth TR16 5EH TEL : 01872 327381 FAX : 01209 821539

ASBESTOS BULK SAMPLE ANALYSIS TEST REPORT



In House Method based on HSG248

Scheme / Site: **The Coombe WC - Asbestos Survey**
Location: **Throughout building**

Date Sampled: **20/09/2012**
Sampled By: **DM**
Date Received: **20/09/2012**
Date Tested: **24/09/2012**
Tested By: **JM**

Test Report No:	AS6725.1
Project No:	76832
Client Ref:	N/A
Sample Cert No:	AS 8121
Date Reported:	26/09/2012
Page Number:	1 of 1

Test Results

Sub Sample Number	Client Sample Number	Sample Type	Sample Details	Asbestos Type(s) Present
1	-	O (Slate)	External roof tile	AND

For additional information see the Sampling Certificate.

KEY:

Sample Type: A = Adhesive, C = Cement, D = Dust/Debris, FB = Fibre Board, G = Gasket, IB = Insulating Board, I = Insulation, L = Lagging, PL = Pipe Lagging, R = Resin, RF = Roof Felt, SP = Sink Pad, SC = Spray Coating, P = Paper, TC = Textured Coating, T = Textile, VFT = Vinyl Floor Tile, VFC = Vinyl Floor Covering, W = Wood, O = Other (detailed).
Asbestos Type: AM = Amosite, CH = Chrysotile, CR = Crocidolite, Trem = Fibrous Tremolite, Actin = Fibrous Actinolite, Anth = Fibrous Anthophyllite, AND = Asbestos Not Detected.

Remarks : Materials have been referred to as Asbestos Insulating Board or Asbestos Cement based on upon their asbestos content and visual appearance alone. Water absorbency checks on materials have not been carried out unless stated otherwise. Where this has been done, the test is outside the scope of UKAS Accreditation.
Where samples have not been taken by Engineering Services Laboratory, it can only report analysis results. No responsibility can be taken for any consequences arising from the client's sampling strategy or procedures, or the use of these results in subsequent reports.

Client Name: **CORMAC Property Maintenance**
F.A.O: **Roger Westcott**

Address: **Central Group Centre
Castle Canyke Road
Bodmin**

PL31 1DZ

Tel No: 01872 327854 Fax No:

Authorised Signatory:

Paul Laban- Geo-environmental Engineer

T:\Test\2012\09\26\MAIN\MS-AS6725-1-crowe-092000-0.DOC : Revision 18, Date: 26/11/2008, By: RNH.

This Report relates only to the samples tested.

Opinions and Interpretations expressed herein, or any water absorption tests performed, are outside the scope of UKAS accreditation.
This report may not be reproduced except in full, without the written approval of the Laboratory.



This report is not valid if the serial number has been defaced or altered

IPN3/

0242139

ELECTRICAL INSTALLATION CONDITION REPORT

Issued in accordance with British Standard 7671 - Requirements for Electrical Installations by an Approved Contractor or Competent Body installed with NICEIC, Warwick House, Houghton Hall Park, Houghton Regis, Dunstable LU5 5ZX

Original (to the person ordering the work)

A. DETAILS OF THE CLIENT

Client: **CORNWALL COUNCIL**

Address: **NEW COUNTY HALL
TRURO.**

Postcode:

B. PURPOSE OF THE REPORT

This report must be used only for reporting on the condition of an existing installation.

Purpose for which this report is required: **ANNUAL PUBLIC TOILET ELECTRICAL TEST.**

Date(s) on which inspection and testing were carried out: **7-1-14.**

C. DETAILS OF THE INSTALLATION

Occupier: **CORNWALL COUNCIL**

Address: **THE CORNWALL TOILETS (FISHMONGERS)
THE CORNWALLS
POLPERNO**

Postcode: **PL13 2RQ**

Estimated age of the electrical installation:

20 years

Description of premises: **COMMERCIAL.**
domestic, commercial,
industrial, other
(Please state)

Evidence of alterations or additions

NO

If yes, estimated age

years

Date of previous inspection:

FEB 2013

Electrical Installation Certificate No or previous Periodic Inspection or Condition Report No:

N/A.

Records of installation available: **NO**

Records held by: **--**

D. EXTENT OF THE INSTALLATION AND LIMITATIONS ON THE INSPECTION AND TESTING

Extent of the electrical installation covered by this report:

DBI ALL CIRCUITS AND ACCESSORIES.

Agreed limitations including the reasons, if any, on the inspection and testing:

ACCESS LIMITATION TO MAIN SUPPLY PUMP AND METERING EQUIPMENT.

INSULATION RESISTANCE LIMITATION L.N ON LIGHTING CIRCUITS, DUE TO SENSITIVE ELECTRONICS IN L.N.B.

Agreed with: **CLIENT.**

Operational limitations including the reasons (see page No.)

RCD TEST (SEE SECTION F)

The inspection and testing have been carried out in accordance with BS 7671, as amended. Cables concealed within trunking and conduits, or cables and conduits concealed under floors, in inaccessible roof spaces and generally within the fabric of the building or underground, have not been visually inspected.

E. SUMMARY OF THE CONDITION OF THE INSTALLATION

General condition of the installation (in terms of electrical safety):

GENERALLY GOOD, APART FROM NOTES IN SECTION F.

Summary of the condition of the installation continued on additional pages? No ☒ Yes Specify page

Overall assessment of the installation:

SATISFACTORY / UNSATISFACTORY (Delete as appropriate)

An 'Unsatisfactory' assessment indicates that dangerous and/or potentially dangerous conditions have been identified

This report should have been reviewed and confirmed by the registered Qualified Supervisor or the Approved Contractor responsible for issuing it. (See declaration on page 2)

This report is based on the model forms shown in Appendix B of BS 7671

Published by NICEIC, a part of the Ascot Group © Copyright The Electrical Safety Council (July 2011)

IPN3/1

Page 1 of 2

Please see the 'Notes for Recipients' on the reverse of this page.

ELECTRICAL INSTALLATION CONDITION REPORT

H. SCHEDULES AND ADDITIONAL PAGES

Inspection Schedule: Page(s) No 4, 5, 6

Additional pages, including additional source(s) data sheets: Page No(s)

Schedule of Circuit Details for the Installation: Page No(s) 7

Schedule of Test Results for the Installation: Page No(s) 8

The pages identified are an essential part of this report. The report is valid only if accompanied by all the schedules and additional pages identified above.

I. NEXT INSPECTION

I/We recommend that this installation is further inspected and tested after an interval of not more than

1 year.

(Enter interval in terms of years, months or weeks, as appropriate)

provided that any items at F which have been attributed a Classification code C1 (danger present) are remedied immediately and that any items which have been attributed a code C2 (potentially dangerous) or require further investigation are remedied or investigated respectively as a matter of urgency. Items which have been attributed a Classification code C3 should be improved as soon as practicable (see F).

J. DETAILS OF NICEIC APPROVED CONTRACTOR

Trading title: **Carma Solutions Ltd.**

Address: **CASTLE CANYON ROAD
BIRMINGHAM.**

Telephone number:

Email address:



Enrolment number:
(Essential information)

6 0 1 4 9 9

Postcode: **B13 1BZ**

Branch number:
(If applicable)

K. SUPPLY CHARACTERISTICS AND EARTHING ARRANGEMENTS

System type(s)	Number and type of live conductors			Nature of supply parameters			Characteristics of primary supply overcurrent protective device(s)	
TNS		a.c. ✓	d.c.	Nominal voltage(s) 230 V	U₀ 50 V	BS(EN) 1361	Type IPB	
TNCS ✓	1-phase (2-wire) ✓	1-phase (3-wire)	2-pole	Nominal frequency, f _N 50 Hz	Noise (1) by enquiry.		Rated current Lim.	A
TNC	2-phase (3-wire)		3-pole	Prospective fault current, I _p 0.003 kA	(2) by enquiry or by measurement		Short-circuit capacity Lim.	kA
TT ✓	3-phase (3-wire)	3-phase (4-wire)	other	External earth fault loop impedance, Z _e N/A	(3) where more than one supply, record the higher or highest values		Confirmation of supply polarity	✓ (✓)
IT	Other	Please state		Number of sources 1	(4) by measurement			

L. PARTICULARS OF INSTALLATION AT THE ORIGIN

Means of earthing		Details of installation earth electrode (where applicable)	
Distributor's facility:	Type: (eg rod(s), tape(s) etc) ROD	Location: BEHIND TOILET BLOCK.	
Installation earth electrode: ✓	Electrode resistance, R _A 70.7	(2) Method of measurement: LOOP TESTER.	
Main switch or circuit-breaker		Earthing and protective bonding conductors	
Type: BS(EN) 4293	Voltage rating 240 V	Earthing conductor	Main protective bonding conductors
No of poles 2	Rated current, I _n 30 A	Conductor material COPPER	Conductor material N/A
Primary supply conductors material COPPER	RCD operating current, I _{Δn} 30 mA	Conductor csa 10 mm²	Conductor csa - mm²
Primary supply conductors csa 16 mm²	Rated tripping delay N/A ms	Connection continuity verified ✓ (✓)	Connection continuity verified ✓ (✓)
	RCD operating time (at I _{Δn}) Lim. ms		
* (Applicable only where an RCD is suitable and is used as a main circuit breaker)		Bonding of extraneous-conductive parts (✓)	
		Water service	Gas service
		Oil service	Structural steel
		Lightning protection	Other incoming services
		Specify	

ELECTRICAL INSTALLATION CONDITION REPORT

INSPECTION SCHEDULE FOR DISTRIBUTION BOARDS AND CIRCUITS

Item	Description	Outcome* Location reference
1.0	Condition/adequacy of distributor's/supply intake equipment	
1.1	Service cable	✓
1.2	Service cut-out/fuse(s)	Lim
1.3	Meter tails - distributor	✓
1.4	Meter tails - consumer	✓
1.5	Metering equipment	Lim
1.6	Means of main isolation (where present)	N/A
2.0	Presence of adequate arrangements for parallel or switched alternative sources	N/A
3.0	Automatic disconnection of supply	
3.1	Main earthing and bonding arrangements	
	• Presence and condition of distributor's earthing arrangement	N/A
	• Presence and condition of earth electrode arrangement	✓
	• Adequacy of earthing conductor size	✓
	• Adequacy of earthing conductor connections	✓
	• Accessibility of earthing conductor connections	✓
	• Adequacy of main protective bonding conductor size(s)	✓
	• Adequacy of main protective bonding conductor connections	✓
	• Accessibility of main protective bonding connections	✓
	• Provision of earthing/bonding labels at all appropriate locations	✓
3.2	FELV	
	• Source providing at least simple separation	N/A
	• Plugs, socket-outlets and the like not interchangeable with those of other systems within the premises	N/A
3.3	Reduced low voltage	
	• Adequacy of source	N/A
	• Plugs, socket-outlets and the like not interchangeable with those of other systems within the premises	N/A
4.0	Other methods of protection (where the methods of protection listed below are employed, details should be provided on separate sheets)	
4.1	Double insulation	N/A
4.2	Reinforced insulation	N/A
4.3	Use of obstacles	N/A
4.4	Placing out of reach	N/A
4.5	Non-conducting location	N/A
4.6	Earth-free local equipotential bonding	N/A
4.7	Electrical separation for more than one item of equipment	N/A
5.0	Distribution equipment	
5.1	Adequacy of working space/accessibility of equipment	✓
5.2	Security of fixing	✓
5.3	Condition of insulation of live parts	✓
5.4	Adequacy/security of barriers	✓
5.5	Condition of enclosure(s) in terms of IP rating	✓
5.6	Condition of enclosure(s) in terms of fire rating	✓
5.7	Enclosure not damaged/deteriorated so as to impair safety	✓
5.8	Presence of main switch(es), linked where required	✓
5.9	Operation of main switch(es) (functional check)	✓
5.10	Correct identification of circuit protective devices	✓
5.11	Adequacy of protective devices for prospective fault current	✓
5.12	RCD(s) provided for fault protection - Includes RCBOs	✓

* All boxes must be completed.

✓ Indicates: Acceptable condition

Lim Indicates: Limitation

N/A Indicates: Not applicable

Unacceptable condition state C1 or C2

Improvement recommended state C3

Further investigation required state F1
(to determine whether danger or potential danger exists)

Outcome

Provide additional comment where appropriate on attached numbered sheets. C1, C2 and C3 coded items to be recorded in section F of the report.

ELECTRICAL INSTALLATION CONDITION REPORT

INSPECTION SCHEDULE FOR DISTRIBUTION BOARDS AND CIRCUITS

Item	Description	Outcome*	Location reference
5.13	RCD(s) provided for additional protection – Includes RCBOs	✓	
5.14	RCD(s) provided for protection against fire – Includes RCBOs	✓	
5.15	Manual operation of circuit-breakers and RCDs to prove disconnection	C3	F.1
5.16	Presence of RCD retest notice at or near equipment where required	✓	
5.17	Presence of diagrams, charts or schedules at or near equipment where required	✓	
5.18	Presence of non-standard (mixed) cable colour warning notice at or near equipment where required	✓	
5.19	Presence of alternative supply arrangement warning notice(s) at or near equipment where required	N/A	
5.20	Presence of replacement next inspection recommendation label	✓	
5.21	Presence of other required labelling (specify)	N/A	
5.22	Examination of protective device(s) and base(s); correct type and rating (no signs of unacceptable thermal damage, arcing or overheating)	✓	
5.23	Protection against mechanical damage where cables enter equipment	✓	
5.24	Protection against electromagnetic effects where cables enter metallic enclosures	N/A	
6.0	Distribution/final circuits		
6.1	Identification of conductors	✓	
6.2	Cables correctly supported throughout their length	✓	
6.3	Condition of insulation of live parts	✓	
6.4	Non-sheathed cables protected by enclosure in conduit, duct or trunking	✓	
6.5	Suitability of containment systems for continued use (including flexible conduit)	✓	
6.6	Cables correctly terminated in enclosures (indicate extent of sampling in Section D of report)	✓	
6.7	Examination of cables for signs of unacceptable thermal and mechanical damage/deterioration	✓	
6.8	Adequacy of cables for current-carrying capacity with regard to the type and nature of installation	✓	
6.9	Adequacy of protective devices; type and rated current for fault protection	✓	
6.10	Presence and adequacy of circuit protective conductors	✓	
6.11	Co-ordination between conductors and overload protective devices	✓	
6.12	Cable installation methods/practices appropriate to the type and nature of installation and external influences	✓	
6.13	Cables where exposed to direct sunlight, of a suitable type	✓	
6.14	Concealed cables installed in prescribed zones (see extent and limitations)		
6.15	Concealed cables incorporating earthed armour or sheath, or run within earthed wiring system, or otherwise protected against mechanical damage caused by nails, screws and the like where not in prescribed zones or not protected by 30 mA RCD (see extent and limitations)	N/A	
6.16	Provision of additional protection by 30 mA RCD for cables concealed in walls or partitions	N/A	
6.17	Provision of additional protection by 30 mA RCD - Where reasonably likely to be used to supply mobile equipment for use outdoors - For all socket-outlets of rating 20 A or less provided for use by ordinary persons	✓	
6.18	Provision of fire barriers, sealing arrangements and protection against thermal effects	✓	
6.19	Band II cables segregated/separated from Band I cables	N/A	
6.20	Cables segregated/separated from non-electrical services	✓	
6.21	Termination of cables at enclosures (Identify numbers and locations of items inspected in Section D) - Connections under no undue strain - No basic insulation of a conductor visible outside an enclosure - Connections of live conductors adequately enclosed - Adequacy of connection at point of entry to enclosure (gland, bush or similar)	✓	
6.22	General condition of wiring systems	✓	
6.23	Temperature rating of cable insulation	✓	
6.24	Condition of accessories including socket-outlets, switches and joint boxes	✓	
6.25	Suitability of accessories for external influences	✓	

* All boxes must be completed.

✓ Indicates Acceptable condition

'LIM' Indicates a Limitation

'N/A' Indicates Not applicable

Unacceptable condition state C1 or C2

Improvement recommended state C3

Further investigation required state F/I (to determine whether danger or potential danger exists)

Outcome

Provide additional comment where appropriate on attached numbered sheets. C1, C2 and C3 coded items to be recorded in section F of the report.

ELECTRICAL INSTALLATION CONDITION REPORT

INSPECTION SCHEDULE FOR DISTRIBUTION BOARDS AND CIRCUITS

Item: Description	Outcome* Location reference
7.0 Isolation and switching	
7.1 Isolators	
• presence and condition of appropriate devices	✓
• acceptable location	✓
• capable of being secured in the OFF position	✓
• correct operation verified	✓
• clearly identified by position and/or durable marking(s)	✓
• Warning label posted in situations where live parts cannot be isolated by the operation of a single device	N/A
7.2 Switching off for mechanical maintenance	
• presence and condition of appropriate devices	✓
• acceptable location	✓
• capable of being secured in the OFF position	✓
• correct operation verified	✓
• clearly identified by position and/or durable marking(s)	✓
7.3 Emergency switching/stopping	
• presence and condition of appropriate devices	✓
• readily accessible for operation where danger might occur	✓
• correct operation verified	✓
• clearly identified by position and/or durable marking(s)	✓
7.4 Functional switching	
• presence and condition of appropriate devices	✓
• correct operation verified	✓
8.0 Current-using equipment (permanently connected)	
8.1 Condition of equipment in terms of IP rating	✓
8.2 Equipment does not constitute a fire hazard	✓
8.3 Enclosure not damaged/deteriorated so as to impair safety	✓
8.4 Suitability for the environment and external influences	✓
8.5 Security of fixing	✓
8.6 Cable entry holes in ceiling above luminaires, sized or sealed so as to restrict the spread of fire (Indicate extent of sampling in Section D of report)	✓
8.7 Recessed luminaires (e.g. downlighters)	
• correct type of lamps fitted	✓
• installed to minimise build-up of heat by use of "fire rated" fittings, insulation displacement box or similar	✓
• no signs of overheating to surrounding building fabric	✓
• no signs of overheating to conductors/terminations	✓
9.0 Location(s) containing a bath or shower	
9.1 Additional protection for all low voltage (LV) circuits by RCD not exceeding 30 mA	✓
9.2 Where used as a protective measure, requirements for SELV or PELV are met	✓
9.3 Shaver sockets comply with BS EN 61558-2-5 or BS 3535	✓
9.4 Presence of supplementary bonding conductors unless not required by BS 7871: 2008	✓
9.5 Low voltage (e.g. 230 volts) socket-outlets sited at least 3 m from zone 1	✓
9.6 Suitability of equipment for external influences for installed location in terms of IP rating	✓
9.7 Suitability of equipment for installation in a particular zone	✓
9.8 Suitability of current-using equipment for a particular position within the location	✓
10.0 Other special installations or locations	
List special locations present, if any. List the results of particular inspections applied. - a separate page is required for each location	✓

* All boxes must be completed.

✓ Indicates Acceptable condition

LIM Indicates a Limitation

N/A Indicates Not applicable

Unacceptable condition state C1 or C2
Improvement recommended state C3
Further investigation required state F1
(to determine whether danger or potential danger exists)

Outcome
Provide additional comment where appropriate on attached numbered sheets: C1, C2 and C3 coded items to be recorded in section F of the report.

SCHEDULE OF CIRCUIT DETAILS FOR THE PRIMARY DISTRIBUTION BOARD

TO BE COMPLETED IN EVERY CASE		TO BE COMPLETED ONLY IF THE DISTRIBUTION BOARD IS NOT CONNECTED DIRECTLY TO THE ORIGIN OF THE INSTALLATION*			
Location of distribution board: SERVICE CUPBOARD	Supply to distribution board is from:	No of phases:	Nominal voltage:	V	
Distribution board designation: DB1	Overcurrent protective device for the distribution circuit:	Associated RCD (if any): BS (EN)			
	Type: BS (EN)	Rating:	A	RCD No of poles:	1
				I _{Δn}	mA

Original (to the person ordering the work)

CIRCUIT DETAILS											
Circuit number and line	Circuit designation	Type of wiring (see code below)	Reference method	Number of points served	Circuit conductors: csw			Overcurrent protective devices			
					Live	Up	Max. disconnection time permitted by BS 7671 (s)	BS (EN)	Type	Rating (A)	Short-circuit capacity (kA)
1	SERVICE SOCKETS	E	B	3	2.5	1.5	0.2	60898	B	32	6
2	GENTS WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
3	GENTS WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
4	GENTS WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
5	LADIES WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
6	LADIES WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
7	LADIES WASHROOM	E	B	1	2.5	1.5	0.2	60898	B	16	6
8	LADIES, STAFF LIGHTS + TIMBERLIN	A	C	13	1.5	1	0.2	60898	B	6	6
9	GENTS, STAFF STAFF LIGHTS + TUNING FLUSH	A	C	9	1.5	1	0.2	60898	B	6	6
10	OUTSIDE LIGHTS	A	C	5	1.5	1	0.2	60898	B	6	6
11											
12											
13											
14											
15											
16											
17											
18											
19											
20											
21											
22											
23											
24											
25											
26											
27											
28											
29											
30											

* In such cases, details of the distribution (sub-main) circuit(s), together with the test results for the circuit(s), must also be provided on continuation schedules.

↑ See Table 4A2 of Appendix 4 of BS 7671

CODES FOR TYPE OF WIRING								
A	B	C	D	E	F	G	H	U (Other - please state)
Thermoplastic insulated/sheathed cables	Thermoplastic cables in metallic conduit	Thermoplastic cables in non-metallic conduit	Thermoplastic cables in metallic trunking	Thermoplastic cables in non-metallic trunking	Thermoplastic /SWA cables	Thermosetting /SWA cables	Mineral-insulated cables	

SCHEDULE OF TEST RESULTS FOR THE PRIMARY DISTRIBUTION BOARD

TO BE COMPLETED ONLY IF THE DISTRIBUTION BOARD IS NOT CONNECTED DIRECTLY TO THE ORIGIN OF THE INSTALLATION				Test instruments (serial numbers) used:	
Characteristics of this distribution board					
Confirmation of supply polarity					
* See note below					
Z_s	Ω	Operating times of associated RCD (if any)	At $I_{\Delta n}$	ms	Earth fault loop impedance
I_{pl}	kA	At $I_{\Delta n}$ (if applicable)		ms	Insulation resistance
				Continuity	
				RCD	
				Mould function	
				Other	

TEST RESULTS

[illegible]

* *Note: Where the installation can be supplied by more than one source, such as a primary source (e.g. public supply) and a secondary source (e.g. standby generator), the higher or highest values must be recorded.*

TESTED BY

Signature: _____

Position: Electrician

Name: M. J. Jones
(CAPITALS)

Date of testing: 7-1-14

Page 8 of 12

This report is based on the model forms shown in Appendix 6 of BS 7671.
Published by NICEIC, a part of the Ascotiva Group © Copyright The Electrical Safety Council (July 2011)

See previous page for
Schedule of Circuit Details

Log Book – Outlet Temperatures (Sentinels & Representatives)

Month.....MAY 15.....

To comply with the specified control measures, water from the hot water outlets should reach at least 50°C within 1 minute of running (55°C in healthcare premises) and water from the cold water outlets should be below 20°C after running the water for up to 2 minutes. Sentinel outlets are the nearest and furthest outlets on a system or the first and last outlets on a recirculated system and must be monitored on a monthly basis. A representative amount on non sentinel outlets must be monitored annually on a rotational basis. Failures must be reported to the Responsible Person for further action in accordance with the written scheme.

Site Name:	Outlet Reference & Location:	Outlet Fed From:	Outlet Type (S/R)	Temperature in °C	Name:	Date:
Calstock, The Quay	Mens	MC		14.50	S. Vazquez	07.05.15
	beds	MC		11.4	S. Vazquez	07.05.15
Gunnislake, Car Park	Mens	MC		11.2	S. Vazquez	07.05.15
	beds	MC		11.6	S. Vazquez	07.05.15
Minnions	Mens	MC		10.2	S. Vazquez	07.05.15
	beds	MC		10.0	S. Vazquez	07.05.15
Pelynt	Mens	MC		12.2	S. Vazquez	07.05.15
	beds	MC		12.6	S. Vazquez	07.05.15
Polperro, Crumplehorn	Mens	MC		10.00	S. Vazquez	07.05.15
	beds	MC		10.2	S. Vazquez	07.05.15
Polperro, The Coombes	Mens	MC		10.2	S. Vazquez	07.05.15
	beds	MC		10.2	S. Vazquez	07.05.15

Polperro, Quay	Mens	MC		9.8	S. Ureaway	07.05.15
	Ladys	MC		9.8	S. Ureaway	07.05.15
Polruan	Mens	MC		10.0	S. Ureaway	06.05.15
	Ladys	MC		10.0	S. Ureaway	06.05.15
	Unisex	MC		12.0	S. Ureaway	07.05.15
Saltash, Belle Vue	Unisex	MC		11.6	S. Ureaway	07.05.15
Saltash, Longstone	Mens	MC		13.0	S. Ureaway	07.05.15
	Ladys	MC		12.6	S. Ureaway	07.05.15
Saltash, Tamar St	Mens	MC		12.0	S. Ureaway	07.05.15
	Ladys	MC		12.2	S. Ureaway	07.05.15
Talland Bay	Mens	MC		12.0	S. Ureaway	07.05.15
	Ladys	MC		12.6	S. Ureaway	07.05.15
Upton Cross	Mens	MC		11.2	S. Ureaway	07.05.15
	Ladys	MC		11.0	S. Ureaway	07.05.15

Outlet Fed From = Source of water i.e.: Water Heater No, Cold Water Storage Tank No, Mains Cold, etc

Outlet Type: S = Sentinel; R = Representative

