



Significant spalling to the top of the pediment
Location of greatest delamination/spalling to the underside of the pediment

Proposed Work Item	Work Description
F	Carry out delicate concrete repairs to the pediment and other required areas with existing, using skilled trades people, to carefully reproduce the colour, texture, profiles and lettering of the monument.
G	Rake out mastic/dirt filled gaps and open joints and fully infill with mortar.
H	Apply a migration corrosion inhibitor to all concrete surfaces.

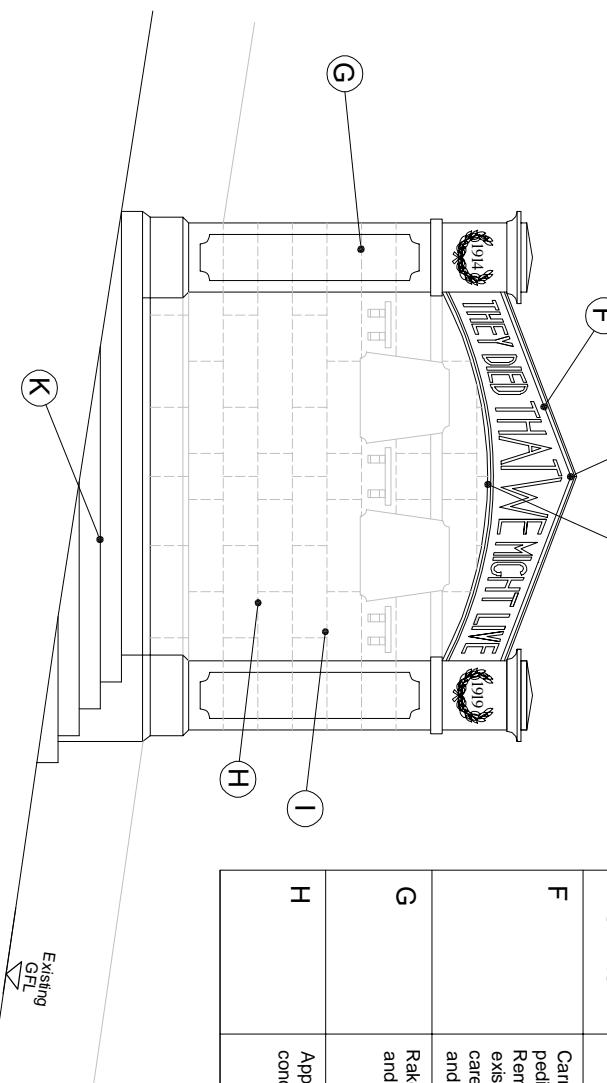


FRONT (NORTH WEST) ELEVATION

LAURELS, MEMORIAL CROFT WAR MEMORIAL CROMFORD ROAD

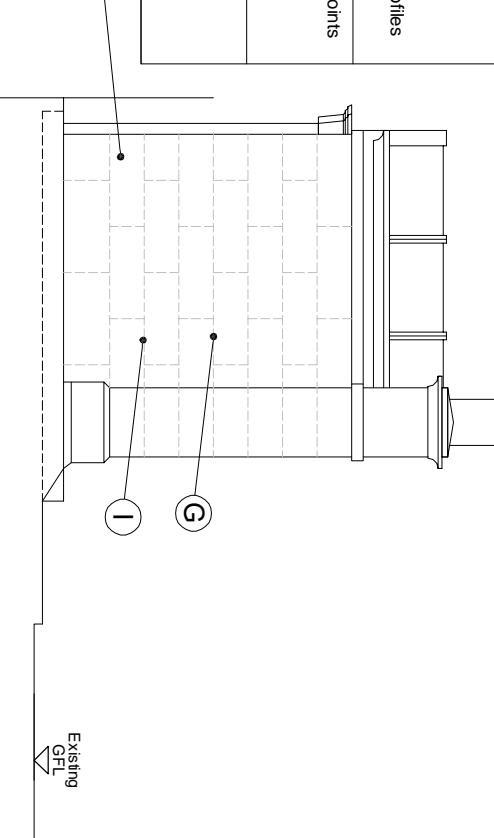

SIDE (NORTH EAST) ELEVATION

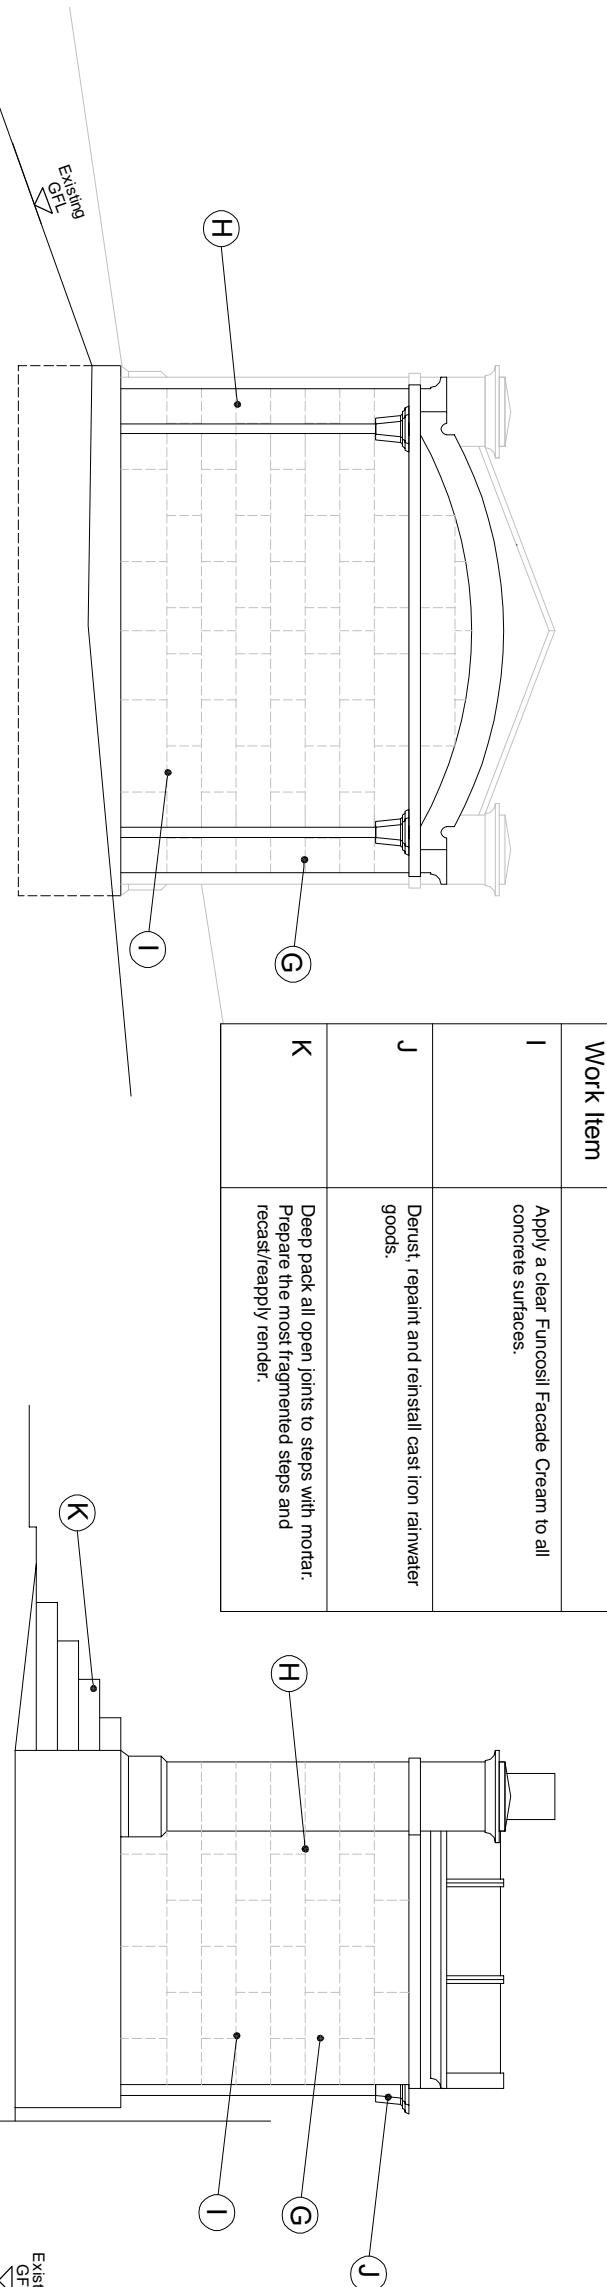

SIDE (SOUTH WEST) ELEVATION

REAR (SOUTH EAST) ELEVATION

A	02/02/2024	GS	-	Listed Building Consent
Rev	Date Drawn	Chkd		Amendment
BOLEHILL AND STEEPLE GRANGE WAR MEMORIAL				
ELEVATIONS PROPOSED				
Drawn	GS	Checked	-	
Scales	1:500 @ A3			
Drawing No	1305/P06	Rev	A	