


New DH5340 Fascia Brackets 87mm x 117mm  
 New Fascia Board 150mm x 38mm  
 New Ornamental Head H542A Corner  
 Existing bricks quins  
 New cast iron 100mm diameter downpipe


Eared shoe  
 75mm fall from kerb to gully grating  
 Slate min 75mm upstand against wall  
 Shoe min 25mm from gully  
 RC Slab min 50mm thick

Section AA' through gully


Cut slates to form bending  
 Slates to form edges  
 Engineering Bricks to form edge

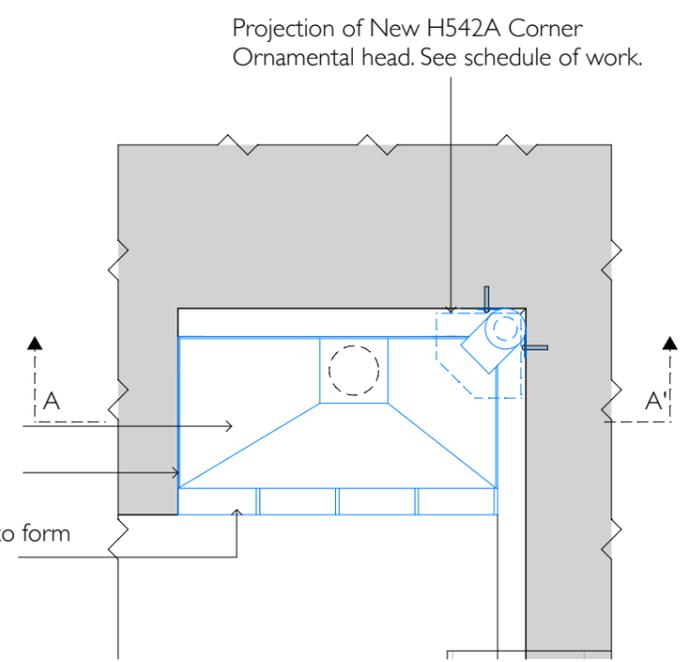

Detail 04 - Plan of Gully, West corner between Nave and South West Transept

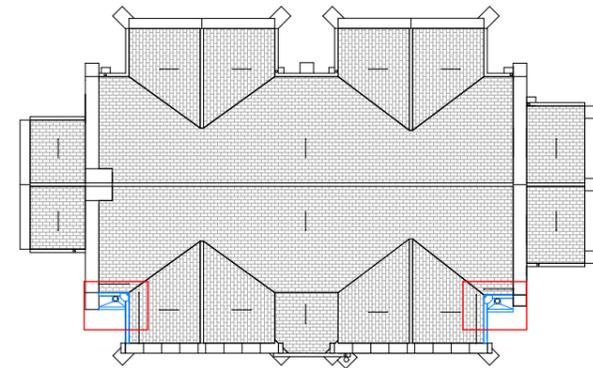

Roof Plan NTS



Note: Do not scale from drawing, check dimensions on site

This drawing is copyright ©

Drawing Title <b>Detail, Rainwater goods</b>	Job No <b>590</b>	Dwg No <b>/ 2105</b>	Rev <b></b>	Scale <b>1:20 @ A3</b>	Drawn:MSA <b>17/02/2017</b>
Revision	Date				
PCC and Churchwardens					
<b>Thetford Cemetery Chapel Repairs to South Side</b>					
<b>© Nicholas Warns Architect Ltd.</b>					
64 Bishopgate Norwich, NR1 4AA info@nicholaswarns.com					T: 01603 622056 F: 01603 627 393