


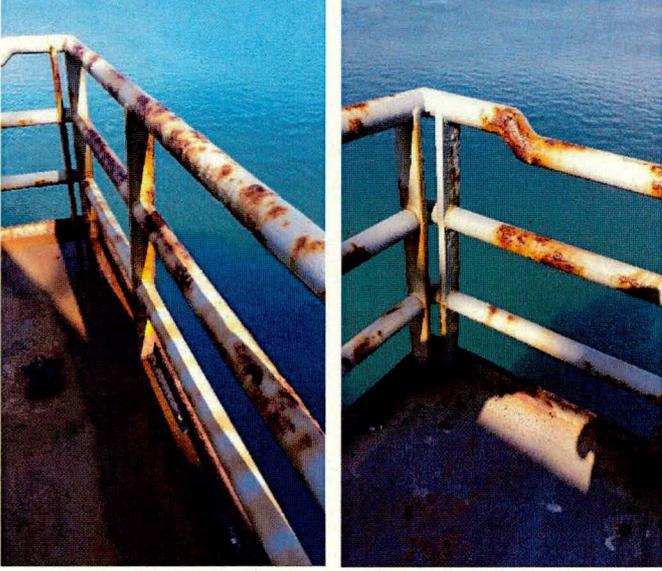

Guardrails have total paint covering breakdown in areas which has led to total thickness corrosion of tubular guardrails. Affected areas to be RENEWED including intermediate rails and end support fixings as shown. PRESERVE on completion.

ALLOW for 10m top rail and 6m intermediate rail RENEWAL. ALLOW for 6m² REPRESENTATION.

TASK NO.	TASK/DESCRIPTION	NOTES
H3.05	<p data-bbox="408 331 1219 360">H3 HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS</p> <p data-bbox="408 389 927 418">Port and Stbd Bridge Wing Guardrails</p> <div data-bbox="408 439 1070 1010">  </div> <div data-bbox="408 1025 1070 1373">  </div> <p data-bbox="408 1379 1219 1462">Stbd bridge wing guardrails show paint covering breakdown and active corrosion. REPRESENT all stbd guardrails. Port guardrail has severe full thickness active corrosion and requires RENEWAL.</p> <p data-bbox="408 1480 1219 1536">ALLOW for 8m guardrail RENEWAL. ALLOW for 20m² REPRESENTATION.</p>	<p data-bbox="1251 394 1449 566">Hotwork Required – Appropriate precautions to be taken IAW General 8.4.</p> <p data-bbox="1251 595 1449 707">IAW Paint scheme -General 12 and Annex B refer.</p> <p data-bbox="1251 736 1449 819">To be completed in conjunction with H2.15.</p> <p data-bbox="1251 848 1449 904">Complete IAW Ref. 5.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H3	HULL AND STRUCTURE – GUARDRAILS AND STANCHIONS	
H3.06	<p>Gundeck Guardrails</p>  <p>Strikable guardrails port and stbd are damaged and not fit for purpose. RENEW with fixed stanchions and permanent guardrails as fitted elsewhere on board. PRESERVE guardrails and deck area on completion.</p> <p>ALLOW for 15m guardrail RENEWAL. ALLOW for 10m² REPRESENTATION.</p>	<p>Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p>IAW Paint scheme -General 12 and Annex B refer.</p> <p>Complete IAW Ref. 5.</p>