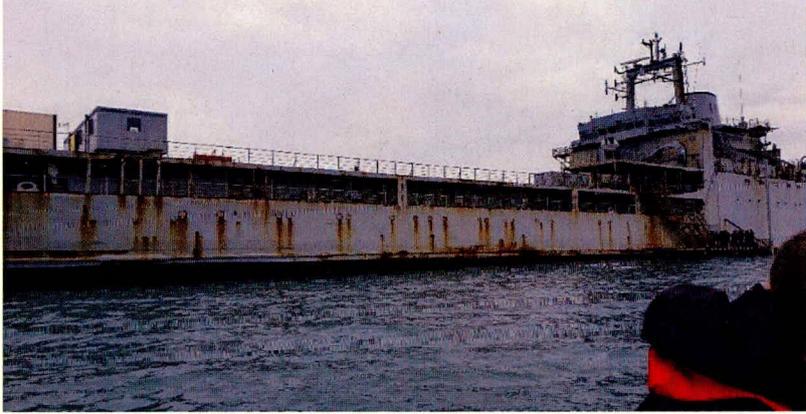
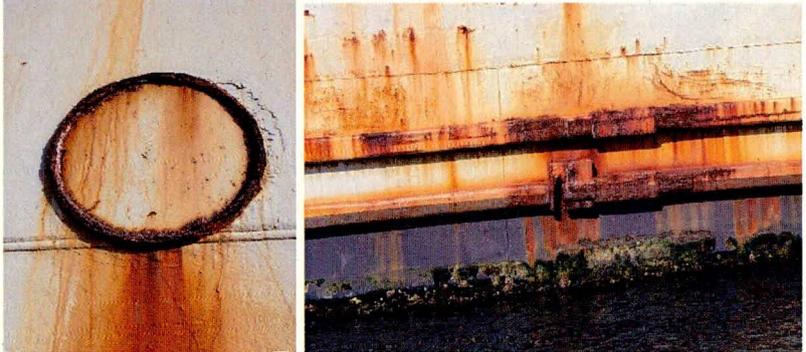
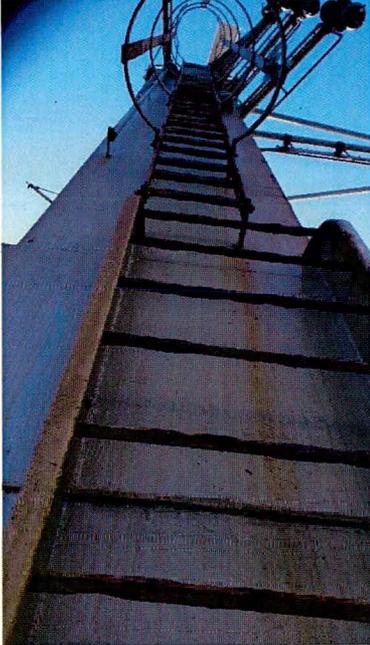


TASK NO.	TASK/DESCRIPTION	NOTES
H5.06	<p data-bbox="405 389 536 421">Topsides</p>    <p data-bbox="405 1677 1211 1821">Topsides showing extensive signs of paint coating breakdown and corrosion with subsequent gingering of paint coatings. REPRESERVE topsides up to and including the weather-deck boundary. Areas of active corrosion where there has been a breakdown of paint coatings to be spot blasted locally.</p> <p data-bbox="405 1832 1211 1888">ALLOW for 30m² spot blasting. ALLOW for 500m² REPRESERVATION.</p>	<p data-bbox="1246 394 1417 678">The Contractor must ensure this process is carried out in accordance with current Health and Safety requirements.</p> <p data-bbox="1246 707 1417 965">Costs of providing scaffolding and staging or other means of access to undertake this work is to be included.</p> <p data-bbox="1246 994 1445 1104">IAW Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H6 EXTERNAL LADDERS		
H6.01	<p data-bbox="400 383 746 412">Main Mast Ladder Chains</p>  <p data-bbox="400 1095 1212 1211">Main mast lower ladder rungs port and stbd have total breakdown of paint coating and excessive active corrosion which has reduced rung cross sectional area to approx. 50% of original. REFURBISH ladder, RENEW ladder rungs and REPRESENT on completion.</p> <p data-bbox="400 1223 1165 1252">ALLOW for 30 Rungs total. ALLOW for 10m² REPRESENTATION.</p>	<p data-bbox="1249 387 1450 555">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1249 589 1450 696">IAW Paint scheme -General 12 and Annex B refer.</p>

TASK NO.	TASK/DESCRIPTION	NOTES
H6.02	<p data-bbox="638 331 989 358" style="text-align: center;">H6 EXTERNAL LADDERS</p> <p data-bbox="411 389 944 421">Port and Stbd Access Platform Ladders</p> <div data-bbox="408 439 1241 936"> </div> <p data-bbox="408 954 1251 1124">Both port and stbd access platforms require ladders to be RENEWED due to current poor design. New design to be agreed with Authority's Authorised Representative. PRESERVE ladders on completion. Platforms will be removed prior to berthing for period of Refit, work to be conducted in shoreside facility. Ladders to be in place before platforms refitted to vessel.</p> <p data-bbox="408 1137 852 1169">ALLOW for 70m² REPRESENTATION.</p>	<p data-bbox="1251 394 1449 564">Hotwork Required – Appropriate precautions to be taken iaw General 8.4.</p> <p data-bbox="1251 595 1407 703">To be completed in conjunction with H1.02.</p> <p data-bbox="1251 734 1433 904">Design for new ladder to be approved by Authority's Authorised Representative.</p> <p data-bbox="1251 936 1449 1043">IAW Paint scheme -General 12 and Annex B refer.</p>