



Timber External Door for Repair; Elevation


External Timber Door for Repair; Section

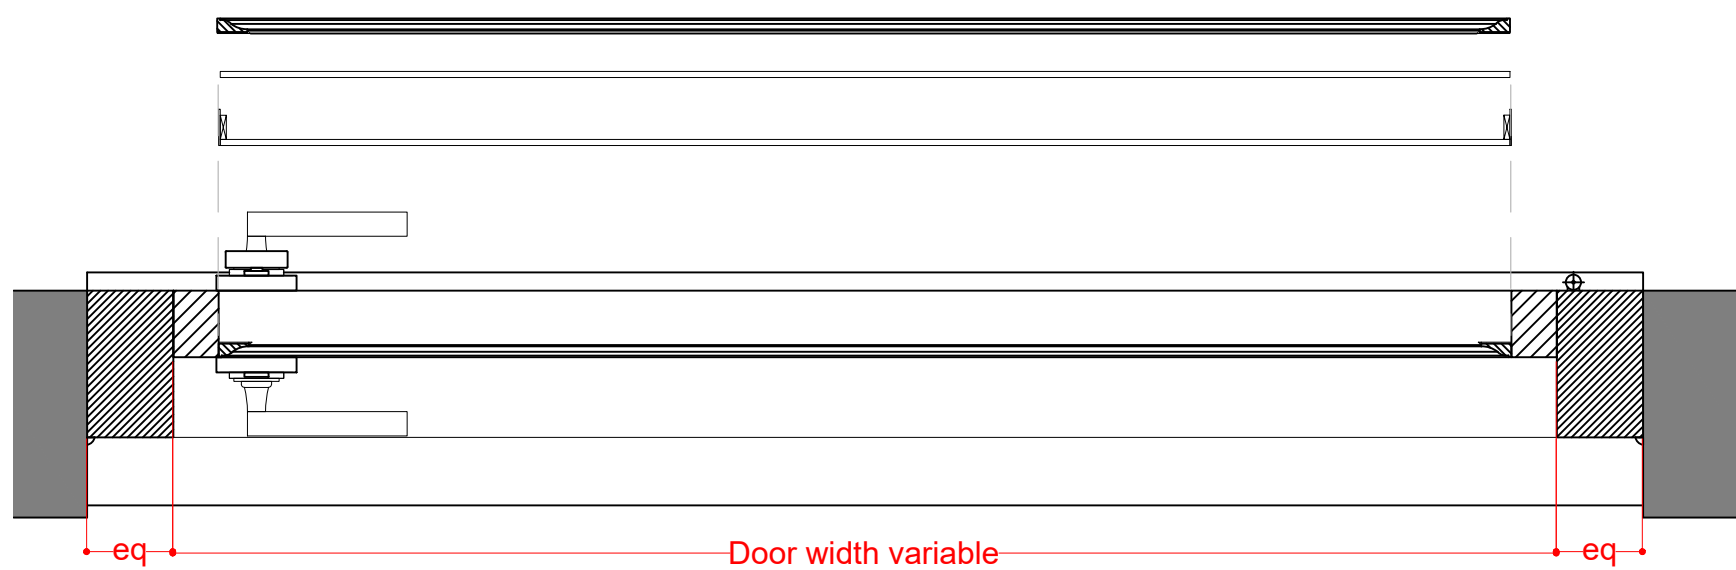

Glazed Fanlight Repair; Plan

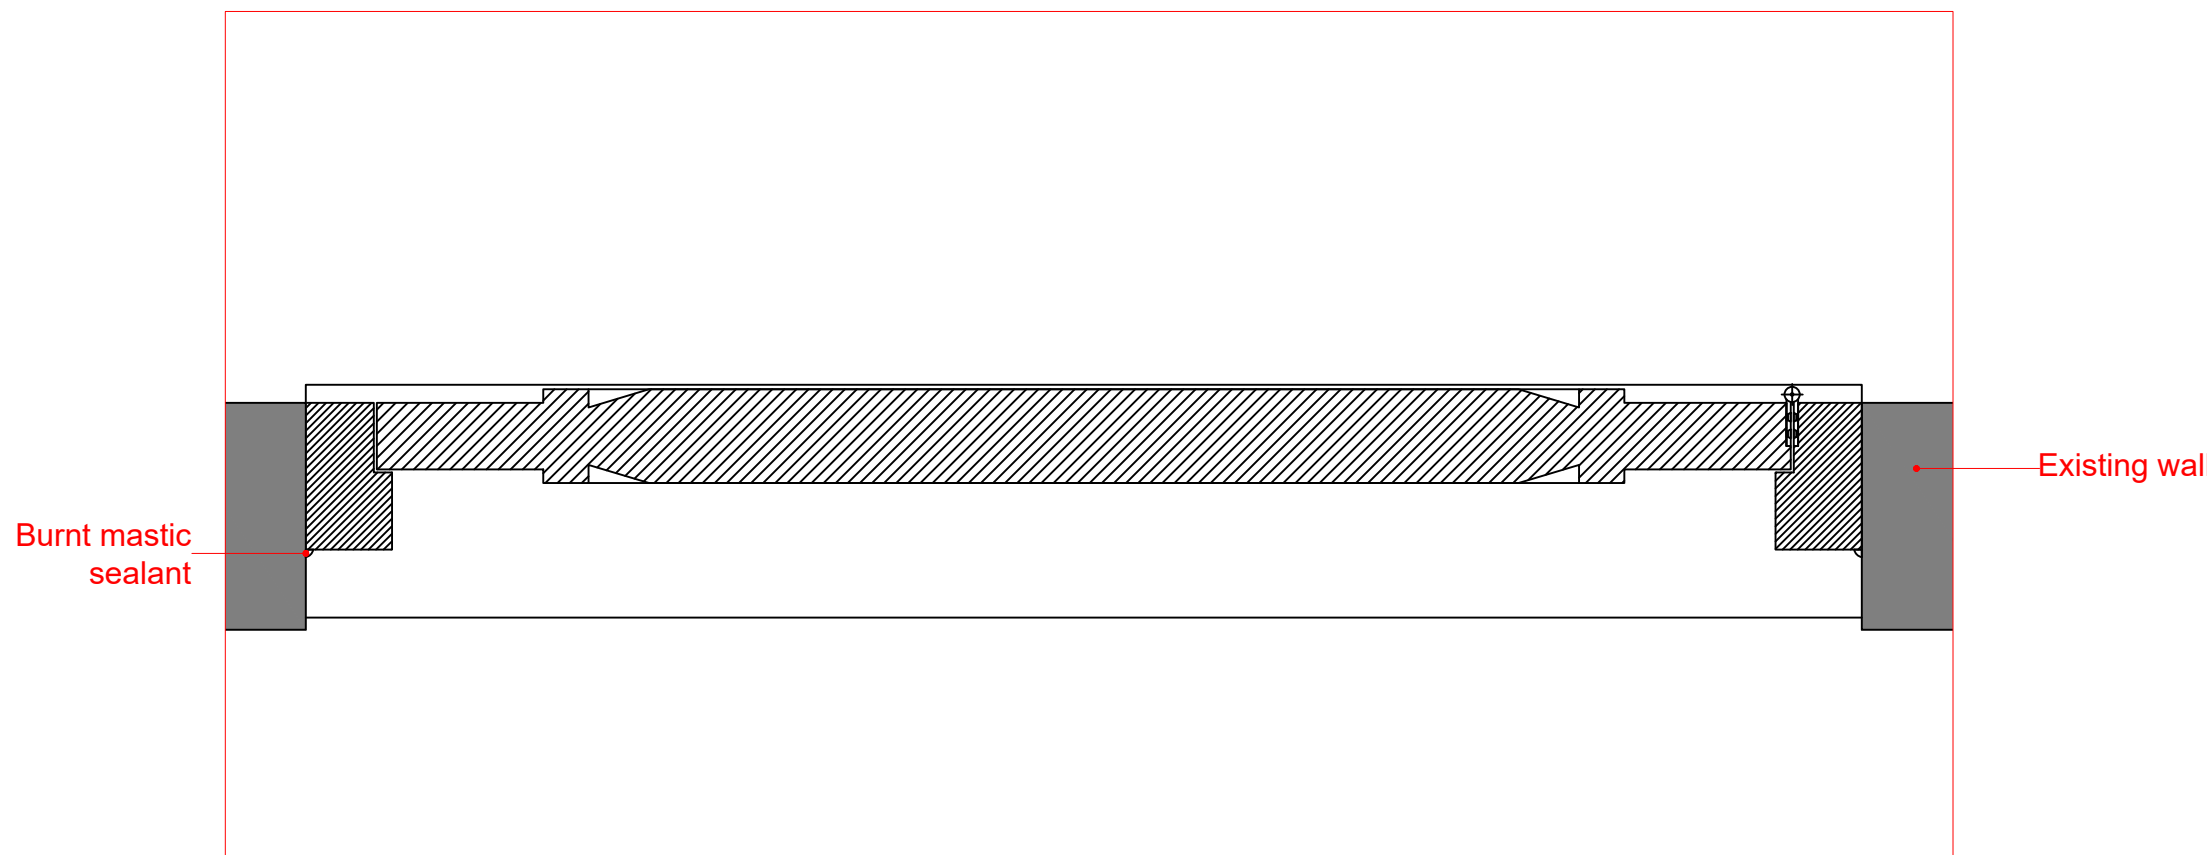


Internal Rotting Timber Repair; Plan

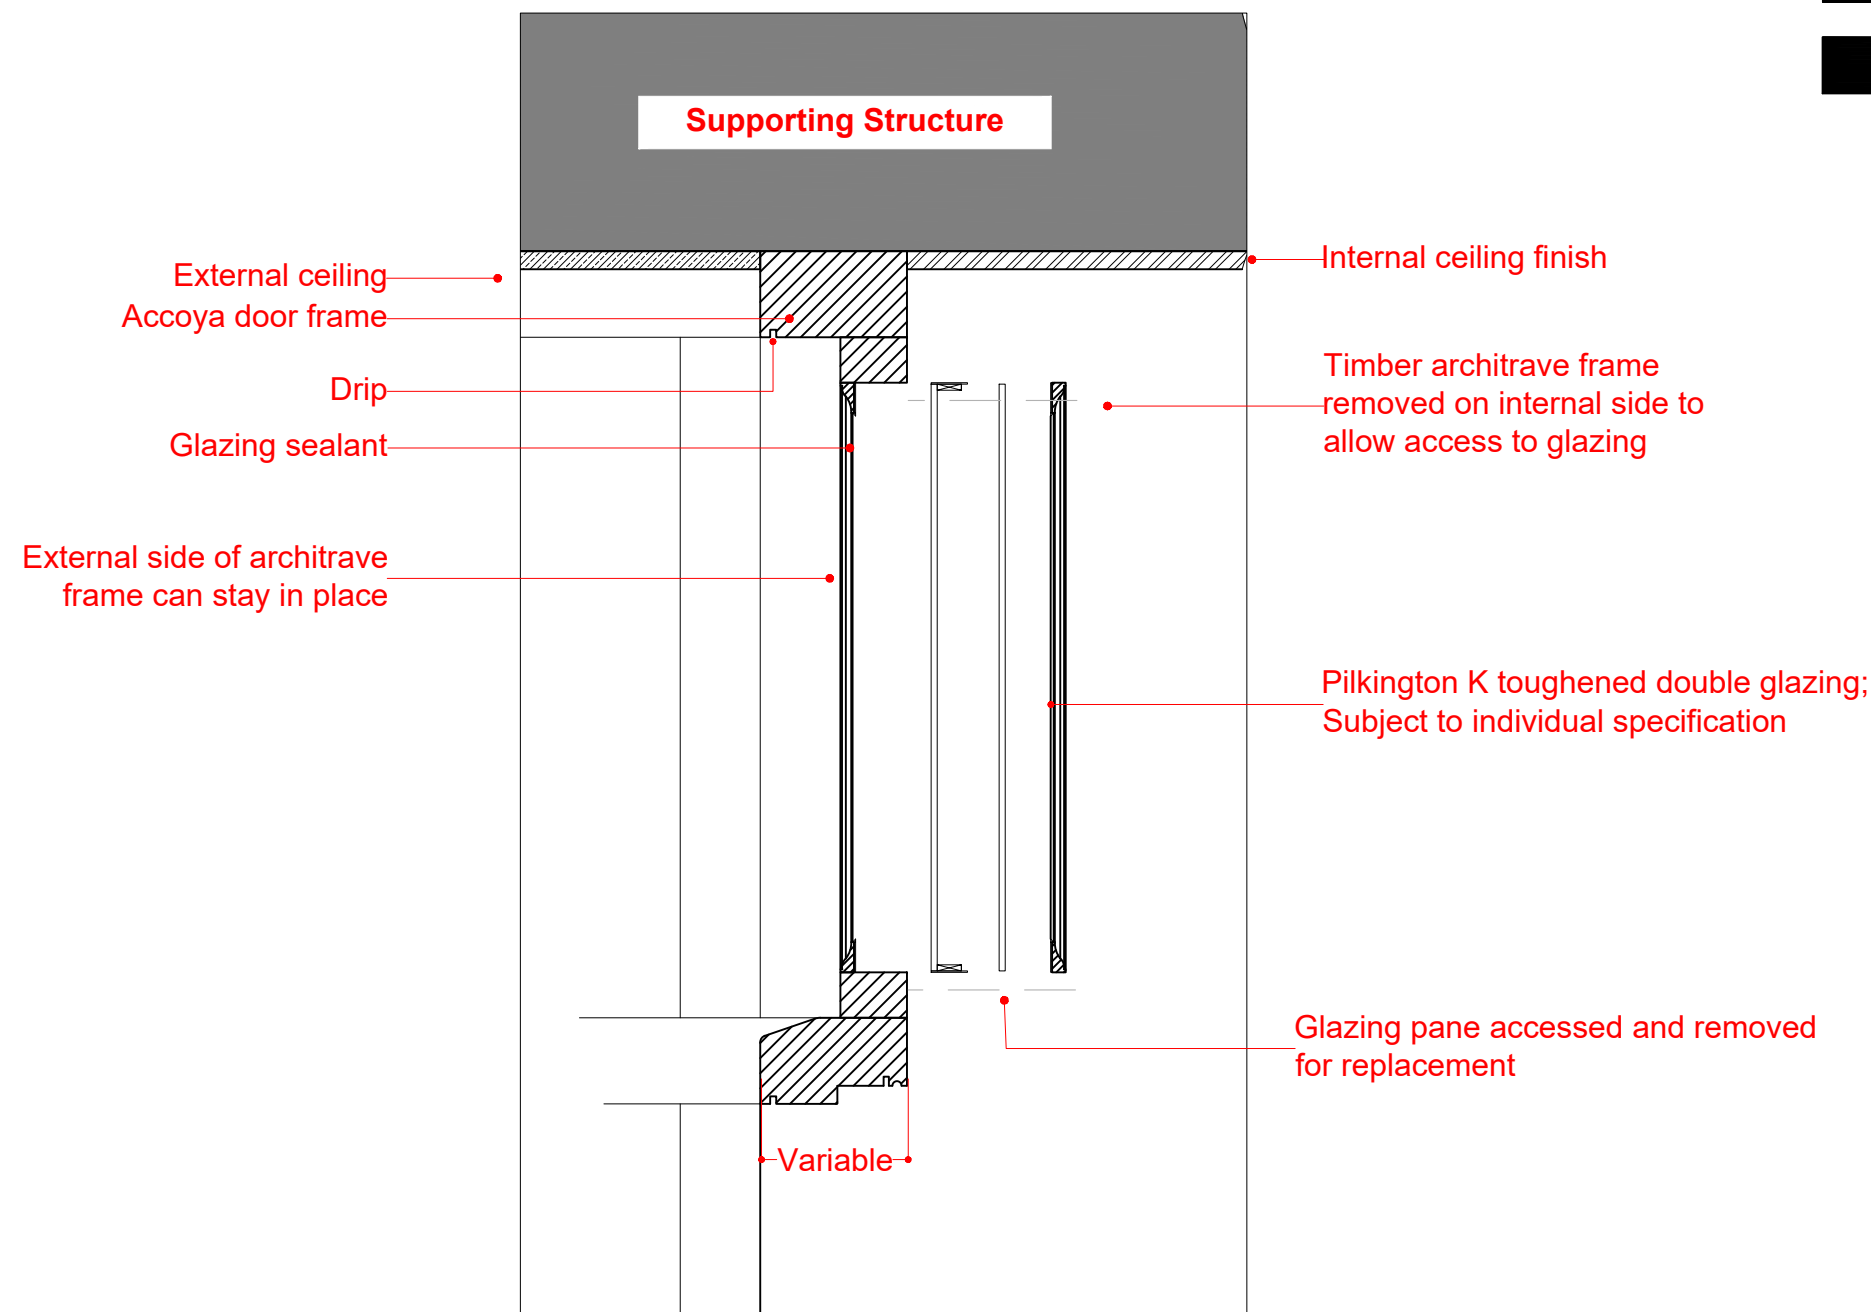

Glazed Transom Repair Detail; Replacement of Damaged Glass

Scale 1:5 @ A1

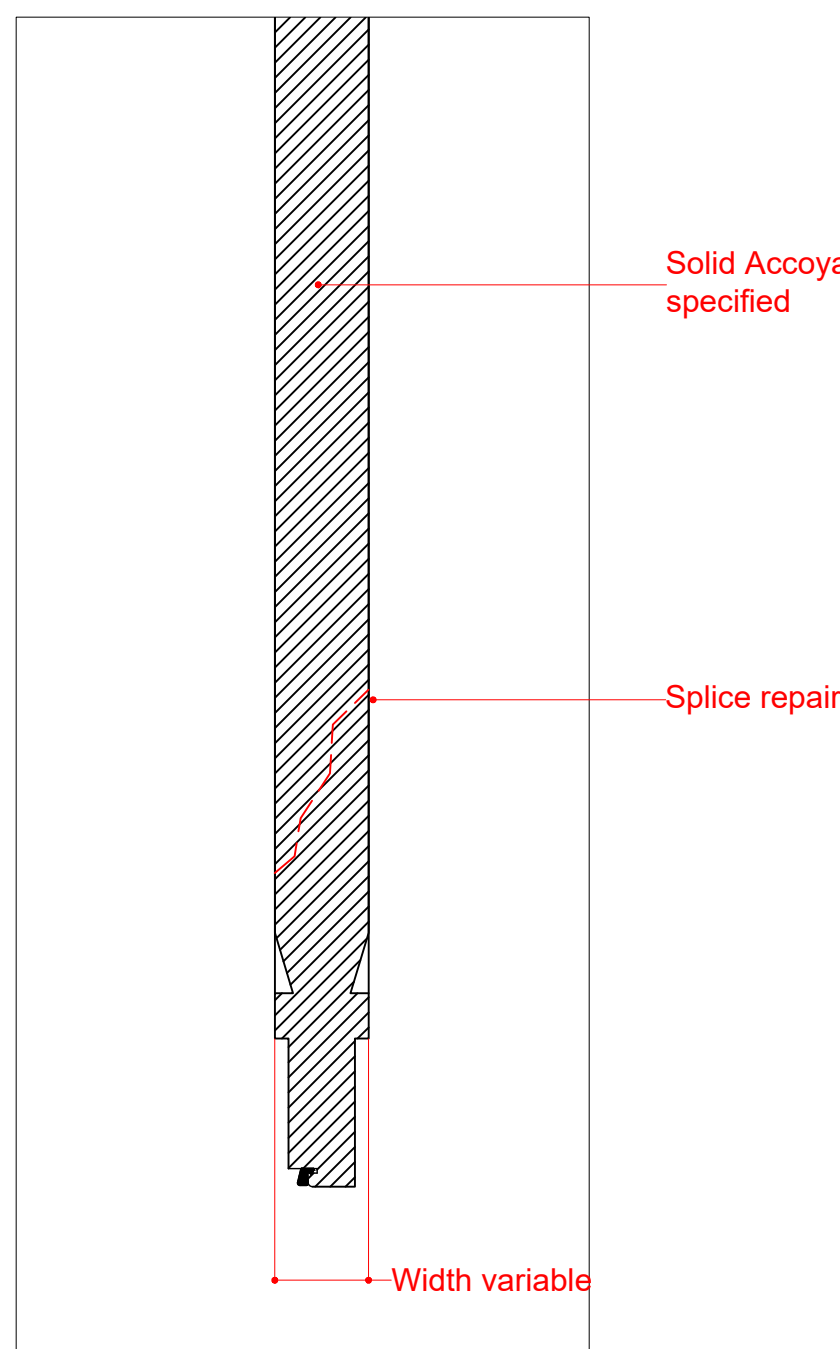

Splice Repair of Internal Timber Rot Detail

Scale 1:5 @ A1

Rev 11/12/2020 Tender Review
LB

Rev Date/Ints Details

© The moral rights of the author are hereby asserted.
This drawing and design is the sole property of Buttress Ltd and must not be reproduced without permission.
Buttress Ltd is Registered in England and Wales, 348372.

Buttress

41 Bengal St
Manchester
M4 6AF

T 0161 236 3303
E contact@buttress.net
W www.buttress.net

Project Title	Bacup Derelict Buildings		
Client	Rossendale Borough Council		
Location	Bacup		
Drawing Title	External Timber Door Glazed - Repair Detail Drawings -		
Date	11/12/2020	Scale	1:10 & 1:5
Checked	KC	Orig Paper Size	A1
		Status	Tender
Drawing ref	Job No	Drawing No	Revision
	8920	(32) 004	B