


104•02 STAIR ROOF PLAN - EXISTING
1:100@ A1

-  Areas to be removed/demolished
-  Existing areas of ponding
-  Existing soft spots of roof surface

- Roofs R2 & R4
Samafil covering circa: 1989.
- R2 parapet:
Brick parapets with aluminium coping
- R3 parapet:
Brick parapets with insitu cast concrete coping.
Sand cement rendered inner face in poor condition.
- R4 triangular roof above lift = aluminium?
- RL2 Steel framed rectangular rooflight with monopitch roof fixed to concrete upstand.
Georgian Wire armoured glazing - all in poor condition.
- RWP 5 & 6
110 x 110mm cast iron downpipes with hoppers and shoes discharging onto main roof.

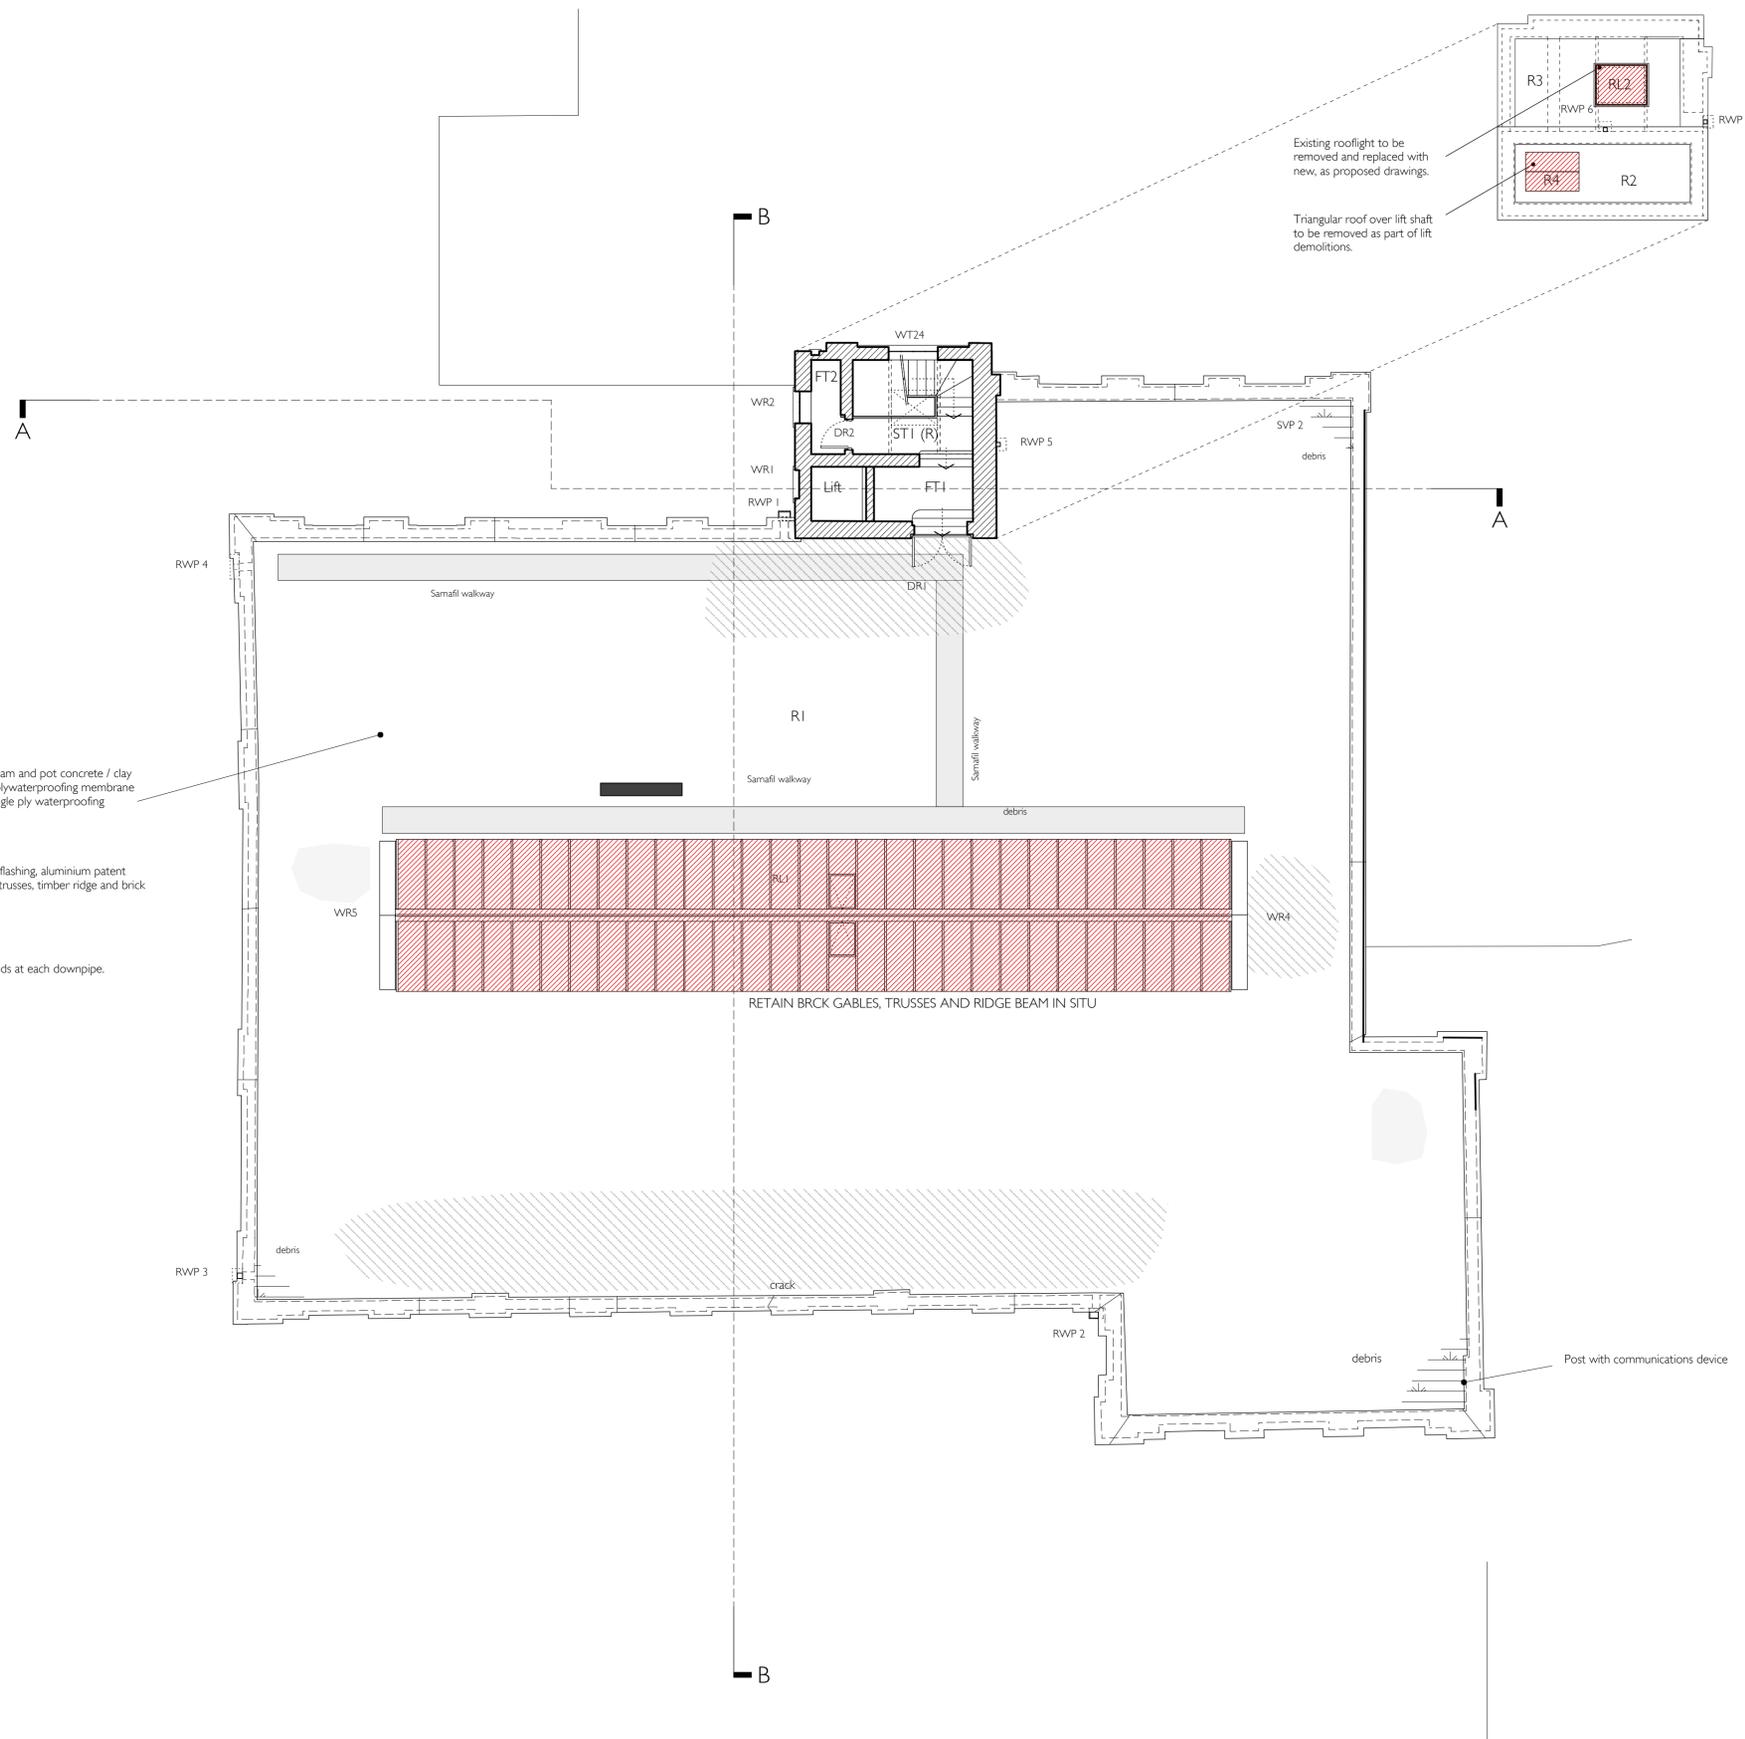

R1 - Main roof.
Samafil Roof covering circa 1989.

Substrate: Existing warm roof comprising of a beam and pot concrete / clay deck, 20mm asphalt, PIR insulation and a single plywaterproofing membrane overlaid with a separation fleece and another single ply waterproofing membrane.

Areas of ponding / debris shown by shading.

Rooflight: Remove all rooflight to include: Ridge flashing, aluminium patent glazing sections, glass and flashings. Retain steel trusses, timber ridge and brick kerb / upstand in situ.

Refer to proposed drawings 976•340+

Lightning conductor:
Taped to parapets and rooflight with earthing rods at each downpipe.

Existing rooflight to be removed and replaced with new, as proposed drawings.

Triangular roof over lift shaft to be removed as part of lift demolitions.

104•01 ROOF PLAN - EXISTING
1:100@ A1

Rev A : 18 / 10 / 2018
Notes updated

Initial Issue : 09 / 06 / 2016
To Building Regs

976 / 104A

Trowbridge Museum Redevelopment
The Shires, Court Street, Trowbridge
Wiltshire, BA14 8AT
for Trowbridge Town Council

ROOF PLAN
EXISTING

1:100 @ A1 May 2016

ARCHITECTON

The Wool Hall 12 St Thomas Street
Bristol BS1 4JJ
t 0117 9105200 f 0117 9260221
e info@architecton.co.uk

