

NORTH ELEVATION

## WEST ELEVATION




Panels of Monument 43 stacked on site in January 2020

Approximate anticipated reconstruction of monument based on assessment of surviving pieces. Top of urn does not appear to be present but may be found elsewhere on the site.

Clean stonework (volunteers)

Build up honeycomb brickwork core walls off existing base within tomb to support lid 10mm above top of side and end panels. 50mm space between face of brickwork and back of panels. Reassemble monument on existing rubble killas foundation base, repairing broken panels and cramping panels to each other and to brickwork core. Re-bed top, plinth to cap, cap and urn with stainless steel dowels to secure the top sections together.

15.63 Point all joints and joints between panels.

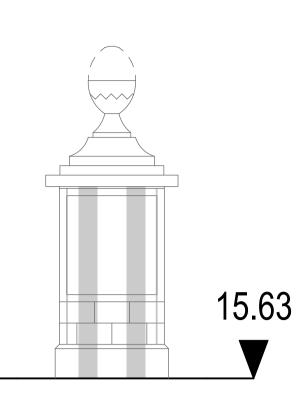


Approximate anticipated reconstruction of monument based on assessment of surviving pieces. Top of urn does not appear to be present but may be found elsewhere on the site.

Clean stonework (volunteers)

Build up honeycomb brickwork core walls off existing base within tomb to support lid 10mm above top of side and end panels. 50mm space between face of brickwork and back of panels. Reassemble monument on existing rubble killas foundation base, repairing broken panels and cramping panels to each other and to brickwork core. Re-bed top, plinth to cap, cap and urn with stainless steel dowels to secure the top sections together.

Point all joints and joints between panels.

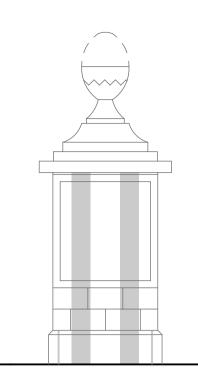


SOUTH ELEVATION

## EAST ELEVATION



Panels of Monument 43 laid out on site in January 2021

## C43 William Devonshire Monument

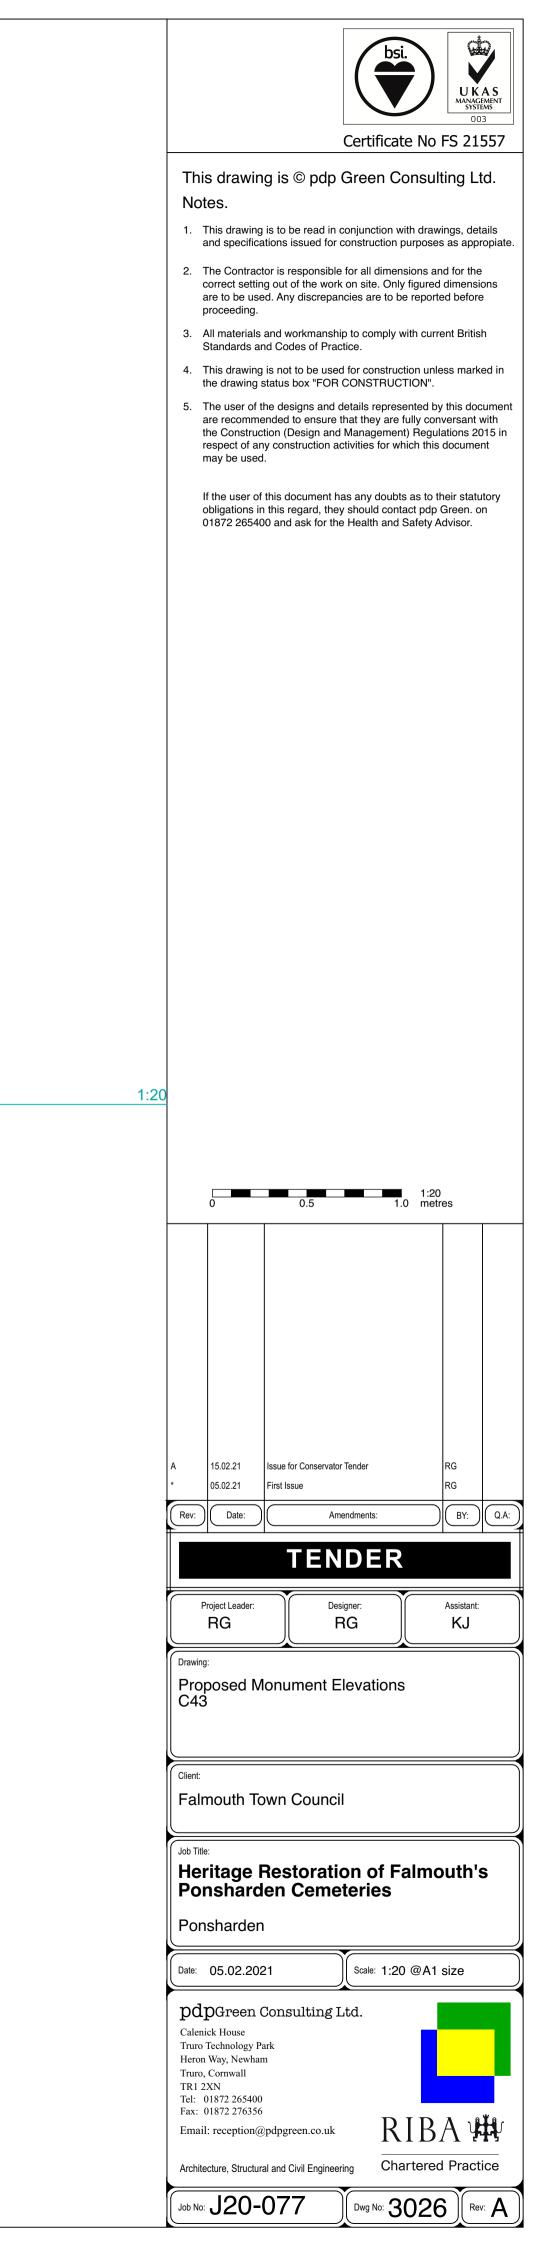

15.63